

Instruction Manual XENAX® Xvi 75V8

Translation of "Anleitung XENAX® Xvi 75V8"

Edition January 2016

Compact Ethernet Servo Controller


EtherCAT®

PROFI®
NET

EtherNet/IP™

CANopen®

ETHERNET
POWERLINK

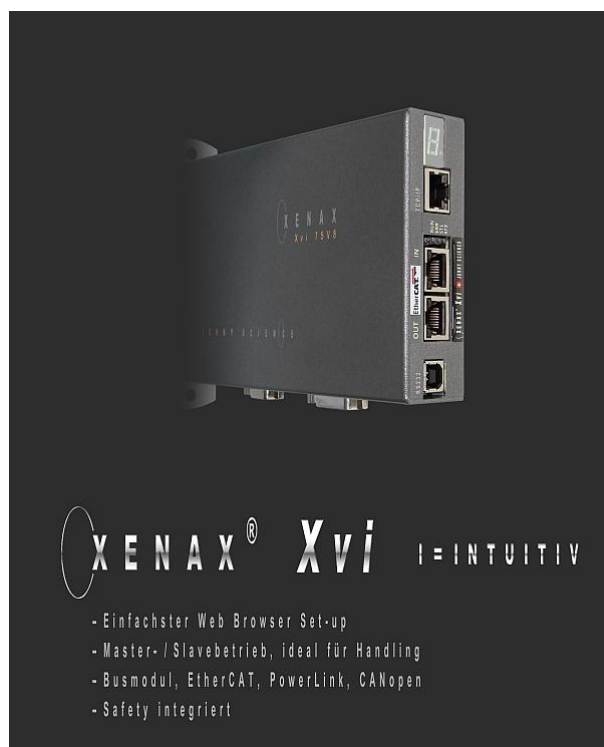

Parameterization over Web browser

The integrated webserver allows a setup and parameterization over web browser.

After an automatic self-check, the connected LINAX® linear motor axis or ELAX® electric slide can instantly be set in motion by click on the Quick Start Button.

This XENAX® Xvi 75V8 is setting new standards in terms of intuitive handling.

General

The XENAX® Xvi 75V8 Ethernet servo controller controls all series of the LINAX® linear motor axes and the ELAX® electric slide product family. It is also possible to control servo motors series RAXx (ultra-compact rotary axes) and RT-xx (round table with hollow shaft).

Customary rotary AC/DC/EC servo motors for example from FAULHABER® or MAXON® can also be operated by the XENAX® Xvi 75V8.

The logic supply (24V DC) and the intermediate circuit voltage (24V – 75V DC) are separately connectable. This is how “Safety Torque Off” is possible as a standard.

Master-Slave function, Force Calibration (compensation of the cogging forces in iron core linear motors) and optional “Safety” functionalities such as SS1, SS2, or SLS are further features of this compact XENAX® Xvi 75V8 servo controller.

Contents

1 Characteristics XENAX® Xvi 75V8	7
1.1 Electronics / Firmware	7
1.2 Performance / Options	7
1.3 Dimensions	8
2 Controllable Motor Types	9
2.1 Linear Motor Axes and Electric Slides	9
2.2 Servo Motors in our Product Line	9
2.3 Customary Servo Motors	10
3 Hardware and Installation	10
3.1 Environmental Conditions	10
3.2 Assembly and Installation	10
4 Functional Safety - TÜV certified	11
4.1 Hardware Requirements	11
4.2 Safety Standards	11
4.3 Basic Conditions	12
4.4 Technical Data Safety	13
4.5 Safety Functions	14
4.5.1 STO, Safe Torque Off	14
4.5.2 SS1, Safe Stop 1	14
4.5.3 SS2, Safe Stop 2	14
4.5.4 SLS, Safely Limited Speed	15
4.6 Functional Safety Parameterization in WebMotion®	15
4.6.1 Display Active Safety Parameters	15
4.6.2 Modification of Safety Parameters	15
5 UL	17
5.1 Ratings	17
6 Electrical Connections	18
6.1 Plug Arrangement	18
6.2 Plug Pin Configuration	18
6.2.1 RS232	18
6.2.2 Motor Plug 3 Phase	19
6.2.3 Logic and Power Supply	19
6.2.4 Encoder and Hall Signals	20
6.2.5 Definition of Rotating Direction for Servo Motors	20
6.2.6 OPTIO Pulse/Dir, Second Encoder Channel	21
6.2.7 PLC I/O	22
6.3 Internal I/O Circuit	23
6.4 Output Configuration	24
7 Configuration Motor Type Linear / Rotary	25
8 RS232 Serial Interface	26
8.1 Baud Rate RS232 XENAX®	26

9	ETHERNET TCP/IP Interface	26
9.1	Baud Rate Ethernet Gateway (XPort)	26
9.2	Default Setup Records Upgrade	28
9.3	Test IP Connection with >IPCONFIG	29
9.4	Test Connection with >PING	29
9.5	Change IP Address with “Device Installer”	29
9.6	Communication Settings XPort	30
9.7	PORT Address	30
10	ASCII Protocol	31
10.1	ASCII Protocol TCP/IP	32
10.2	Asynchronous Messages (Events)	32
11	Install JAVA Plugin	33
11.1	Applet Cache	34
11.2	Disable Java certificate Validation	35
12	WebMotion®	35
12.1	Start WebMotion®	36
12.1.1	Error „Upload XENAX Settings®“	36
12.2	Quick Start only with LINAX® and ELAX® linear motor axis	37
12.3	Operation, Status Line	38
12.4	Move Axis by Click	39
12.4.1	Move Axis by Click for LINAX®/ELAX® Linear Motors	39
12.4.2	Move Axis by Click for Rotary Motors	41
12.5	Move Axis by Command Line	41
12.6	ASCII Command Set for XENAX®	42
12.6.1	Power / Reset	42
12.6.2	Basic Settings	42
12.6.3	Motor Settings	42
12.6.4	Controller Settings	43
12.6.5	Motion Settings	43
12.6.6	Reference LINAX® / ELAX®	44
12.6.7	Reference Gantry	44
12.6.8	Reference Rotary Motors	44
12.6.9	Move Commands	45
12.6.10	Index / Moves with I_Force (programmed movements)	45
12.6.11	Program / Application	46
12.6.12	Event	46
12.6.13	Input / Output	46
12.6.14	Limit Position ELAX®	47
12.6.15	Force Control	48
12.6.16	Correction Table	50
12.6.17	System Information	50
12.6.18	Bus Module Information	51
12.6.19	Error Handling	51

12.6.20 System Monitoring	51
12.7 Move Axis by Force	52
12.8 Move Axis Motion Diagram	52
12.9 Index	54
12.10 Drive I_Force	54
12.11 Sector I_Force	55
12.12 Program	55
12.12.1 Program commands	56
12.13 I/O Functions	58
12.13.1 Selection of Input Functions	59
12.13.2 Selection Output Functions	60
12.14 Profile (Velocity)	61
12.15 Captured Pos	62
12.16 State Controller	63
12.16.1 F Setting	66
12.17 Motor	69
12.17.1 Motors LINAX® and ELAX®	69
12.17.2 Motor Rotary Servo Motors	70
12.18 Reference	71
12.18.1 Reference LINAX®	71
12.18.2 Reference ELAX®	72
12.18.3 Reference Rotary Servo Motors	74
12.18.4 Correction Table for LINAX® / ELAX®	75
12.19 Basic Settings	78
12.20 Version	78
12.21 Update Firmware / WebMotion®	79
12.22 Save	80
12.23 Open	80
13 Master / Slave	81
13.1 Master/Slave Configuration	81
13.2 Programming example Pick&Place	82
13.3 Timing Master / Slave	82
14 Gantry Synchronized Mode	83
14.1 Activate Gantry Mode	83
14.2 ASCII Commands for Gantry Synchronized Mode	84
15 Force Processes	85
15.1 Overview FORCE Functions	85
15.1.1 Force Calibration	85
15.1.2 Force Limitation	86
15.1.3 Force Monitoring	87
15.1.4 Force Control	88
15.2 Integration of Force Processes	89
15.2.1 XENAX® in Program	89

15.2.2 Over Command Set	91
15.2.3 Sector Offset for Touching Position	93
15.3 Application Example	94
15.3.1 Programming Force Process in XENAX®	95
15.3.2 Force Process with ASCII Commands	97
16 Operating Status on 7-Segment Display	99
17 Error Handling	99
17.1 Error Codes	99
17.2 Notes for Error 50	102
17.3 Notes for Error 89	103
17.4 Arbitrary Display on 7-Segment	105
17.4.1 Defective adapter for logic supply	105
17.4.2 Defective Firmware	105
17.4.3 GAL contact problems, only with hardware <=2.0	106

1 Characteristics XENAX® Xvi 75V8

1.1 Electronics / Firmware

Description	Data
Interfaces	Ethernet, TCP/IP, http web server Puls/direction, Master Encoder, I/O IIC Master/Slave, Start-up Key RS232
Bus, multi-axis operation	EtherCAT (CoE), DS402 Ethernet POWERLINK, DS402 CANopen, DS 402 PROFINET (PROFIdrive) EtherNet/IP, DS402 Ethernet Switch, TCP/IP
Safe Motion Unit SMU	Security module, 2-channel monitoring TÜV certified
	SIL 2 Safety Integrity Level 2 Cat 3 Category 3 PL d Performance Level d MTTFd 1733313 h
Status indication	7-Segment LED
Input digital	12 x 24V Pull down
Output digital	8 x 24V, 100mA Source or 400mA Sink
Input function	8 inputs to start a function or program
Output function	8 outputs to indicate a condition
Reference for rotary motors	free to define, incl. external sensor
Index	50 motion moves (accl. / speed / distance, position)
Profile	5 extended motion profiles with 7 profile segments each.
Number of application programs via input	15, Input 9-12 binary coded (MODE >=10)
Firmware update	Over TCP/IP, Flash-memory internal
Application and parameter update	Over TCP/IP, Flash-memory internal




1.2 Performance / Options

„LG“ logic supply	24VDC / max. 1.3 A
„PW“ power supply motor	12-75VDC
3- Phase Output frequency	0-599 Hz
Nominal current	0-8A
Peak current	18A
Continuous power / dissipation loss	Typical 48V / 3A / 150W / $\eta \approx 85\%$ / $P_v = 22W$
Temperature monitoring output stage	Shutdown at 80°C
Excess voltage – observation	> 85V
Under voltage – observation	< 10V
Ballast circuit	up to 80W
Fuse power	10AF
Motor temperature observation with LINAX®/ELAX®	Shutdown at 80°C
linear motor, sensor in coils	
PLC Input	8 Inputs, 24V
PLC Input BCD	4 Inputs, 24V, binary coded for program selection
PLC Output	8 Outputs, 24V, Source 100mA, Sink 400mA, Source/Sink

Options

EtherCAT (CoE)	DS402, Beckhoff®, OMRON®, TRIO® MC
POWERLINK (CoP)	DS402, B&R®
CANopen	DS402
EtherNet/IP	DS402, Allen-Bradley
PROFINET (PROFIdrive)	SIMATIC, SIMOTION, SINUMERIK
SMU Safety Functions	STO Safe Torque Off SS1 Safe Stop 1 SS2 Safe Stop 2 SLS Safely-Limited Speed
Start-up Key	ID number for Master Slave and application memory.

1.3 Dimensions

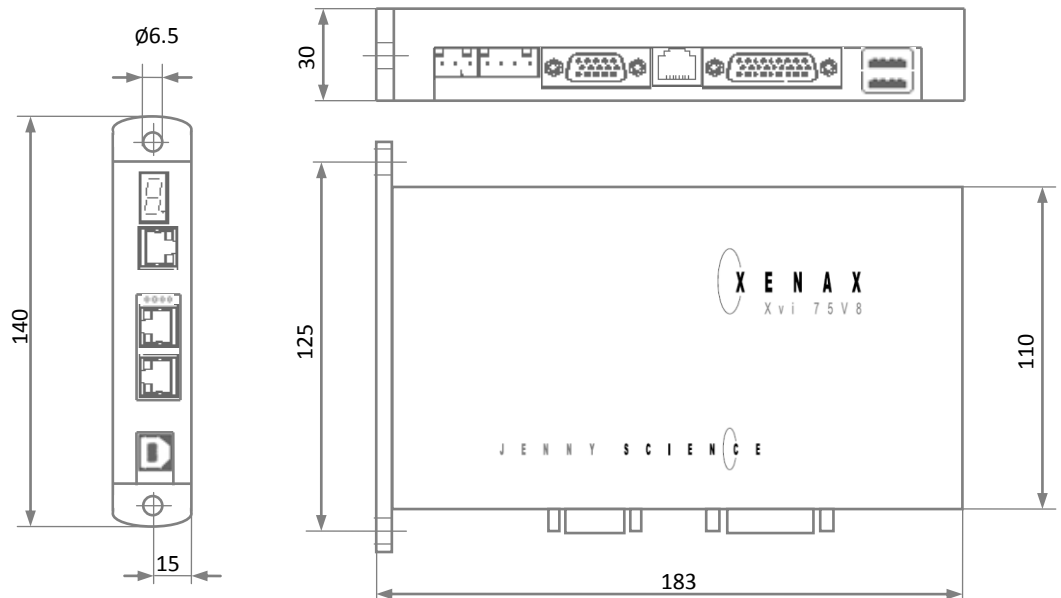

Dirt resistance	IP 20
Weight	550g


2 Controllable Motor Types

2.1 Linear Motor Axes and Electric Slides

LINAX® Linear Motors

3 phase synchronous linear motor with encoder RS422 A/A*, B/B* und Z/Z* and distance-coded reference marks.

Special feature:
Linear motor identification and temperature monitoring over I2C bus.

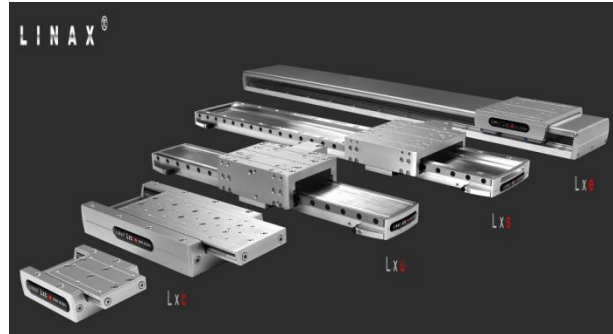

ELAX® Electric Slides with Linear Motor

ELAX® is the evolutionary step of the widespread pneumatic slides. The great accomplishment is the patented compact integration of the linear motor in the slider case, resulting in a force/volume ratio which has hitherto never been achieved.

Special feature:
Linear motor identification and temperature monitoring over I2C bus.



2.2 Servo Motors in our Product Line

Lafert, RAxx, RTxx

AC-Servo motors with encoder A/A*, B/B* and Z/Z* and hall sensors e.g. AEG B28 D4 0,4Nm, 6000 U/min. Optionally available with brakes for vertical applications.



2.3 Customary Servo Motors

Faulhaber®, Maxon®

AC / DC / EC brushless servo motors with incremental encoder RS422 A/A*, B/B* and Z/Z* and hall sensors, as well as DC brush-type servo motors with incremental encoder.

For brushless AC/EC servo motors there are hall signals and incremental encoder necessary.



3 Hardware and Installation

3.1 Environmental Conditions

Storage and transport	No outdoor storage. Warehouses have to be well ventilated and dry. Temperature from -25°C up to +55°C
Temperature while operating	5°C -50°C environment, after 40°C performance reduction
Humidity while operating	10-90% non-condensing
Air conditioning	No external air conditioning needed; integrated heat sink.
MTBF	> 120'000h for housing internal temperature of < 50°C

3.2 Assembly and Installation

Assembly with two screws on an electrically conductive rear wall e.g. the back wall of a switch cabinet.

For a series mounting the distance between the devices has to be at least 10mm and the distance to the floor has to be at least 40mm.



We recommend mounting the devices in vertical orientation to ensure a good cooling air circulation.



4 Functional Safety - TÜV certified

4.1 Hardware Requirements

In order to use the TÜV certified safety functions a XENAX® Servo controller equipped with an optional Safety Motion Unit (SMU) is needed.

The SMU module has to be ordered by the client with a separate article number.

XENAX® Servo controllers can only be upgraded to SMU with hardware V 4.0 or higher. SMU modules can only be mounted by Jenny Science. SMU modules will only be supplied when mounted into a XENAX® Servo controller.



Functional Safety
SIL 2, PL d, Cat. 3

Legal Note:

In case of any modification or attempts of modification on the hardware by third parties, the TÜV certification is no longer guaranteed and Jenny Science declines all liability.

4.2 Safety Standards

<p>EN 61508-1:2010 EN 61508-2:2010 EN 61508-3:2010 Functional safety of electrical/ electronic/programmable safety-related systems</p>	<p>SIL 2 Safety Integrity Level 2</p>
<p>EN ISO 13849-1:2008 Safety of machinery, Safety-related parts of control systems</p>	<p>Cat 3 Category 3 PL d Performance Level d MTTF_d 1733313 h</p>
<p>EN 61800-5-2:2007 Adjustable speed electrical power drive systems</p>	<p>Safety Functions: STO Safe Torque Off SS1 Safe Stop 1 SS2 Safe Stop 2 SLS Safely-Limited Speed</p>
<p>EN 61800-5-1:2007 Adjustable speed electrical power drive systems</p> <p>EN 60068-2-6:2008 EN 60068-2-27:2010 EN 60068-2-1:2008 EN 60068-2-2:2008 EN 60068-2-78:2010</p>	<p>Vibration- Shock- and Environmental Testing:</p> <p>Vibration (sinusoidal) Half-Sine Shock Cold Test Dry heat Test Damp heat Test</p>

<p>EN 61000-6-2:2005 Electromagnetic compatibility (EMC), Immunity for industrial environments</p> <p>EN 61326-3-1 IFA:2012 EN 61326-1, EN 61800-3, EN 50370-1</p>	<p>EMC Immunity Testing, Industrial Class A</p> <p>Immunity for Functional Safety Functional safety of power drive systems Electrostatic discharges ESD, Electromagnetic Fields, Fast electric transients Bursts, radio frequency common mode</p>
<p>EN 61000-6-3:2001 Electromagnetic compatibility (EMC), Emission standard for residential, commercial and light-industrial environments</p> <p>EN 61326-1, EN61800-3, EN50370-1 IFA:2012</p>	<p>EMC Emissions Testing, Residential Class B</p> <p>Radiated EM Field, Interference voltage Functional safety of power drive systems</p>

4.3 Basic Conditions

<p>Motor Types</p>	<p>Functional Safety with SMU can be used for all LINAX® and ELAX® linear motors axes, as well as rotary brushless motors with different A/B/Z encoder signals. Rotary brush type DC motors are not subject to the functional safety.</p>
<p>Signaling</p>	<p>A possible signaling to the user of the safety state has to be completed with an external controller with a safety output.</p>
<p>Commissioning</p>	<p>The configuration assessment has to be warranted by the client for each modification of the functional safety and its parameters through commissioning.</p>
<p>External Devices</p>	<p>Devices which are connected to the XENAX® servo controller over I/O's or a communication line, have to provide a basic insulation or an impulse test according to EN 60947-1 or a comparable standard.</p>

4.4 Technical Data Safety

Process safety time (between appearance of a potential dangerous error until reaction time of the SMU)	< 5ms										
Reaction time of the security inputs (until activation of a safety function)	< 1ms										
Activation of a safety function	Switching on two channel to 0V One-channel switched safety inputs lead to turn off of the power stage and requires a restart of the XENAX® servo controller.										
Level of safety inputs	>21.0V safety input inactive < 2.0V safety input active Voltage levels outside of these limits are prohibited.										
Hierarchy of safety functions	<table border="1"> <thead> <tr> <th>Hierarchy</th> <th>Safety Functions</th> </tr> </thead> <tbody> <tr> <td>4</td> <td>STO Safe Torque Off</td> </tr> <tr> <td>3</td> <td>SS1 Safe Stop 1</td> </tr> <tr> <td>2</td> <td>SS2 Safe Stop 2</td> </tr> <tr> <td>1</td> <td>SLS Safely Limited Speed</td> </tr> </tbody> </table> <p>Safety functions of higher hierarchy levels overdrive the ones below.</p>	Hierarchy	Safety Functions	4	STO Safe Torque Off	3	SS1 Safe Stop 1	2	SS2 Safe Stop 2	1	SLS Safely Limited Speed
Hierarchy	Safety Functions										
4	STO Safe Torque Off										
3	SS1 Safe Stop 1										
2	SS2 Safe Stop 2										
1	SLS Safely Limited Speed										
Deceleration ramps for SS1 Profile Position Mode and Cyclic Synchronized Position Mode (RT-Ethernet)	Trough parameter ED (Emergency Deceleration)										
Deceleration ramps for SS2 Profile Position Mode Cyclic Synchronized Position Mode (RT-Ethernet)	With Parameter ED (Emergency Deceleration) Indicated by superior master controller										
Deceleration ramps for SLS Profile Position Mode Cyclic Synchronized Position mode (RT-Ethernet)	After speed infringements through parameter ED (Emergency Deceleration) Indicated by superior master controller										


4.5 Safety Functions

4.5.1 STO, Safe Torque Off

According IEC 61800-5-2

Immediate shut-down of the output stage.


Parameter:
None

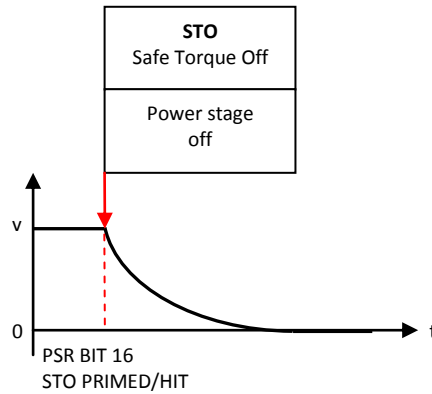

4.5.2 SS1, Safe Stop 1

Stop followed by shut-down of the output stage
(Stop category 1)


Parameter:
Timeout Stop Δt_1 Standard 300ms

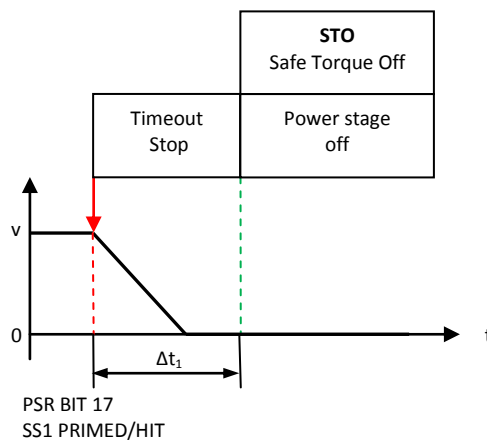

4.5.3 SS2, Safe Stop 2

Stop while remaining in stop position, axis remains under power, power stage active. Then observation of stop-position, status SOS (Safe Operating Stop). If exceeding the position limit, STO will be triggered. Shut-down of the output stage (stop category 2)


Parameter
Timeout Stop Δt_1 Standard 300ms
Position window Δs Standard ± 2500 Inc

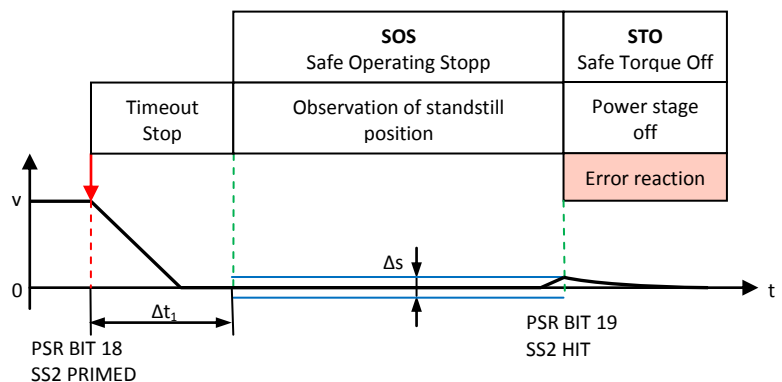

4.5.4 SLS, Safely Limited Speed

Observation of a safe speed. If Safety Limited Speed (SLS) is exceeded, Safe Stop (SS2) while observing the position window. If position window is exceeded as well, then triggering STO, shut-down of the output stage. Adjustment of speed during SLS time out has to be specified by user.

Parameter:			
Timeout SLS	Δt_2	Standard	300ms
Safely Limited Speed	v_{max}	Standard	+/-50'000 Inc/s
Timeout Stop	Δt_1	Standard	300ms
Position window	Δs	Standard	+/-2500 Inc

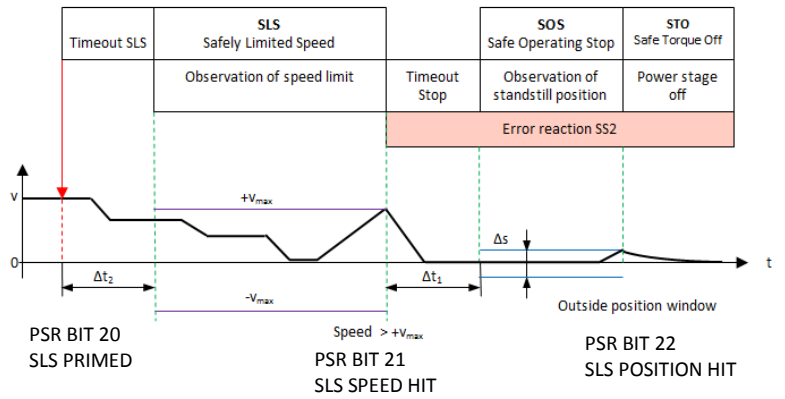


4.6 Functional Safety Parameterization in WebMotion®

4.6.1 Display Active Safety Parameters

The defined Safety Functions and parameters are shown in WebMotion® in the menu *application/io*. This safety information can only be read, not modified.

The parameters of the Safety Functions can be made visible by pressing „Safety Param“.

Please refer to chapter 11: “WebMotion®” for further explanations on WebMotion® interface.

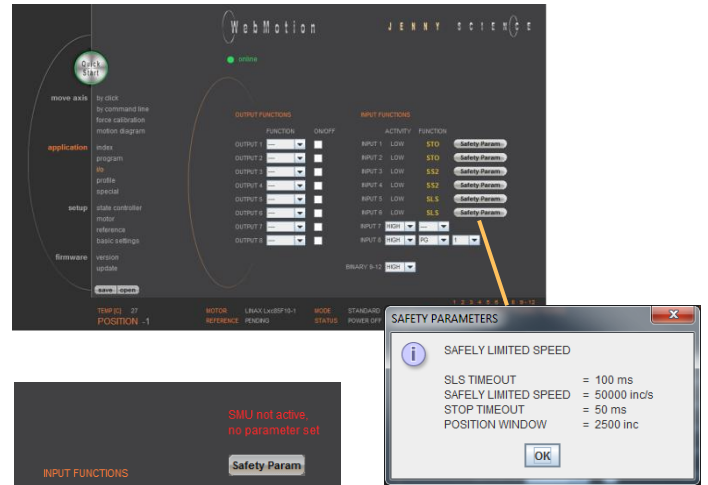


If there is a Safety Motion Unit in the XENAX® and no parameter would be assign. It will show it, in red, over the Input Function and a button appears where you can directly switch to the Safety page to enter the parameter.



4.6.2 Modification of Safety Parameters

The safety parameters can be modified with WebMotion® and the functional safety login:

Enter IP address of the XENAX® servo controller and add „/SAFETY.html“ in Web browser. E.g. <http://192.168.2.190/SAFETY.html>

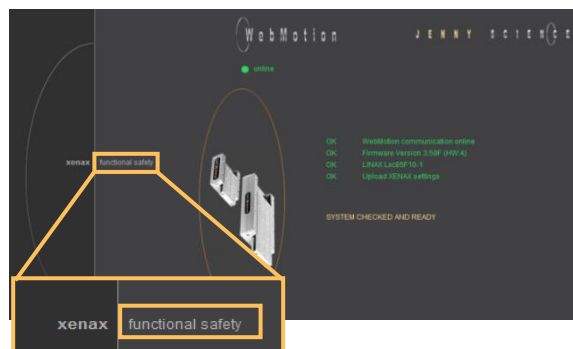

Password: **SafetyXvi75V8**
„OK“

Note: Please pay attention to capital and small letters.



Actual

Current safety parameters of XENAX® servo controller with SMU.

New

This is where new safety parameters can be selected from the drop down menu. They are activated in XENAX® servo controller by pressing „save“.

save

to XENAX®:

The modified safety parameters are being sent to XENAX® / SMU. The active parameters are visible in the column XENAX®.

to File:

The safety parameters on the SMU are saved into a file.

open




Safety parameters can also be loaded from a pc file.

In order to be activated on the XENAX® servo controller, the parameters have to be saved by pressing on the *save* → to XENAX.

ED x 1000

The Parameter ED „Emergency Deceleration“ muss be set as big, that STOP and SLS Timeout can be hold by stopping.

By pressing „EXIT“ you exit functional safety and get back to WebMotion®.

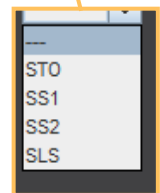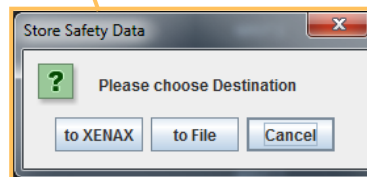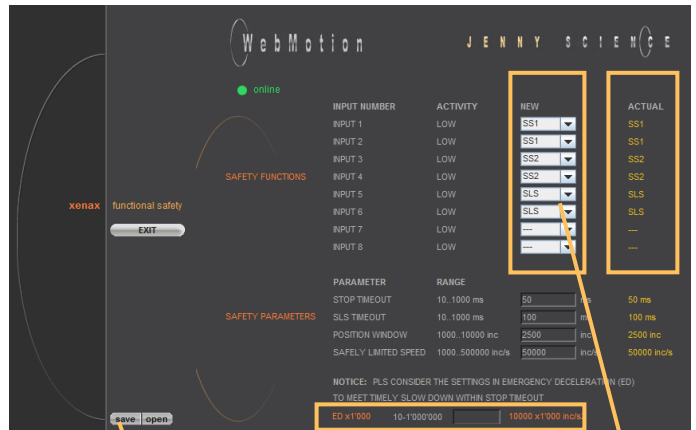

Note: The Signal of an active safety function has to be operated by a higher level control system.

5 UL

For UL-conformity, the XENAX® servo controllers need to be used with the Brake Energy Converter from Jenny Science AG to guarantee voltage levels during dynamic braking within DVC A Levels.


Please refer *Manual_Brake_Energy_Converter.pdf*

5.1 Ratings

Description	Data
Input (PW) Input (LG)	24 – 36 VDC max. 6.93 A 15.59A peak 24 VDC max 1.3 A
Output (Motor)	0 – 25.5V ac, 3phase, 5.7A, 18A peak
Power Supply	These products are intended for operation within circuits not connected directly to the supply mains (galvanically isolated from the supply). The XENAX® Servocontroller/s need to be used with the Brake Energy Converter to stay within the 36 DVC A Limits
	Integral solid state short circuit protection does not provide branch circuit protection. Branch circuit protection must be provided in accordance with the National Electrical Code and any additional local codes. For Canada (ENG): Integral solid state short circuit protection does not provide branch circuit protection. Branch circuit protection must be provided in accordance with the Canadian Electrical Code, Part I. For Canada (F): Des protections intégrées, à relais statique, contre les court circuits, ne protègent pas contre les circuits de dérivation. Une protection contre les circuits de dérivation doit être fournie conformément au code canadien de l'électricité, Partie I.
Maximum Surrounding Air Temperature	+ 45°C
Temperature Wago Connectors	-60°C ... 100°C
Motor Overload Protection for motors other than the LINAX® / ELAX® Linear Motors	External or Remote Motor Overload Protection and overtemperature sensing need to be provided.
Motor Overload Protection for the LINAX® / ELAX® Linear Motors	The proper connection and the rating of the load imposed by the equipment on the protector contacts. Power output: 0-25.5 VAC, 3 phase, 5.7 A, 18 A peak
UL File Nr.	E477533, Link to file , Link to file Canada

6 Electrical Connections

XENAX® Xvi 75V8

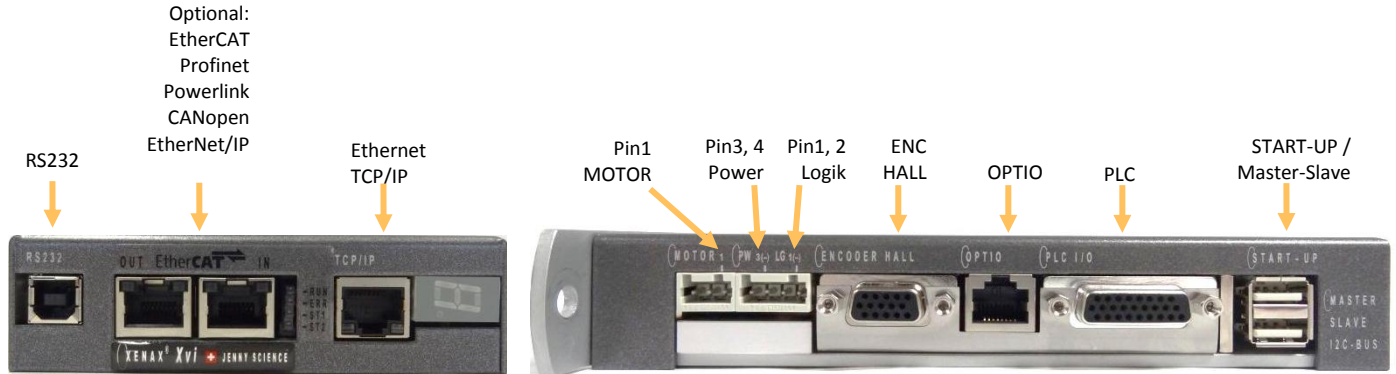

6.1 Plug Arrangement

Description	Plug Type
RS232	USB-B socket
Real time Ethernet (optional)	2 x RJ45 socket with status LED
CANopen (optional)	9 Pol socket D-Sub
Ethernet TCP/IP	RJ45 socket with status LED
MOTOR	3 pole plug Wago, pitch 3,5mm
POWER / LOGIK	4 pole plug Wago, pitch 3,5mm
ENCODER HALL	15 pole plug D-Sub High Density
OPTIO	8 pole socket RJ45
PLC I/O	26 pole plug D-Sub High Density
START-UP / MASTER-SLAVE	2 x 4 pole plug USB-A


6.2 Plug Pin Configuration

6.2.1 RS232

USB-B Socket

The serial interface RS232 is led over a 4 pole USB-B socket.

USB Socket	XENAX®	PC/SPS
1	N.C.	
2	RX	TX
3	TX	RX
4	GND	GND

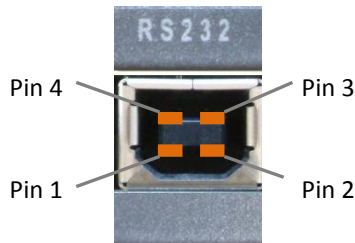

6.2.2 Motor Plug 3 Phase

Wago 3 Pole Plug	LINAX® / ELAX® 3 Phase	Servo motor 3 Phase	DC Motor
1	U (white)	U	DC +
2	V (brown)	V	DC -
3	W (green)	W	

6.2.3 Logic and Power Supply

Wago 4 Pole Plug			
1	0, GND	Adapter logic	
2	24V DC		
3	0, GND	Adapter power	
4	12-75V DC		

The typical POWER supply is 24V DC. For the stronger LINAX® F40 / F60 axes with high masses (>2kg) or high dynamics (>1.5m/s) a POWER supply of 48V or 72V DC is applicable. Power demand for one Axis is 3-5A / for two axes 5-7A / for 3 axes 7-10A.

Important: The 0 volt connection of the logic supply (pin 1) and the 0 volt connection of the power supply (pin 3) have to be connected to the ground/chassis star point of the switch cabinet.

Note:

In case of emission sensitivity it is recommended to twist the supply cable for logic and power.



6.2.4 Encoder and Hall Signals

15 pole D-Sub socket	Signal	Description
1	GND	Together, for encoder and hall 0V supply, only 1 pin
2	5V Encoder	150 mA for encoder supply
3	Encoder A	Pull up 2,7kΩ to 5V, differential input 26LS32
4	Encoder A*	Middle level: pull up 2,7kΩ to 5V, Pull down 2,2kΩ, differential input 26LS32, 330Ω internal between Pin3/4
5	Encoder B	Pull up 2,7kΩ to 5V, differential input 26LS32
6	Encoder B*	Middle level: pull up 2,7kΩ to 5V, pull down 2,2kΩ, differential input 26LS32, 330 Ω internal between Pin5/6
7	Encoder Z	Pull up 2,7kΩ to 5V, differential input 26LS32
8	Encoder Z*	Middle level: pull up 2,7kΩ to 5V, pull down 2,2kΩ, differential input 26LS32, 330 Ω E internal between Pin7/8
9	HALL 1	Pull up 2,7kΩ to 5V, differential input 26LS32
10	HALL 1*	Middle level: Pull up 2,7kΩ to 5V, pull down 2,2kΩ, differential input 26LS32
11	HALL 2 / -TMP	Pull up 2,7kΩ to 5V, differential input 26LS32 / over temperature signal motor
12	HALL 2*	Middle level: Pull up 2,7kΩ to 5V, Pull down 2,2kΩ, differential input 26LS32
13	HALL 3 / I2C_SCL	Pull up 2,7kΩ auf 5V, differential input 26LS32 / I2C clock signal
14	HALL 3*	Middle level: Pull up 2,7kΩ to 5V, pull down 2,2kΩ, differential input 26LS32
15	5V Hall / I2C_SDA	5V, 150 mA / I2C data signal

6.2.5 Definition of Rotating Direction for Servo Motors

	Sight on front surface motor shaft, turn the shaft clockwise, the meter has to count upwards
Switch encoder A/B Switch +/- motor power	Switch rotating direction for DC brush type servo motors
Switch encoder A/B Switch hall1 with hall3 Switch winding-phase 1 and phase 2	Switch rotating direction for 3phase brushless servo motors
Phase 1 to phase 2, 2 to 3 and 3 to 1 Hall 1 to hall2, 2 to 3 and 3 to 1	Switch phase connection for brushless servo motors without change of rotating direction

6.2.6 OPTIO Pulse/Dir, Second Encoder Channel

PULSE / DIRECTION CONTROL, MODE 2, as standard
Parameter MODE and INC PER PULSE

MODE	0-29	<input type="text" value="2"/>
INC PER PULSE	1-50	<input type="text" value="5"/>
SYNC RATIO	+/-x10	<input type="text" value="0"/>
CARD IDENTIFIER	0-255	<input type="text" value="0"/>

GND internal
5V internal
Pull up 2,7kΩ to 5V, differential input 26LS32
Pull up 2,7kΩ to 5V, differential input 26LS32
Middle level: Pull up 2,7kΩ to 5V, pull down 2.2kΩ, differential input 26LS32
Middle level: Pull up 2,7kΩ to 5V, pull down 2.2kΩ, differential input 26LS32

Pin 1 GND
Pin 2 5V
Pin 3 PULS
Pin 4 DIRECTION
Pin 5 DIRECTION*

Pin 6 PULS*

ENCODER 2
Electronic gear, MODE 1, as standard
Parameter SYNCH RATIO 10 = 1:1

MODE	0-29	<input type="text" value="1"/>
INC PER PULSE	1-50	<input type="text" value="0"/>
SYNC RATIO	+/-x10	<input type="text" value="-5"/>
CARD IDENTIFIER	0-255	<input type="text" value="0"/>

GND intern
5V intern
Pull up 2,7kΩ to 5V, differential input 26LS32
Pull up 2,7kΩ to 5V, differential input 26LS32
Middle level: Pull up 2,7kΩ to 5V, pull down 2.2kΩ, differential input 26LS32
Middle level: Pull up 2,7kΩ to 5V, pull down 2.2kΩ, differential input 26LS32

Pin 1 GND
Pin 2 5V
Pin 3 A
Pin 4 B
Pin 5 B*

Pin 6 A*

6.2.7 PLC I/O


Output

Signal	D-Sub	PLC Cable	PLC I/O
Source PNP: 24V/100mA, Sink NPN: open collect. 24V/400mA	Pin 1	White	Output 1 (0/24V)
Source PNP: 24V/100mA, Sink NPN: open collect. 24V/400mA	Pin 2	Brown	Output 2 (0/24V)
Source PNP: 24V/100mA, Sink NPN: open collect. 24V/400mA	Pin 3	Green	Output 3 (0/24V)
Source PNP: 24V/100mA, Sink NPN: open collect. 24V/400mA	Pin 4	Yellow	Output 4 (0/24V)
Source PNP: 24V/100mA, Sink NPN: open collect. 24V/400mA	Pin 5	Grey	Output 5 (0/24V)
Source PNP: 24V/100mA, Sink NPN: open collect. 24V/400mA	Pin 6	Ping	Output 6 (0/24V)
Source PNP: 24V/100mA, Sink NPN: open collect. 24V/400mA	Pin 7	Blue	Output 7 (0/24V)
Source PNP: 24V/100mA, Sink NPN: open collect. 24V/400mA	Pin 8	Red	Output 8 (0/24V)

Input


24V Input, Ri 31kΩ	Pin 17	White-grey	Input 1
24V Input, Ri 31kΩ	Pin 18	Grey-Brown	Input 2
24V Input, Ri 31kΩ	Pin 19	White-pink	Input 3
24V Input, Ri 31kΩ	Pin 20	Pink-Brown	Input 4
24V Input, Ri 31kΩ	Pin 21	White-blue	Input 5
24V Input, Ri 31kΩ	Pin 22	Brown-blue	Input 6
24V Input, Ri 31kΩ	Pin 23	White-red	Input 7
24V Input, Ri 31kΩ	Pin 24	Brown-red	Input 8 (program Start)
24V Input, Ri 31kΩ / Bit 0 binary coded	Pin 13	White-green	Input 9
24V Input, Ri 31kΩ / Bit 1 binary coded	Pin 14	Brown-green	Input 10
24V Input, Ri 31kΩ / Bit 2 binary coded	Pin 15	White-yellow	Input 11
24V Input, Ri 31kΩ / Bit 3 binary coded	Pin 16	Yellow-Brown	Input 12

MODE >=10 Input 9-12, binary coded, for program number 1-15, input 8 fix dedicated for program start (static, not controlled by trigger flange)

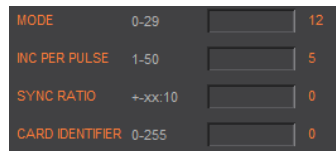

Enabling Power Stage

Activate the function with DIP-switch

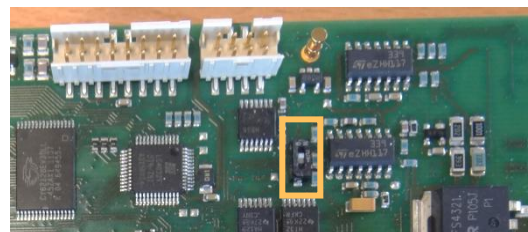

DIP switch OFF HW power stage enabling with 24V on Pin 9
Input open or 0V = power stage blocked

DIP switch ON Always enabling power stage, Pin 9 inactive

Pin 9 black Enable PWR / Input

2A
24V / 80mA
24V / 200mA (total Pin 12+Pin 26)

Pin 10 violet GND
Pin 11 Grey pink Pulse Output (not implemented)
Pin 12 Red-blue 24V Output


2A
24V / 200mA (total Pin 12+Pin 26)

Pin 25 White-black GND
Pin 26 Brown-black 24V Output

6.3 Internal I/O Circuit

INPUT 1-12

INPUT FUNCTIONS		
	ACTIVITY	FUNCTION
INPUT 1	HIGH	REF
INPUT 2	HIGH	PG 1
INPUT 3	LOW	EE
INPUT 4	HIGH	---
INPUT 5	HIGH	---
INPUT 6	HIGH	---
INPUT 7	HIGH	---
INPUT 8	HIGH	---

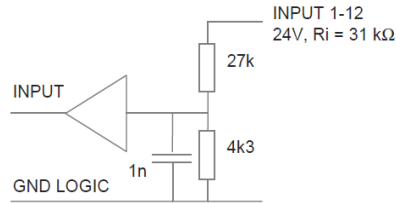

HIGH or LOW ACTIVITY programmable


OUTPUT 1-8

TYPE SOURCE

SOT Bit-value	TYPE	SOA Bit-value	ACTIVITY
0,1	SOURCE	1	HIGH
		0	LOW

Output ON 24V*
Output OFF open*
open 24V

All Output SOURCE
SOT 21845
SOA 255 / 0

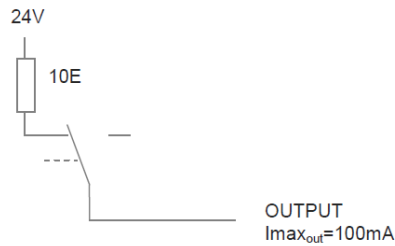


TYPE SINK

SOT Bit-value	TYPE	SOA Bit-value	ACTIVITY
0,0	SINK	1	HIGH
		0	LOW

Output ON open
Output OFF 0V
open 0V

All Output SINK
SOT 0
SOA 255 / 0

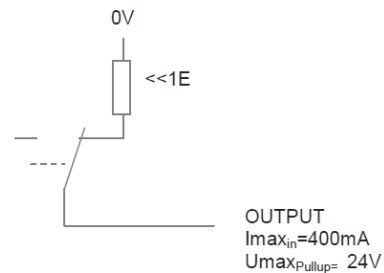


TYPE SOURCE/SINK

SOT Bit-value	TYPE	SOA Bit-value	ACTIVITY
1,0	SINK / SOURCE	1	HIGH
		0	LOW


Output ON 24V
Output OFF 0V
0V 24V

All Output SOURCE/SINK
SOT 43690
SOA 255 / 0

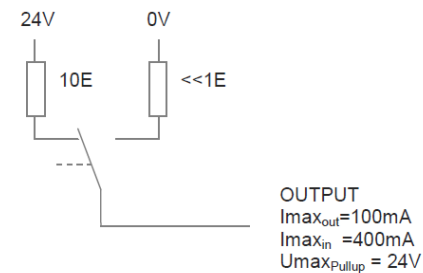

6.4 Output Configuration


TYPE
SOT (Set Output Type) parameter 16 Bit
2 Bit-value per output

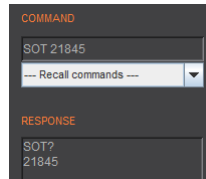

Output	8	7	6	5	4	3	2	1
SOT Bit	15	14	13	12	11	10	9	8
Bit-value	0	1	0	1	0	1	0	1
Decimal	21845							

*Default setting all output on SOURCE
>SOT 21845

ACTIVITY
SOA (Set Output Activity) parameter 8 Bit
1 Bit-value per output

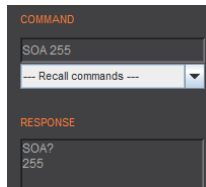

Output	8	7	6	5	4	3	2	1
SOA Bit	7	6	5	4	3	2	1	0
Bit-value	1	1	1	1	1	1	1	1
Decimal	255							

*Default setting all output HIGH ACTIVE
>SOA 255

Parameter Values

Output	SOT Bit	SOT Bit-value	TYPE	SOA Bit	SOA Bit-value	ACTIVITY	Output ON	Output OFF
1	0,1	0,0	SINK	0	0	HIGH	0V	open
				0	1	LOW	open	0V
2	2,3	0,1	SOURCE	1	0	LOW	open	24V
				1	1	HIGH	24V*	open*
3	4,5	1,0	SINK/SOURCE	2	0	LOW	0V	24V
				2	1	HIGH	24V	0V

Examples

Output	SOT Bit	SOT Bit-value	TYPE	SOA Bit	SOA Bit-value	ACTIVITY	Output ON	Output OFF
1	0,1	0,0	SINK	0	0	HIGH	0V	open
2	2,3	0,1	SOURCE	1	1	HIGH	24V*	open*
3	4,5	0,1	SOURCE	2	1	HIGH	24V*	open*
4	6,7	0,1	SOURCE	3	1	HIGH	24V*	open*
5	8,9	1,0	SINK/SOURCE	4	0	LOW	0V	24V
6	10,11	1,0	SINK/SOURCE	5	0	LOW	0V	24V
7	12,13	1,0	SINK/SOURCE	6	1	HIGH	24V	0V
8	14,15	0,0	SINK	7	1	HIGH	0V	open

SOA 11001110_b 206_d
SOT 0010101001010100_b 10836_d

10836
0010 1010 0101 0100
15 0

Microsoft Windows
Version 6.1 (Build 7601)

7 Configuration Motor Type Linear / Rotary

The motor type is set by hardware internally in the XENAX® servo controller before dispatch. The configuration is visible on the sticker with the serial number.

LINAX® Linear Motor
ELAX® Electric Slide


XENAX® Xvi 75V8
EtherCAT, **Lx oder Ex**
SN Xvi-75V8.xxxx
JENNY SCIENCE AG

Rotary Servo Motor

XENAX® Xvi 75V8
EtherCAT, **Ro**
SN Xvi-75V8.xxxx
JENNY SCIENCE AG


Motor Type	Bit 1	Bit 2	Bit 3	Bit 4
LINAX® / ELAX® linear motor	ON	ON	OFF	OFF
Rotary servo motor	OFF	OFF	ON	ON

A subsequent readjustment of motor type is possible through the according setup of the DIP-switch. A change in motor type should be updated on the sticker with the serial number.

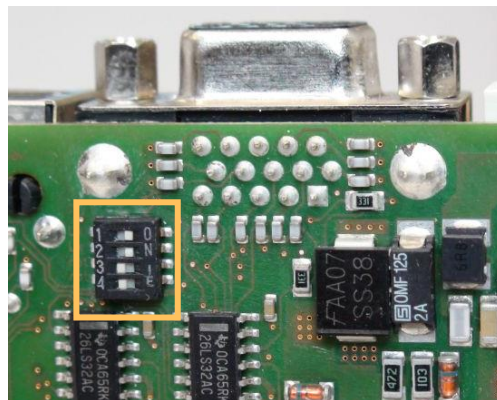

Please note:


For the older hardware versions <3, the DIP-switch is located on the opposite side of the circuit board.

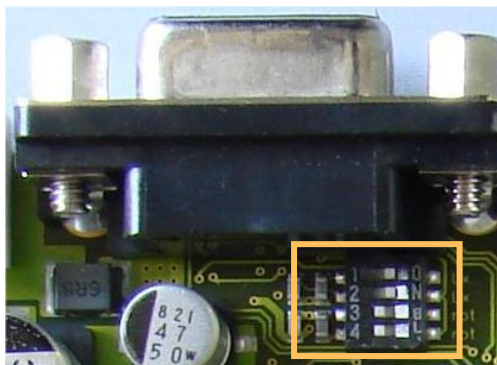

8 RS232 Serial Interface

8.1 Baud Rate RS232 XENAX®

Setting the baud rate RS232 using the 8-bit DIP-switch (remove the cover to find the multi switch). The new baud rate will be activated after switching the device off and on again.

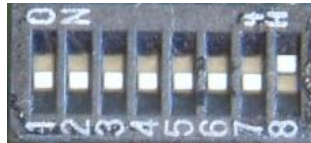


Baud Rate	Bit 1	Bit 2	Bit 3	Bit 4	Bit 5	Bit 6	Bit 7	Bit 8
RS232 9600 baud	X	x	x	x	x	x	OFF	OFF
RS232 115'200 baud (default)	X	x	x	x	x	x	OFF	ON
RS 232 57'600 baud	X	x	x	x	x	x	ON	OFF
RS232 19'200 baud	X	x	x	x	x	x	ON	ON
Data	8 Bit							
Parity	No							
Stop	1 Bit							

9 ETHERNET TCP/IP Interface

Please also consult the TUTORIAL VIDEO **JSC Tutorial 1: TCP/IP Connection** on our website, in which you can see all possible obstacles and according measures to solve the problems which might occur during the TCP/IP connection.

If the error “connection to Gateway (Port 10001) refused” occurs when opening WebMotion® there might be the following causes:

- WebMotion® is opened twice with the same TCP/IP address
- Baud rate of XENAX® does not correspond to baud rate in XPort
- Setup records are wrong

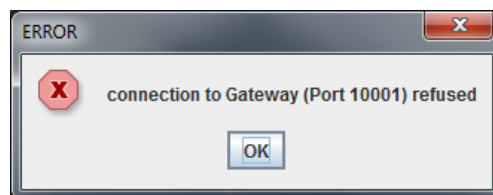


9.1 Baud Rate Ethernet Gateway (XPort)

Important:

On operation with WebMotion® the baud rate of XPort (Ethernet gateway) must be in accordance with the baud rate of XENAX® (Default 115'200)


Start tool „[DeviceInstaller](#)“ and search for desired XPort.

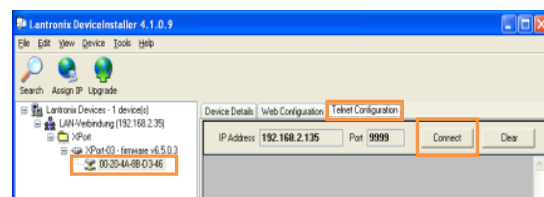

Click on IP-address, choose „Telnet Configuration“, press “Connect” button and confirm with “Enter” key.

Choose selection 1 (Channel 1) and set baud rate according to XENAX® setup. Confirm all other menu items with “Enter” key.

Save setup with selection 9 (Save and exit). Close Tool [“DeviceInstaller”](#) and start WebMotion®.

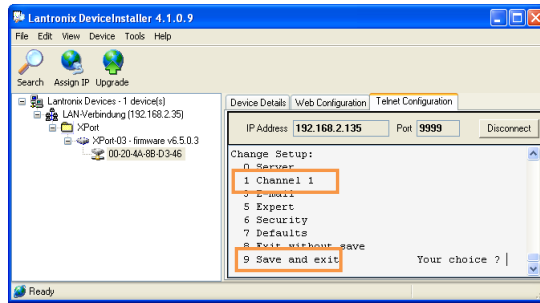


IP-address of XENAX® is provided on the back side of the controller.

Connection of XENAX® to laptop/PC over a normal RJ45 network cable.

When connecting laptop/PC directly to XENAX®, it may possibly need a crossed RJ45 cable. However, with newer network types a crossed RJ45 cable is not necessary anymore.

Display Ethernet Plug

Color	LED left	Color	LED right
Off	No connection	Off	No Activity
Orange	10Mbps	Orange	Half-duplex
Green	100Mbps	Green	Full-duplex

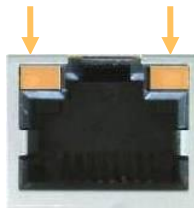



9.2 Default Setup Records Upgrade

Open DeviceInstaller

Connect XENAX® with Ethernet cable and power.
Open DeviceInstaller and choose the according XENAX® servo controller.

Upgrade Setup Records

 Upgrade Setup Records in DeviceInstaller

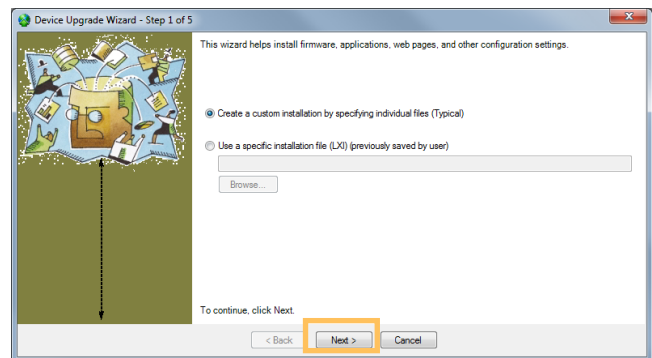


-> Next >
->Next >

Select:

- Install setup records from a file


Choose File „Xvi_SetupRecords_115200.rec” with „browse”. (This file can be downloaded from <http://www.jennyscience.de/en/download/> under *Servo Controller / Setup Records*)

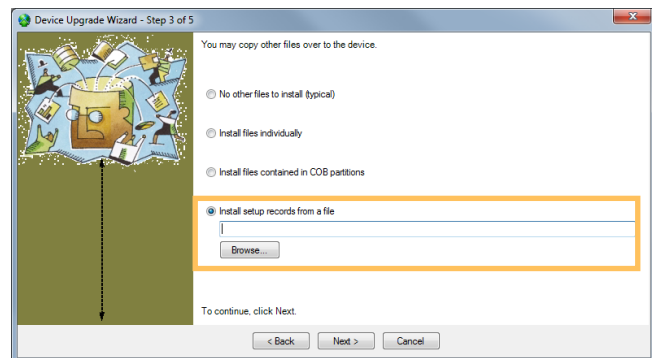

->Next >
->Next >

The new setup is being upgraded and is completed when colored in green.

Close.

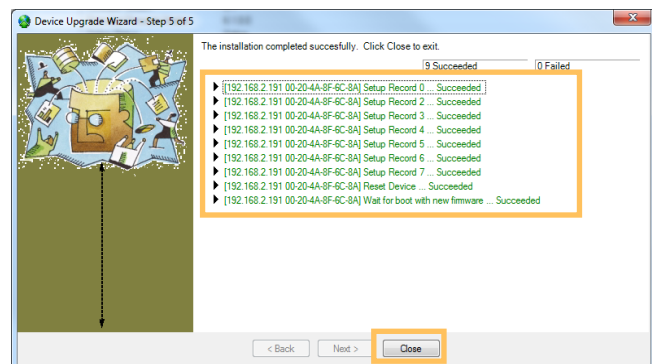

9.3 Test IP Connection with >IPCONFIG

IPCONFIG command in DOS window

Test TCP/IP address range.

IP address has to be in range of 192.168.2.xxx
If necessary adjust IP address in computer „network environment“ to e.g. IP 192.168.2.200.

xxx = 001 – 255
≠ IP Address XENAX®

```
Verbindungsspezifisches DNS-Suffix:
IP-Adresse (Autokonfig.) . . . . . : 192.168.2.200
Subnetzmaske . . . . . : 255.255.255.0
Standardgateway . . . . . :
```

9.4 Test Connection with >PING

PING command in DOS window

IP address is provided on the back side of XENAX®.
If no response, check direct connection with crossed RJ45 cable.

If you do not know the IP address, you can look it up with the [DeviceInstaller](#), provided that the Ethernet connection is working o.k.

```
C:\Dokumente und Einstellungen\ping 192.168.2.100
Ping wird ausgeführt für 192.168.2.100 mit 32 Bytes Daten:
Antwort von 192.168.2.100: Bytes=32 Zeit<1ms TTL=64
Antwort von 192.168.2.100: Bytes=32 Zeit<1ms TTL=64
Antwort von 192.168.2.100: Bytes=32 Zeit<1ms TTL=64
Antwort von 192.168.2.100: Bytes=32 Zeit<1ms TTL=64
Ping-Statistik für 192.168.2.100:
    Pakete: Gesendet = 4, Empfangen = 4, Verloren = 0 (0% Verlust)
    Ca. Zeitangaben in Millisek.:
    Minimum = 0ms, Maximum = 0ms, Mittelwert = 0ms
```

9.5 Change IP Address with “Device Installer”


To view and change the IP address as well as to update WebMotion®, the [DeviceInstaller](#) tool is used.
Use link on the right and click on [DeviceInstaller](#).
Select XPort and install it.

<http://www.lantronix.com/device-networking/utilities-tools/device-installer.html>

The DeviceInstaller needs .NET Framework driver.


Search IP address

Start DeviceInstaller von Lantronix from Lantronix and select “Search” to look for existing IP addresses.

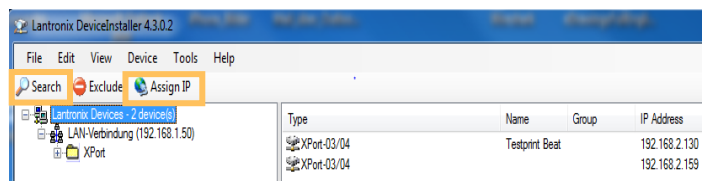

Change IP address

On “Assign IP” select “Assign a specific IP address”.
Now you can set a new IP address.

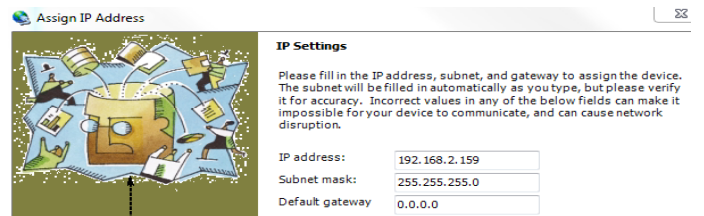


9.6 Communication Settings XPort

To communicate with WebMotion® and higher control systems via Ethernet TCP/IP, XENAX® is delivered with the default XPort settings on the right.

The parameters can be changed with the tool DeviceInstaller in menu „Telnet Configuration“.

You can reset the parameters to default settings manually or by uploading the setup-record file (on request).

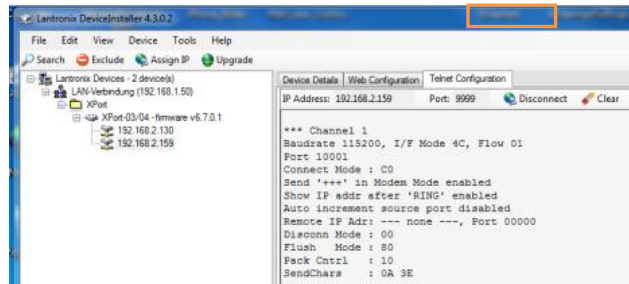

We recommend strongly using the default XPort settings. Otherwise, the correct functionality of WebMotion® and the communication over Ethernet cannot be guaranteed.

```
*** Channel 1
Baudrate 115200, I/F Mode 4C, Flow 01
Port 10001
Connect Mode : C0
Send '+++ ' in Modem Mode enabled
Show IP addr after 'RING' enabled
Auto increment source port disabled
Remote IP Adr: --- none ---, Port 00000
Disconn Mode : 00
Flush Mode : 80
Pack Cntrl : 10
SendChars : 0A 3E
```

9.7 PORT Address

The default port address is 10001. WebMotion® addresses this port as a standard.

If another port address has to be communicated, the port address has to be set antecedently on XPort.

Example: Connection on port No. 10005

When starting WebMotion® in the web browser window this port address has to be entered according to the following syntax:

```
*** Channel 1
Baudrate 115200, I/F Mode 4C, Flow 01
Port 10005
.....
.....
```

Starting WebMotion®

<http://192.168.2.xxx/xenax.html?Port=10005>

10 ASCII Protocol

Over Ethernet TCP/IP in the menu *move axis / by command line* in WebMotion®
Or via RS232 e.g. with hyper terminal.

The simple ASCII protocol works with the echo principle.
The sent characters come back as an echo and can be checked immediately.
Thus, if existing, you get a parameter value and finally the character prompt ">". If the command could not be accepted then, it has a "?" character in the string.

Description	Command	[Parameter]	Echo command accepted
<i>Write parameters:</i>			
Power continues	PWC	<CR>	PWC <CR> <LF> >
Speed	SP	10-9'000'000 <CR>	SPxxxxxx<CR> <LF> >
Acceleration	AC	2'000-100'000'000 <CR>	ACxxxxxx<CR> <LF> >
<i>Read parameters:</i>			
Tell Position	TP	<CR>	TP <CR> <LF> XXXXXXXX<CR> <LF> >
Retrieve	e.g. AC?	<CR>	AC? <CR> <LF> XXX <CR> <LF> >
	SP?	<CR>	SP? <CR> <LF> XXX <CR> <LF> >

Echo command not recognized or cannot be completed in the current configuration

<command> <CR> <LF> ? <CR> <LF> >

Echo command cannot be accepted at this time

<command> <CR> <LF> #xx <CR> <LF> >

#-List

Nr.	Description
#01	Error in queue
#03	Drive is active
#05	Program is active
#13	EE1 in queue
#14	EE in queue
#15	Force Calibration active
#33	TRMA active
#34	Rotary reference active
#36	Gantry reference active
#38	Reference active
#40	Command at active bus module not allowed
#47	Fault Reaction active
#65	Value of parameter not valid

Note for sequential commands:

Terminate a command with <CR> only, no additional <LF>. Do not send a new command until you have received the prompt character „>“ before

10.1 ASCII Protocol TCP/IP

In TCP/IP the cohesive ASCII sequences can be splitted into different telegram packages. This is why a separate receive buffer has to be considered.

Please find detailed information in:
 „ Xvi75_TCP/IP_Socket_Telegram_Events/Wireshark.pdf”
 on <http://www.jennyscience.de/en/download/>.

10.2 Asynchronous Messages (Events)

To reduce response time, status or PLC input modifications of the PLC interface can be sent automatically (events). Therefore it is not necessary to poll the status or inputs permanently.

Enable Events

Events disabled, default	EVT=0
Events enabled generally	EVT=1

Status modifications / Reference Event

Will be sent in case of generally activated events.

Power OFF	@S0
Power ON / Halt	@S1
In motion	@S2
Error	@S9
Reference finished	@H

PLC Input

Inputs are selectable with ETI (Event Track Input)

Enable event of input 1..12	ETI=1..C
Enable all input events	ETI=0

Disable event of PLC input with DTI (Disable Track Input).

Disable event for input 1..12	DTI=1..C
Disable all input events	DTI=0

Structure of input events @Ixyz
 with xyz as half bytes in Hexadecimal notation.

PLC I/O pin no.	16	15	14	13	24	23	22	21	20	19	18	17
INPUT no.	12	11	10	9	8	7	6	5	4	3	2	1
Example input bits after modification	1	0	1	1	0	0	1	0	1	1	0	1
Event general @I	x				y				z			
Example Event @I	"B"				"2"				"D"			

Default Settings after Power ON

After power on of XENAX® servo controller or application download, default settings are active again:

Events OFF EVT=0
 PLC Input Events OFF DTI=0

11 Install JAVA Plugin

Check installed JAVA version.

The JAVA Plugin Software version has to be higher or equal version 7.

Information on the installed JAVA version can be retrieved under:
 Start / Control Panel / JAVA / General / Info.

We highly recommend uninstalling older JAVA versions before installing the new version.



Download Java

<http://www.java.com/de/download/manual.jsp>




11.1 Applet Cache


The WebMotion® applet should be fully reloaded by each new start of the browser or when the browser is being updated. To prevent problems and errors during the loading process, the Cache option has to be deactivated.

Open JAVA Control Panel:
Start / Control Panel / JAVA

Temporary Internet Files

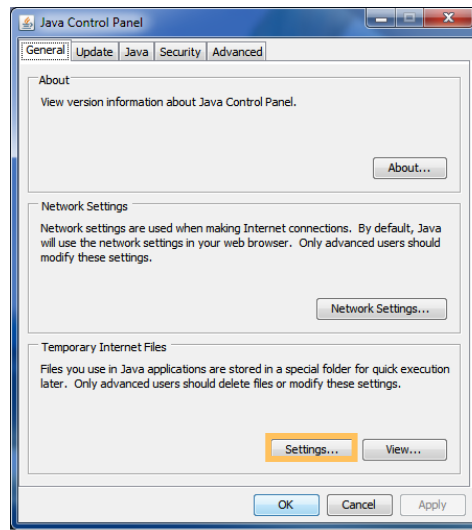


Deactivate “Keep temporary files on my computer”.

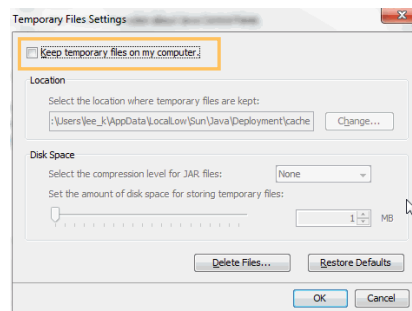

11.2 Disable Java certificate Validation

If the XENAX® servo controller is connected to a PC without internet access, the Java certificate cannot be validated. This can possibly slow down loading the WebMotion® user interface or can even lead to a time-out. The automatic certificate validation has to be deactivated.

Open the control panel of the PC → Java → Advanced
→ uncheck „Enable online certificate validation“.

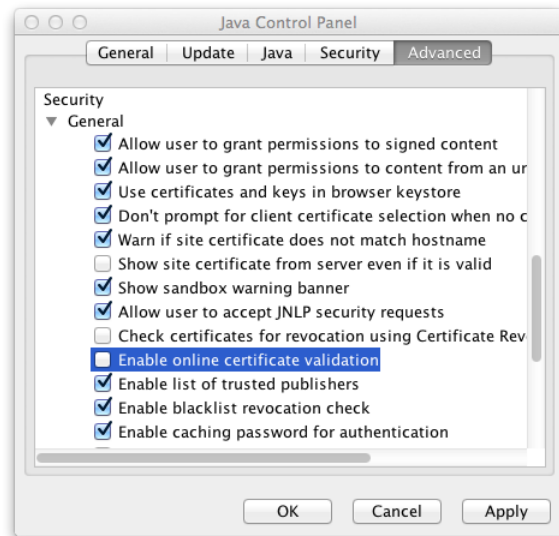

12 WebMotion®

Please also consult the TUTORIAL Video **JSC Tutorial 2: Set-Up Single Axis** on our website and convince yourself of the easy axis setup with WebMotion®.

WebMotion® is an integrated graphic user interface (website), located in XENAX®. It is loaded and activated over a web browser (Internet Explorer >= 8.0, Mozilla, Firefox, Opera, ...).

Note:

Please make sure that zoom-settings of the browser window are at 100% (original size). Otherwise the WebMotion® display is affected.

12.1 Start WebMotion®


Start your web browser with the IP address number of your XENAX® and add “/xenax.html” as a suffix.

IP address is provided on the back side of the XENAX®.

Example:

<http://192.168.2.xxx/xenax.html>


XENAX® is being started with an automatic system self-check including type designation and version information on firmware and hardware. Moreover, WebMotion® identifies the connected linear motor or rotary motor and uploads the current XENAX® settings (parameters, programs) in to the WebMotion®.

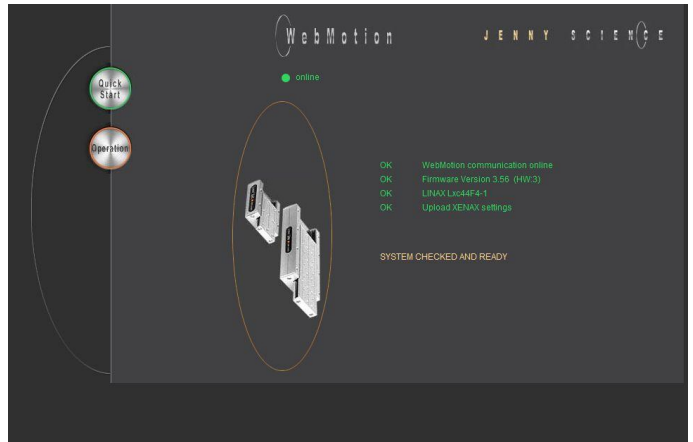

Interruption of TCP/IP Connection

If the XENAX® logic supply is interrupted or if the Ethernet cable is disconnected, the TCP/IP interruption will be detected by WebMotion® and signaled with “offline”. After removing the cause of the offline-mode, the TCP/IP connection has to be reloaded by updating the current web browser window.

If it is still blocked, it is recommended to first exit and then restarts the web browser.

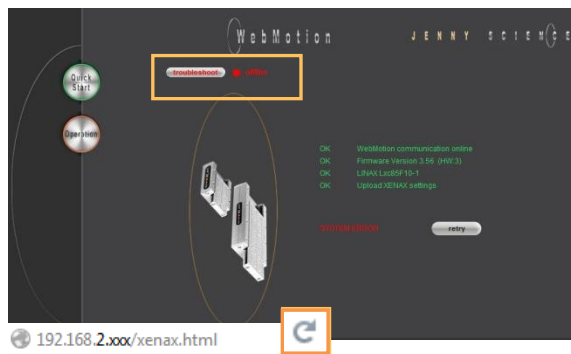


12.1.1 Error „Upload XENAX Settings®“

The settings in Kaspersky Internet Security might be responsible if the error code „Error Upload XENAX Settings“ occurs with the automatic self-check of WebMotion®.

If you are using Kaspersky or similar internet security software, the security for Instant Messenger Services has to be deactivated.

(Refer example in Kaspersky Pure 3.0)

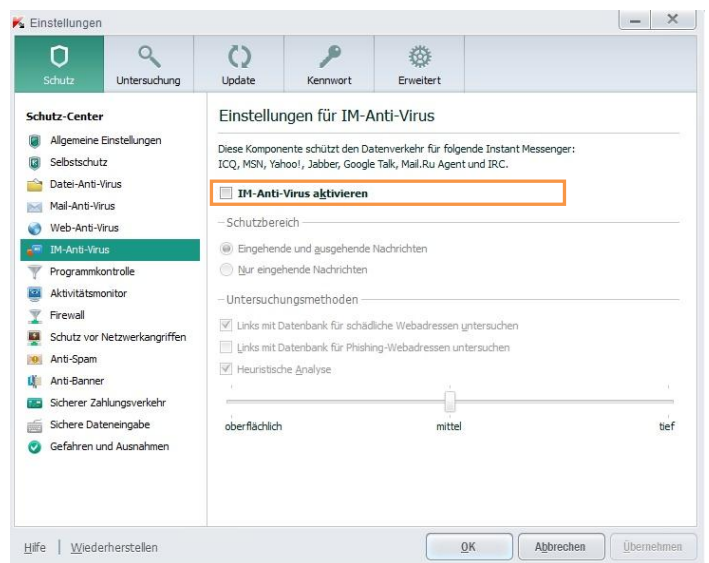

12.2 Quick Start only with LINAX® and ELAX® linear motor axis

The Quick Start function allows the user to setup the LINAX® or ELAX® linear motor axis with the XENAX® controller simply immediately after receipt of the components.

It is completed per mouse click, without parameter settings and without an instruction manual.

By pressing the Quick Start button, a system check is automatically started including the following tests:

Cable connections, power voltage, input functions, functionality of the measuring system, parameter settings and current flow of the linear motor.

In order to test the functionality of the measuring systems the system asks you to move the slider of the LINAX® linear motor axis of a distance of at least 20mm back and forth.




With the Start/Stop LINAX® or ELAX® the linear motor will be referenced automatically and will then move the distance back and forth that was indicated manually by hand before.

For the Quick Start Function it is recommended to operate the linear motor axis in horizontal orientation without a payload.



You can adjust the dynamics individually with the arrow symbol by mouse click.

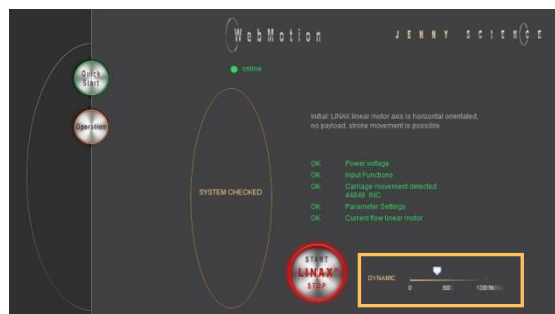

12.3 Operation, Status Line

The status line on the lower edge of WebMotion® gives an overview of the current condition of XENAX® and the connected motor at any time. These data cannot be changed and are for the user's information only.

MOTOR TMP

Shows the current temperature of the coils in the linear motor, which is detected by a sensor. This measuring function is not possible for rotary servo motors. The temperature observation for servo motors is done by an I²T calculation.

POSITION

After referencing the linear motor the current, this indicates the absolute position of the motor in increments of the measuring system. Standard for LINAX®/ELAX® linear motors is 1Increment = 1µm.

MOTOR

Automatic identification of the connected LINAX®/ELAX® linear motor axis. *Is a rotatory motor connected, it only shows "ROTATIVE"*

REFERENCE

The reference is a condition to start the LINAX®/ELAX® linear motor axes. This is also how the precise current commutation is being calculated.

- PENDING = Reference outstanding
- DONE = Reference completed

MODE

Displays the operating mode:
0=Standard Servo

- 1 = El. Gera mechanism over second encoder
- 2 = Pulse/Dir, stepper emulation
- 10 = Coded Prog No Standard
- 12 = Coded Prog no for Stepper Controlled

STATUS

- POWER OFF = off
- POWER ON / HALT = On, Motor is not moving
- IN MOTION = Motor is in motion
- ERROR XX = error number, *with a button where describe the error and an error history*

INPUT

Condition of the direct inputs 1-8, and the binary coded inputs 9-12.



OUTPUT

Condition of outputs 1-8
(Modification under menu *application / I/O*)

PROG

Program number, binary coded from inputs 9-12.
For this binary coded program selection, the MODE has to be set on higher or equal 10, while input 8 is the trigger for program start.

12.4 Move Axis by Click

12.4.1 Move Axis by Click for LINAX®/ELAX® Linear Motors

Simple online control for setup and test of the linear motor axes.

The orange values behind the empty fields show the current registered values in XENAX®. New values can be entered in the empty fields and registered with <Enter>. These parameters will overwrite the existing values and will be registered directly in the XENAX® servo controller.



SOFT LIMIT POS

Software Limit Position, setting of an individual motion range in increments.

SLP- = position counter lower values

SLP+ = position counter upper values

Both values 0 = No limit (limit is the stroke of the connected linear motor)

S-CURVE %

Percentage S-curve rounding of the internal motion profile, e.g. in an INDEX, generally for all motion profiles. Automatic calculation of jerk (changing of acceleration per time unit inc/s^3)

ACC *1'000

Acceleration in inc/s^2 multiplied with a factor of 1'000

SPEED

Speed in inc/s

SP OVERRIDE %

Override of the set speed and acceleration of a motion profile, for example for process deceleration or set up mode.

Go Way (REL)

Input of the distance relative to the present position in increments. Start with <Enter>.

Go Position (ABS)

Input of the position absolute to the zero point in increments. Start with <Enter>.

Rep Reverse

Endless automatic motion back and forth.

Input of the way relative to the present position in increments. Start with <Enter>.

While running, the motors parameters such as

acceleration, speed, and wait time can be adjusted online.

Stop the back and forth movement with “Stop Motion”.

Wait Reverse

Wait time at reversal point of rep reverse in units of 1 milliseconds. Start with <Enter>.

TIME (ms)

Time of the last profile drive in milliseconds.

Reference

To reference the linear motor there are reference marks with different distances in between (>REF).

The absolute position can be calculated when the motor passes two reference marks.

Run this function once after switching on the power.

Go Pos 0

(>G0) Go to position 0.

Power Cont

Power continues (>PWC)

Turning on the power stage with taking over the most recent absolute position and **without the need of**

referencing the linear motor, e.g. after error 50 or after

“Power Quit”. This is only possible as long as the logic supply has not been interrupted after the linear motor was

referenced.

Stop Motion

Stops the motion under control of deceleration ramp.

Power Quit

Power stage without power, the linear motor is movable by hand.



12.4.2 Move Axis by Click for Rotary Motors

If the XENAX® servo controller does not recognize a LINAX® or ELAX® linear motor axis, XENAX® assumes a connection with a rotary servo motor. Instead of “Go Pos 0” WebMotion® offers Jog + und Jog – functions.



Jog -

Runs the motor in negative direction until the command “Stop Motion” stops the motor.

Jog +

Runs the motor in positive direction until the command “Stop Motion” stops the motor.

While the motor is running with Jog, the dynamics SP OVERRIDE or SPEED can be adjusted online.

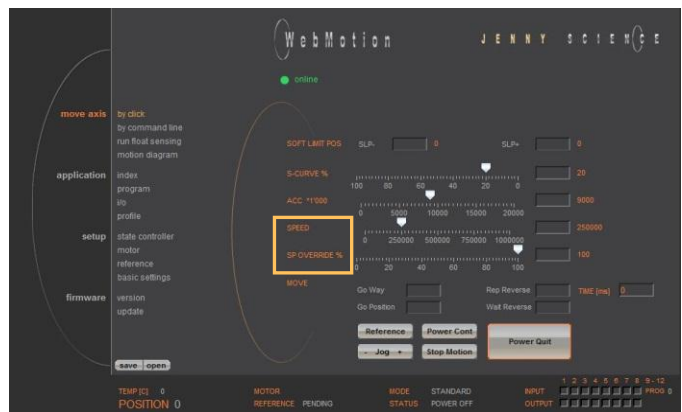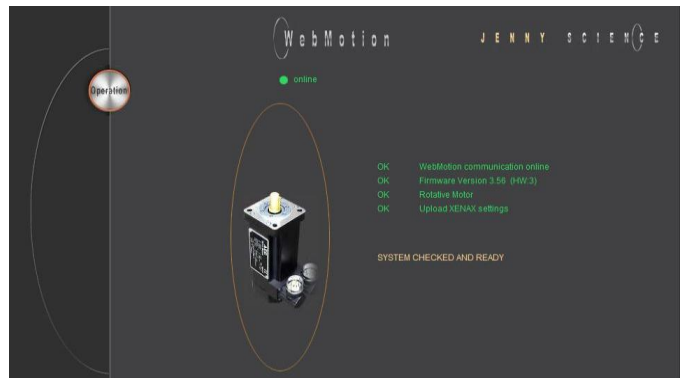

12.5 Move Axis by Command Line

XENAX® can directly be controlled by a ASCII command set.

COMMAND

Transmits an ASCII command with <Enter>. Under “Recall commands” the activated commands are saved and can be reactivated by mouse click

RESPONSE

shows received characters by WebMotion®.

COMMAND SET

Lists all ASCII commands, recognized by XENAX®.



12.6 ASCII Command Set for XENAX®

Using the simple ASCII command [+PARAMETER] set, all XENAX® Servo controller functions can be activated with an extremely short reaction time.

Information about the tables:
 1) *Diagnosis and test functions*
 ? *Query of the programmed value*

12.6.1 Power / Reset


DESCRIPTION	Short	CMD	PARAMETER
Power ON incl. reset encoder counter	Power	PW	
Power ON continue, keep encoder counter	Power continue	PWC	
Power OFF servo amplifier	Power quit	PQ	
Reset setup parameters to default values	Reset	RES	
Clear actual position counter, (not possible with LINAX®/ ELAX®)	Clear position to 0	CLPO	

12.6.2 Basic Settings

DESCRIPTION	Short	CMD	PARAMETER
Set up of MODE (Operating) Important! In case of changing this value, the servo amplifier must be in state POWER OFF (>PQ)..	Mode	MD	0, 1, 2, 10,12 / ? refer <i>WebMotion® / Basic Settings</i>
Inc. per pulse, MODE 2/12, pulse/direction control	Inc per Pulse	ICP	1-50
Synchronous ratio for electronic gear	Synchronous Ratio	SR	± 1-1'000 : 10
Set CI (query), CANopen Node ID, Powerlink Node ID, Remote ID in Master/Slave Configuration	Card Identifier	CI	1-99 / ?
Card Identifier of Gantry Slave	Gantry Slave Identifier	GSID	0 - 4
Identification string max 16 characters free for user	Servo controller ident.	SID	string / ?

12.6.3 Motor Settings

DESCRIPTION	Short	CMD	PARAMETER
Max. motor current nominal [x10mA]	I stop	IS	10-1'800 / ?
Max. motor current peak [x10mA]	I run	IR	10-1'800 / ?
Pole-pair number of motor	Pole pair	POL	1-100 / ?
Number of encoder increments per revolution	Encoder	ENC	10-32'000 / ?
Direction of phase control u,v,w or v,u,w	Phase Direction	PHD	0,1 / ?
Orders of Hall detect sequence. By rotating the motor clockwise, it gets 0 or 1 for the entering from the parameter PHD.	Phase Direction Detection	PHDD	0, 1, ?
Correction of the electrical angle at new adjustment of coils to magnets (after PWR)	Phase Offset	PHO	0-359 / ?

 

Appeared ?, the Dip-switch is set to linear or the Hall wiring is wrong.

Force constant of the motor for LINAX®/ELAX® in [mN/A], torque constant for rotary motors in [μNm/A]	Force Constant Motor	FCM	0-100'000'000 / ?
Resistance phase to phase of the motor in [mΩ]	Phase to Phase Resistance	RPH	0-100'000 / ?
Inductance phase to phase of the motor in [μH]	Phase to Phase Inductance	LPH	0-100'000 / ?

12.6.4 Controller Settings

DESCRIPTION	Short	CMD	PARAMETER
Payload, considered in closed loop [g]	Mass Load	ML	0-100'000 / ?
Bandwidth position controller	Bandwidth Position	BWP	1-5'000 / ?
Bandwidth current controller	Bandwidth Current	BWC	5-5'000 / ?
Frequency from the Notch Filters	Frequency Filter 1	FQF1	0, 160-2000 / ?
Bandwidth /Quality from the Notch Filters	Bandwidth Filer 1	BWF1	500–100'000 / ?
Maximum position deviation in encoder increments	Deviation Position	DP	1-1'000'000 / ?
Permissible deviation in target point	Deviation Target Pos.	DTP	1-10'000 / ?

12.6.5 Motion Settings

DESCRIPTION	Short	CMD	PARAMETER
Position rated absolute, Inc	Position	PO	± 2'000'000'000 / ?
Way relative, encoder increment	Way	WA	± 2'000'000'000 / ?
Speed Inc/s (encoder counter)	Speed	SP	10-9'000'000 / ?
Acceleration Inc/s ² (encoder counter)	Acceleration	AC	2'000-1'000'000'000 / ?
Emergency Deceleration Inc/ s ² (e.g. for input function EE/EE, for errors, if driving in limit switch or soft limit etc.)	Emergency Deceleration	ED	10'000-1'000'000'000 / ?
If necessary the emergency deceleration can be adjusted during operation if there is an emergency deceleration of >1s → In case of emergency the deceleration is always <1s			
Override, scaling from the Acceleration and Speed	Override	OVRD	1-100 / ?
Percentage S-Curve rounding. Calculation of jerk parameter automatically.	S-Curve	SCRV	1-100 / ?
Jerk of trajectory, Inc/s ³	Acceleration Variation (Jerk), Read only	ACV	/ ?
Limitation driveway left Take effect by LINAX®/ELAX® motors only	Soft Limit Position Negative	SLPN	0 - < LINAX®/ELAX® stroke > (Old: LL)
Limitation driveway right Take effect by LINAX®/ELAX® motors only	Soft Limit Position Positive	SLPP	0 - < LINAX®/ELAX® stroke > (old: LR)

12.6.6 Reference LINAX® / ELAX®

DESCRIPTION	Short	CMD	PARAMETER
Home linear motor axis encoder	Reference	REF	
Start direction REF function 0 = positive, 1 = negative 2 = Gantry REF positive, motors same direction 3 = Gantry REF negative, motors same direction 4 = Gantry REF positive, motors reverse direction 5 = Gantry REF negative, motors reverse direction	Direction REF	DRHR	0-5 / ?

12.6.7 Reference Gantry

DESCRIPTION	Short	CMD	PARAMETER
Card Identifier of Gantry Slave set in the Master Control	Gantry Slave Identifier	GSID	0 - 4
Set CI (query), CANopen Node ID, Powerlink Node ID, Remote ID in Master/Slave Configuration	Card Identifier	CI	1-99 / ?
Home linear motor axis encoder	Reference	REF	
Start direction REF function 0 = positive, 1 = negative 2 = Gantry REF positive, motors same direction 3 = Gantry REF negative, motors same direction 4 = Gantry REF positive, motors reverse direction 5 = Gantry REF negative, motors reverse direction	Direction REF	DRHR	0-5 / ?
Responds the automatically detected Gantry Master Slave Offset. Important: The command DGMSO has to be performed on the Gantry Slave Axis.	Detected Gantry Master Slave Offset	DGMSO	
Indication of the Gantry Master Slave Offset. Deviation to the automatically detected value max. 0.5mm, otherwise error 76. 0 = use automatically detected value, can be read with DGMSO . <> 0 = User pre-set Gantry Master Slave Offset Important: The command has to be performed on the Gantry Slave Axis.	Preset Gantry Master Slave Offset	PGMSO	+ - 5'000'000 / ?

12.6.8 Reference Rotary Motors

DESCRIPTION	Short	CMD	PARAMETER
Home function according to program	Reference	REF	
Direction of motor rotation to seek external coarse sensor, 1 = CW, 2 = CCW	Dir Home	DRH	1-2
Speed for seeking external sensor If there is no external sensor, then set SPH = 0	Speed Home	SPH	0-25'000 Inc/s
Input number for external Home Sensor	Input Home	INH	1-8
Direction of motor rotation for seeking z-mark on encoder, 1 = CW, 2 = CCW	Dir Z-Mark	DRZ	1-2
Speed for seeking z-mark If there is no z-mark on the encoder, set SPZ = 0	Speed Z-Mark	SPZ	0-10'000 Inc/s

12.6.9 Move Commands

DESCRIPTION	Short	CMD	PARAMETER
Go direct to rated position absolute, Inc	Go direct Position	G	± 2'000'000'000
Go to position absolute	Go Position	GP	(Position = PO value)
Go way relative	Go Way	GW	(Way = WA value)
Go to zero-mark on encoder disk	Go Z-Mark	GZ	
Jog (run) positive, v = constant	Jog Positive	JP	(Speed = SP value)
Jog (run) negative, v = constant	Jog Negative	JN	(Speed = SP value)
Repeat way(WA value) positive/negative	Repeat Reverse	RR')	1-100'000
Repeat way (WA value) constant direction	Repeat Way	RW')	1-100'000
Waiting time on command RR and RW	Wait Repeat	WT')	1-10'000 (ms)
Run index number	Index	IX	1-50
Run profile	Profile	PRF	1-5
Move DRIVE I_FORCE Nr. xx	Drive I Force	DIF	xx
Stop program and motion with deceleration	Stop Motion	SM	

12.6.10 Index / Moves with I_Force (programmed movements)

DESCRIPTION	Short	CMD	PARAMETER
Run index number	Index	IX	1-50
Number of index pre-load for changing index parameters by remote control	Number Index	NIX	1-50
Acceleration write in Index at the NIX preloaded number	Accel. Index	AIX	2-1'000'000 (x1000) Inc/s ²
Speed write in Index at the NIX preloaded number	Speed Index	SIX	10-1'000'000 Inc/s
Distance write in Index at the NIX preloaded number	Distance Index	DIX	± 2'000'000'000 Increment
Save index type in index for the preselected number with NIX	Type of Index	TYIX	1,2 / ?
Move with DRIVE I_FORCE Nr. xx	Drive I Force	DIF	xx
Selecting Drive I_Force number in which parameters shall be changed. xx= Drive I_Force number 1-10. NDIF? = Retrieving selected sector number	Number of Drive I_Force to change parameter	NDIF	Xx
Acceleration for Drive I_Force xx [x1'000 inc/s ²]	Acceleration of selected Drive I_Force	ADIF	xx
Speed for Drive I_Force xx [inc/s]	Speed of selected Drive I_Force	SDIF	xx
Limitation of I-Force current while Drive I_Force xx [x10mA]	I_Force Limit of selected Drive I_Force	IDIF	xx
Direction Drive I_Force xx = 0 ->positive, xx =1 -> negative	Direction of selected Drive I_Force	DDIF	xx

12.6.11 Program / Application

DESCRIPTION	Short	CMD	PARAMETER
Run program number	Program	PG	1-15
0 = Program 1..15 max. 50 program lines, Program 16..63 max. 10 program lines	Program Mapping	PMAP	0,1 / ?
1 = Program 1..5 max. 130 program lines, Program 6..63 max 10 program lines			
Important: Changes of PMAP parameter clears entire program memory			
Save Application (incl. parameters) to Start-up Key	Save to Start-up Key	SVST	

12.6.12 Event

DESCRIPTION	Short	CMD	PARAMETER
Event activation	Event Status or Input	EVT	0,1
0=All input events enabled	Event Track Input	ETI	0-9, A-C
1..C= Event of input 1..12 enabled			
0= All input events disabled	Disable Track Input	DTI	0-9, A-C
01..C = Event of input 1..12 disabled			

12.6.13 Input / Output

DESCRIPTION	Short	CMD	PARAMETER
Set type of PLC outputs (Source, Sink, Source/Sink) -> refer chapter <i>Output configuration</i>	Set Output Type	SOT	0-65535
High / Low Activity of PLC outputs -> refer chapter <i>Output configuration</i>	Set Output Activity	SOA	0-255
Set PLC output to logic 1 (level according SOT, SOA)	Set Output	SO	1-8
Equivalent to SO, but set all outputs binary coded Bit 0 = Output 1, Bit 7 = Output 8	Set Output Hex	SOX	00-FF
Clear output (level according SOT, SOA)	Clear Output	CO	1-8
Trigger upward counting, absolute, at output #x defined in Output-Function, pulse during 5ms	Trigger upward	TGU	± 2'000'000'000 Increment
Trigger downward counting, absolute, at output #x defined in Output-Function, pulse during 5ms	Trigger downward	TGD	± 2'000'000'000 Increment
0=all Input HIGH active, 1= all Input LOW active, 2= individual input activity selection according to ILAS (value 0 and 1 puts ILAS to 0x000 respectively 0xFFFF)	Input LOW active	ILA	0-2 / ?
individual input activity selection, 0=Input HIGH active, 1=Input LOW active	Input Low Active Single	ILAS	0xx / Fxx / ?
1. Hex for value binary inputs 9-12 only 0 or F, 2. And 3. Hex value for input 1-8 (values 0x000 and 0xFFFF put ILA to 0 resp. 1. All other values are to 2 by ILA			
Status all 12 inputs, 0 = Low, 1 = High / ? incl. indication of input number	Tell Input	TI	/ ?
Status single input, 0 = Low 1 = High	Tell Input	TI	1-12
Status all 12 Inputs in HEX format	Tell Input HEX	TIX	
Status all 8 Outputs, 0= logic 0, 1=logic 1	Tell Output	TO	

Status all 8 Outputs in HEX format	Tell Output HEX	TOX	
Shows present position captured with input	Tell Capture Position	TCP	1-8
Shows the position captured with input 12	Tell Capture Pos. Buffer	TCPB	1-8
Set all 8 capture Position Register to 0	Clear Capture Position	CLCP	1-8 (all)
Activate capture position function over input 12	Capture Pos. Input 12	CP12	0,1
Break Delay in [ms]	Break Delay	BRKD	1-1000 (ms) / ?

Attention: no works with the SMU module

12.6.14 Limit Position ELAX®

DESCRIPTION	Short	CMD	PARAMETER
Start calibration of the internal mechanical limit stop positive. After the calibration the value can be read with <i>DMLPP</i> .	Mechanical Limit Calibration	MLC	
Position of the detected internal mechanical limit position positive ? = Returns the position of the detected internal mechanical limit stop positive. 0 = Deletes the position of the detected internal mechanical limit stop positive Note: - If DMLPP is deleted (DMLPP = 0), the value for the internal mechanical limit stop for the reference in positive direction is <stroke ELAX + 1mm> - If the value for the internal mechanical limit stop positive is known, this value can be set without calibration (without command MLC).	Detected Mechanical Limit Position Positive	DMLPP	0, <Stroke ELAX> - <Stroke ELAX + 3mm> / ?
Position of the detected external mechanical limit stop position negative ? = Returns the position of the detected external mechanical limit stop negative. 0 = Deletes the position of the detected external mechanical limit stop negative Note: - If MLPN is deleted (MLPN = 0), the value for the internal mechanical limit stop itself is used for the reference in negative direction, which is <-1mm> as per definition. - The position of an externally mounted mechanical limit has to be accurate. If the entered position of the externally mounted limit stop is wrong, the alignment of the coils to the magnets cannot be completed and the motor won't be capable to drive	Mechanical Limit Position Negative	MLPN	<-3mm> - <stroke ELAX + 3mm> / ?
Position of the detected external mechanical limit stop position positive ? = Returns the position of the detected external mechanical limit stop positive. 0 = Deletes the position of the detected external mechanical limit stop negative. Note: - If MLPP is deleted (MLPP = 0), the value for the internal mechanical limit stop itself is used for the reference in negative direction, which is <-1mm> as per definition. - The position of an externally mounted mechanical limit has to be accurate. If the entered position of the externally mounted limit stop is wrong, the alignment of the coils to the magnets cannot be completed and the motor won't be capable to drive	Mechanical Limit Position Positive	MLPP	<-3mm> - <stroke ELAX + 3mm> / ?

12.6.15 Force Control

DESCRIPTION	Short	CMD	PARAMETER
<p>Force Calibration is being started with adjustable driving distance for the scanning process. Value from 1 to 10'000'000 = Distance in Inc. Of scanning process. ?= Requesting if of scanning values are still available 0 = Delete Force Calibration scanning values</p> <p>Command "FC?" 1 = Force Calibration Values available 0 = No Force Calibration Values available</p> <p>Important: Force Calibration scan drive will begin at current position</p>	Force Calibration	FC	0-< stroke LINAX®/ELAX® / ?
<p>Test function to check Force Calibration effect through manual movement of the carriage slider. 2 = Test Force Calibration On (without active compensation) 1 = Test Force Calibration (with active compensation) 0 = Test Force Calibration off (Servo holds position)</p>	Force Calibration Test	FCT	0,1,2 / ?
<p>Request Status of Force Calibration: 0 = No Force Calibration scan values available 1=Force Calibration scan values available</p>	Force Calibration Valid	FCV	xx / ?
<p>Maximal approved force-proportional current [x10mA] 0 = Deactivated → As soon as the max. approved current has been hit, error „30“ is being activated and can be retrieved over Process Status registry</p>	Limit I_Force	LIF	0 – 1'800 / ?
<p>Bit 15 „I_FORCE_LIMIT_REACHED“ with command TPSR (Refer to chapter 11.7.1 "Force Limitation") Change Limit DR_I_FORCE to xx x 10mA value xx will overwrite the current parameter DR_I_Force, until DRIVE I_FORCE END</p>	Change Limit I Force	CLIF	xx
<p>Driving with limited force until reaching an object or the end position if there is no object. xx= [1-10] No. of the selected Drive I_Force parameter set</p>	Drive I_Force	DIF	xx
<p>Force-proportional, actual current-value filtered [mA] (Refer to chapter 11.7.2 "Force Monitoring") Actual motor current [mA]</p>	I Force Actual	IFA	
<p>Select sectors which should be active. E.g. xx = 100110-> active are the sectors 2,3,6 Binary from right side LSB (binary notation, LSB = sector 1)</p>	Tell motor current Select Sectors	TMC SSEC	xx / ?
<p>Reads I_FORCE peak value [x1mA] xx=not defined-> Max peak value over all sectors xx=n-> peak value of sector n</p>	I Force Peak	IFPK	xx
<p>shows the active sectors which force curve did not correctly pass through E.g. xx = 1001->Error in sector 1 and 4. (binary notation, LSB = sector 1)</p>	Sector I_Force Curve Failed	SIFF	xx / ?
<p>Is taking current actual position as an offset for all sectors with restart of monitoring. Furthermore the positions „Wait for distance greater/less“ and „Jump if distance greater/less“ are adjusted by this offset.</p>	Take Position as Sector Offset	TPSO	

Provide offset for all sectors with restart of monitoring.
 $xx = [Inc] \text{ offset}$

Furthermore the positions „Wait for distance greater/less“ and „Jump if distance greater/less“ are adjusted by this offset xx .
 E.g. $xx = 0$, sets offset to 0

Selecting sector number for which parameters shall be changed. $xx = [1-10]$ Sector number, NSEC? = Retrieving the selected sector number.


Selecting sector number for which parameters shall be changed. $xx = [1-10]$ Sector number, NSEC? = Retrieving the selected sector number.

Selecting sector number for which parameters shall be changed. $xx = [1-10]$ Sector number, NSEC? = Retrieving the selected sector number.

Lowest value I_Force in pre-selected sector. $xx [x10mA]$

Lowest value I_Force in pre-selected sector. $xx [x10mA]$

Definition of transitions **Entry** and **Exit** in sector
 $xx = \text{activated transition } 1,2,3,4 \text{ Entry/Exit}$

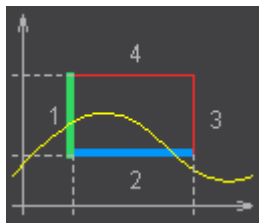

Bit 15..12	11..8	7..4	3..0	xx
Entry	not used	Exit	not used	
4 3 2 1	0	4 3 2 1	0	Transition.
0 0 0 1	0 0 0 0	0 0 1 0	0 0 0 0	bin
1	0	2	0	hex
			4128	dec

Selecting Drive I_Force number in which parameters shall be changed.

$xx = \text{Drive I_Force number } 1-10$. NDIF? = Retrieving selected sector number

Acceleration for Drive I_Force $xx [x1'000 \text{ inc/s}^2]$

Speed for Drive I_Force
 $xx [\text{inc/s}]$

Limitation of I-Force current while Drive I_Force
 $xx [x10mA]$

Direction Drive I_Force
 $xx = 0 \rightarrow \text{positive}, xx = 1 \rightarrow \text{negative}$

Set Sector Offset **SSO** $xx / ?$

Number of Sector for change parameter **NSEC** $xx / ?$

Sector I Force Start **SIFS** $xx / ?$

Sector I Force End **SIFE** $xx / ?$

I Force High **IFH** $xx / ?$

I Force Low **IFL** $xx / ?$

Sector Transition **STC** $xx / ?$

Configuration Decimal

Sector Transition **STCX** $xx / ?$

Configuration Hexadecimal

Number of Drive I_Force to change parameter **NDIF** $xx / ?$

Acceleration of selected Drive I_Force **ADIF** $xx / ?$

Speed of selected Drive I_Force **SDIF** $xx / ?$

I_Force Limit of selected Drive I_Force **IDIF** $xx / ?$

Direction of selected Drive I_Force **DDIF** $xx / ?$

12.6.16 Correction Table

DESCRIPTION	Short	CMD	PARAMETER
Status of correction table: 0= correction table deactivated 1= correction table activated 2= correction table initialized (physical values = Encoder value) Starting position of the correction table in [inc]	Correction Table State	CTAB	0-2 / ?
Distance between the entries in the correction table in [inc]	Correction Table Position Start	CTPS	0-500'000'000 / ?
Preselect absolute encoder position in correction table in [inc]	Correction Table Distance Points	CTDP	10-30'000'000 / ?
Physical position deviation for preselected encoder position in correction table in [inc]	Correction Table Preselect Position	CTPO	0-2'000'000'000 / ?
	Correction Table Value	CTVA	-30'000-30'000 / ?

12.6.17 System Information

DESCRIPTION	Short	CMD	PARAMETER
Present position $\pm 2*10E9$	Tell Position	TP	
Require actual motor velocity [inc/s]	Tell Velocity	TV	
Motor temperature in degree Celsius	Tell Temperature	TT	
Status: 0 = Power OFF, 1 = Power ON, 2 = In motion, 9 = Error	Tell Status	TS	New: please use TPSR
Binary coded process status, size of return string 3 Bytes in HEX format ERROR = BIT 0 HOME = BIT 1 IN_MOTION = BIT 2 IN_POSITION = BIT 3 END_OF_PROGRAM = BIT 4 IN_FORCE = BIT 5 IN_SECTOR = BIT 6 FORCE_IN_SECTOR = BIT 7 INVERTER_VOLTAGE = BIT 8 END_OF_GANTRY_INIT = BIT 9 LIMIT_SWITCH_LEFT = BIT 10 LIMIT_SWITCH_RIGHT = BIT 11 EMERGENCY_EXIT_1, REMAIN POWER ON = BIT 12 <i>(Function can only be used without bus module. With bus module, apply function "EMERGENCY_EXIT").</i> EMERGENCY_EXIT, POWER OFF= BIT 13 COGGING_REFERENCE_DRIVE_ACTIVE = BIT 14 I_FORCE_LIMIT_REACHED = BIT 15 STO PRIMED/HIT = BIT 16 SS1 PRIMED/HIT = BIT 17 SS2 PRIMED = BIT 18 SS2 HIT = BIT 19 SLS PRIMED = BIT 20 SLS SPEED HIT = BIT 21 SLS POSITION HIT = BIT 22 WARNING = Bit 23 INFORMATION = Bit 24	Tell Process Status Register	TPSR	
Actual motor current	Tell motor current	TMC	(mA)

Motion time [milliseconds] of the last profile drive	Tell Motion Time	TMT
Read process timer [milliseconds] refer also program functions TIMER_START, TIMER_STOP	Tell Process Time	TPT
Version number of installed firmware	Version	VER
Version number of installed SMU firmware	Version SMU	VERS
Versions number of the installed bus module firmware	Version Bus Module	VERB
Versions queries of the boot loader (from version V4.00)	Version Boot Loader	VERL
MAC address query of PROFINET / Powerlink / EtherNet/IP bus module	MAC address Bus Module	MACB
Shows CANopen control- and status word an. Important command only provided in WebMotion®.		DS402
Temperature control, instantaneous value integration	I2T	I2T'
Temperature control, maximum value integration painter	I2TM	I2TM'

12.6.18 Bus Module Information

DESCRIPTION	Short	CMD	PARAMETER
Baud rate of the optional CANopen interface	CAN Baud rate	CAB	1'000 - 1'000'000 / ?
Set cycle time [microseconds] in Cyclic Synchronous Position Mode (DS402). Used RMR for interpolation	PDO Cycle Time	PCT	100-10'000 / ?
Versions number of the installed bus module firmware	Version bus module	VERB	
IP address queries EtherNet/IP modules (from version V4.00)	IP Address bus module	EIPB	
Reset bus module	Reset bus module	RESB	
MAC address query of PROFINET / Powerlink / EtherNet/IP bus module	MAC address bus module	MACB	
Re-adjust Bit „P402 Set Point Acknowledge“ to behavior. equal or smaller than firmware V3.68H	Set Point ACK disable	SPAD	0 - 1

12.6.19 Error Handling

DESCRIPTION	Short	CMD	PARAMETER
Error number 01-99	Tell Error	TE	
Error number description string	Tell Error String	TES	
Retrieving error buffer (last 8 appearing info's, warnings or errors)	Tell Error Buffer	TEB	
Description of the error from the SMU	Tell Error SMU	TESM	

12.6.20 System Monitoring

DESCRIPTION	Short	CMD	PARAMETER
Switching off or turning on the encoder plausibility test: 0=Encoder plausibility test on 1= Encoder plausibility test off (for rotary motors only, XENAX® HW >= 4.0)	Encoder Plausibility Checking Disable	ENCPD	0-1 / ?
Watchdog for RS232/Ethernet interface 0 = deactivated 1-60'000 = Watchdog time in [ms]. If output stage is on and no ASCII command was received over RS232 or Ethernet for <WD> ms, output stage is turned off and error code 77 is shown.	Watchdog	WD	0-60'000 ms / ?

12.7 Move Axis by Force

The Force Calibration function compensates the magnetic cogging forces, the load force and the friction forces of the LINAX®/ELAX® iron-core linear motors from Jenny Science.

Refer to chapter “15 Force Processes”



12.8 Move Axis Motion Diagram

Recording position and acceleration.

LOGGING AUTO


Recording starts, as soon as the drive has started. The record lasts until the drive and a possible program have ended.

LOGGING TIME

Recording starts, as soon as the drive has started. The record lasts as long as the time indicated (2-8000ms).

record new

Initialization for new recording sequence. Wait for message “ready for recording next motion”. Start motion in command panel (*move axis / by click* or *by command line*) e.g. G44000.

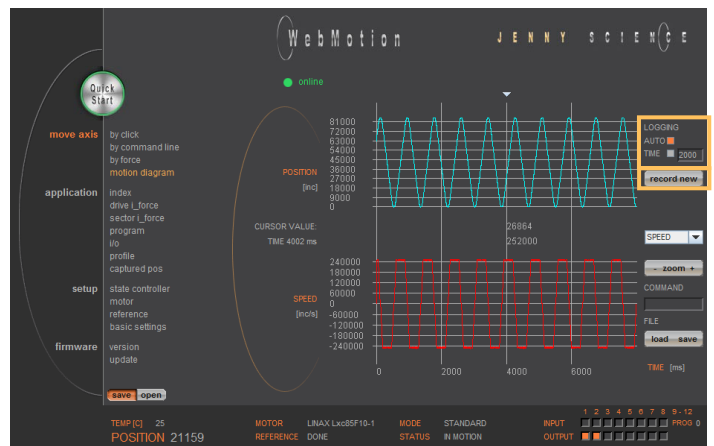

SPEED

Records speed in increments in relation to the position.

IFORCE

Records current in milliamperes in relation to the position.

DEVIATION

Records position deviation in increments.




zoom + / zoom -

Zoom of curve section on time axis.


The middle of the zoom-range can be set with the arrow button on the top. Press key “zoom +” to draw the curve section.

Press key “zoom -” for undo zoom action. The zoom function also works over the mouse wheel.

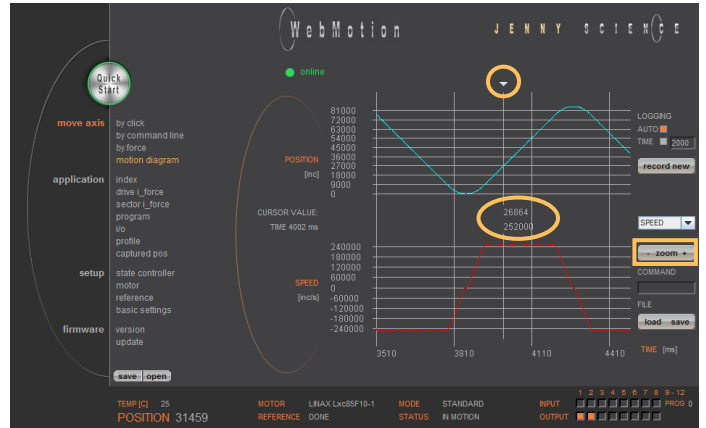

Command

Enter command e.g. starting position of the motor, REF, GO, drive on a position or repeat reverse (RR).


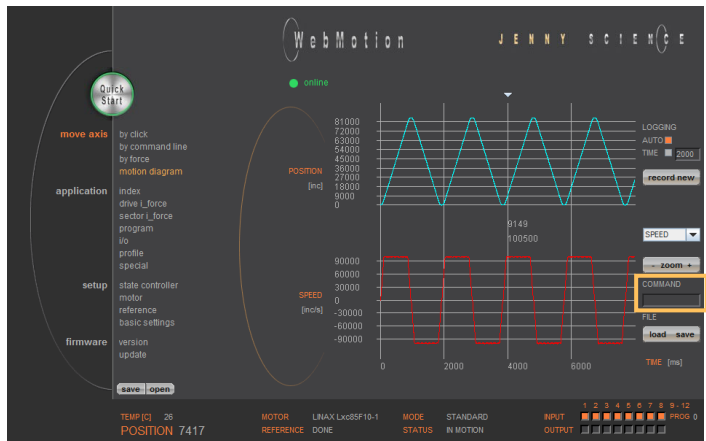


load file

Shows a motion profile which was saved on the computer. The upload has no influence on the parameters of the servo controller.

save file

 Saves the motion profile on the computer.

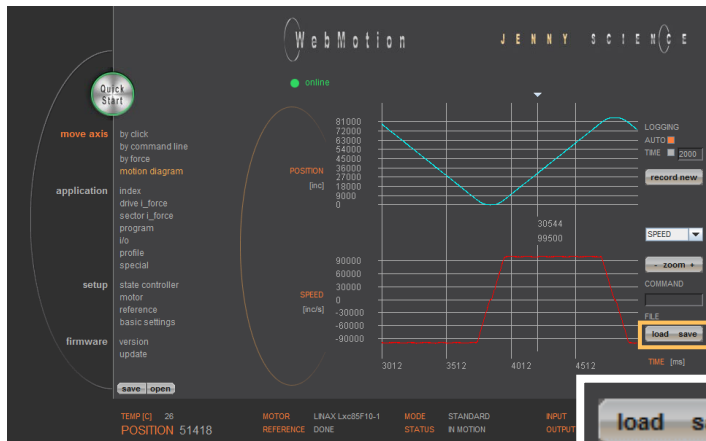

12.9 Index

An Index is a motion profile and contains acceleration (ACCEL), speed (SPEED), distance (DISTANCE) and TYPE of distance (*absolute (ABS)*, with reference to the zero position or *relative (REL)* with reference to the present position).

The values always refer to increments of the incremental encoder. The INDICES simplify programming and reduce the communication time by serial control. Execute with IXxx<CR>.

A maximum of 50 INDEXES can be predefined.

EDIT

NEW INDEX = Create new index

CLEAR INDEX = Clear index number

CURRENT INDEX

A list containing all already defined indices.

PARAMETERS

Setting of the parameters „CURRENT INDEX“


- ACCx1000 Acceleration (2-1'000'000'000 x 1'000 Inc/s²)
- SPEED Speed (10-100'000'000 Inc/s)
- DISTANCE Distance in Inc
- TYPE ABS= Absolut (Position), REL=Relative (WEG)
- Teach Pos Current position is set in the field "DISTANCE"



12.10 Drive I_Force

In the menu „Diag I_Force“ the way/force diagram can be recorded by which the force progression through the sectors can be verified.

Refer more Information in chapter "15 Force Processes"

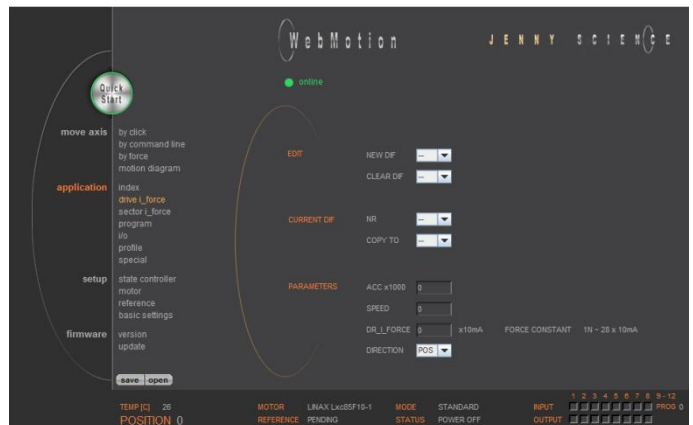


12.11 Sector I_Force

In the WebMotion® program menu „sector I-force“ up to 10 different force sectors can be defined.

Example:

Once an object is touched the force progression shall be examined in a sector of 150 to 170 Increments. When entering the force sector (“ENTRY”) the force should be between 3 and 4N. When exiting the sector (“EXIT”), the force should have reached 4N. These force specifications are defined with the in the force sector incoming and exiting sector boundaries.

Refer more Information in chapter “15 Force Processes”

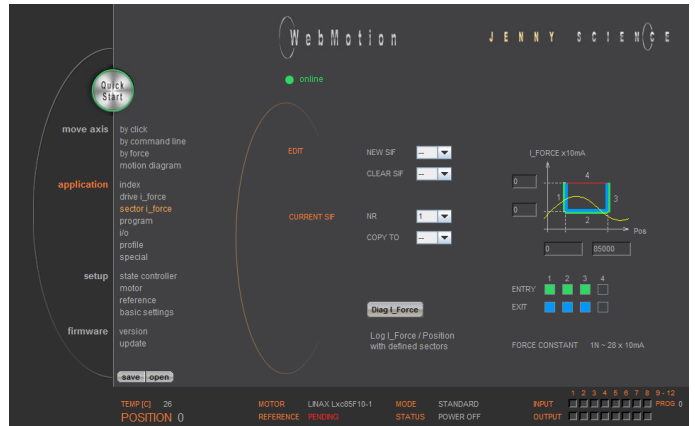

12.12 Program

Please also consult the TUTORIAL Video **JSC Tutorial 5: Programming of a Pick and Place System with XENAX® Master-Slave** on our website, in which you can follow a practical example.

Here you can define program sequences line by line.

PROGRAM

Select, create, copy or delete a program.

LINES

In this list all defined program lines of the present program will be shown. The arrows at the top and below serve for scrolling within the window. Is a line in the list selected then it can be moved with MOVE arrow.

Maximum number of lines depends on program mapping (PMAP, default = 0):

- MPAP = 0 Prog 1-15: 50 lines Prog 16-63: 10 lines
- MPAP = 1 Prog 1-5: 130 lines Prog 6-63: 10 lines

EDIT LINE

This is where program lines can be edited.

SET = sets the edited line in the LINES list.

INSERT = Edited lines can be inserted at any position by selecting the according location in the LINES content.

CLEAR = lines can be deleted by selecting the according line in the list.



12.12.1 Program commands

Reference for LINAX®/ELAX® and rotary motors	REFERENCE		MS
Execute index number xx or change according operation yy with distance zz	INDEX	xx, yy, zz	MS
Set Output number xx	SET OUTPUT	xx	MS
Clear Output number xx	CLEAR OUTPUT	xx	MS
Go to Line number xx	GOTO LINE	xx	
Go to line number xx, if input number yy active	GOTO LINE IF INPUT	xx, yy	
Set Loop Counter # to xxxx (1-10000)	SET LOOP COUNTER (A-E)	xxxx	
Decrement Loop Counter #, if not zero, jump line xx.	DEC LOOP COUNT (A-E) JNZ LINE	xx	
Loop counters can be interleaved with each other			
Wait xx ms	WAIT TIME (ms)	xx	
Wait for logical High of Input number xx within timeout frame yy, otherwise jump to line zz „error handling“ (timeout can only be used locally, not for (remote)	WAIT INPUT NT HIGH	xx	MS
Wait to logical Low of Input number xx within timeout frame yy, otherwise jump to line zz „error handling“ (timeout can only be used locally, not for remote)	WAIT INPUT NT LOW	xx	MS
Set position counter to 0, not possible with LINAX®/ELAX® linear motor axis	CLEAR POSITION		
Execute Profile number xx	PROFILE	xx	MS
Start process timer	TIMER START		
Stop process timer	TIMER STOP		
Command TPT (Tell Process Timer) returns measured time in milliseconds			
LINAX®/ELAX® drives to mechanical limited position, refer <i>setup / reference</i> .	REF LIMIT STOP		
Executing Force Calibration, Start Pos xx, End Pos yy	FORCE CALIBRATION	xx, yy	
Execute DRIVE I_FORCE No. xx	DRIVE I_FORCE	xx	
Selection of active sectors with Bit mask.	SELECT SECTORS	xx	
E.g. xx = 1010 → sectors 2 and 4 are active. LSB is on right.			
Wait until Limit I_FORCE is reached according parameter DRIVE I_FORCE within timeout xx, otherwise jump to line yy „error handling“	WAIT LIMIT I_FORCE	xx, yy	
Wait for distance (absolute position – Sector Offset) to be greater than xx within timeout frame yy, otherwise jump to line zz „error handling“	WAIT FOR DISTANCE GREATER	xx, yy, zz	
Wait for distance (absolute position – Sector Offset) to be smaller than xx within timeout frame yy, otherwise jump to line zz „error handling“	WAIT FOR DISTANCE LESS	xx, yy, zz	
Wait for process status register Bit xx High within timeout frame yy, otherwise jump to line zz „error handling“	WAIT PROCESS STATUS BIT HIGH	xx, yy, zz	
Wait for process status register Bit xx Low within timeout frame yy, otherwise jump to line zz „error handling“	WAIT PROCESS STATUS BIT LOW	xx, yy, zz	
Is taking the actual position as offset value for all sectors followed by the restart of monitoring.	TAKE POS AS SECTOR OFFSET		
Furthermore the positions “Wait for distance greater/less” and “Jump if distance greater/less” are being adjusted by the offset as well.			

Setting offsets for all sectors followed by the restart of monitoring. xx = [Inc] Offset	SET SECTOR OFFSET	xx	
Furthermore the positions "Wait for distance greater/less" and "Jump if distance greater/less" are being adjusted by the offset xx as well. e.g. xx = 0, sets offset incl. TAKE POS AS SECTOR OFFSET to 0			
Changing Limit DR_I_FORCE to xx x 10mA Value of I_FORCE will overwrite the current parameter I_Force in DRIVE I_FORCE until DRIVE I_FORCE END	CHANGE LIMIT I_FORCE	xx	
Jump to line zz if distance xx (absolute position – sector offset) greater than xx e.g. driving distance was too big after force was reached	JUMP IF DISTANCE GREATER	xx, zz	
Jump to line zz if distance (absolute position – sector offset) smaller than xx e.g. driving distance was too small after force was reached	JUMP IF DISTANCE LESS	xx, zz	
Jump to line xx "error handling" if one or more sectors are not passed correctly. Only active sectors are being tested. Caution: Before this analysis can be done, "DRIVE I_FORCE END" has to be completed.	JUMP IF I_FORCE SECTORS FAULT	xx	
Stop Drive I_Force, current position = set point position, parameter LIMIT DR_I_FORCE inactive	DRIVE I_FORCE END		
Power stage without power, the linear motor is movable by hand.	POWER QUIT		MS
Power continues (>PWC)	POWER CONTINUE		MS
Turning on the power stage with taking over the most recent absolute position and without the need of referencing the linear motor, e.g. after error 50 or after "Power Quit" . This is only possible as long as the logic supply has not been interrupted after the linear motor was referenced.			
Program is being ended and does not proceed to last line. Beneficiary for „error handling“	PROGRAM END		

Please note:

All entries in menu *program* must be downloaded in menu *loading / application / Download Appl* to take effect on servo controller.

MS: Master/Slave function can be started on another controller.

LOC = Local, ID1...4 = Device with according Card Identifier (CI)

The command set for the XENAX® force processes are explained in the document "XENAX® Xvi Force Processes".


Example: Initialization LINAX®/ELAX®

This example shows the initialization of a LINAX®/ELAX® linear motor with the command REFERENCE which then drives to a defined starting position (INDEX 1).

The start position is free to choose as long as it is within the stroke of the motor. In this example the axis drives to start position 0.

Important:

The command REFERENCE has to be completed once after powering on the servo controller. Only after reference, other motion commands are possible.

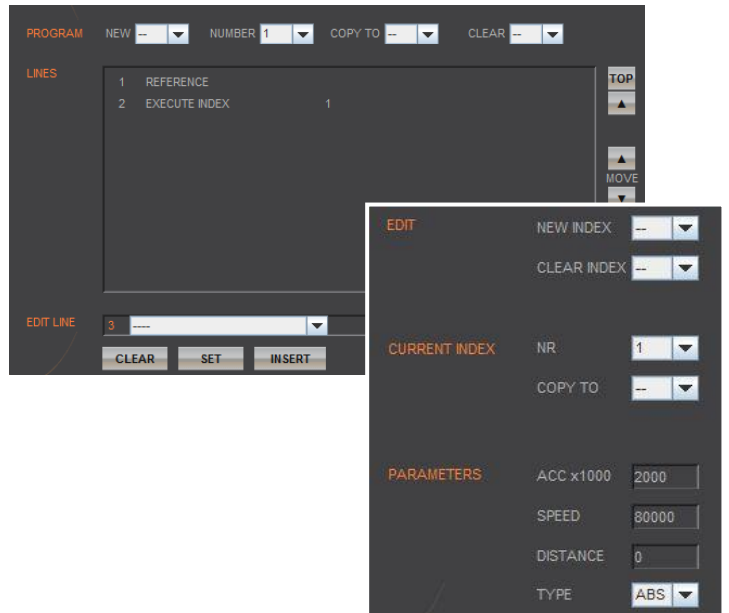


Example: Initialization rotary motor

The reference function for rotary motors can be defined in the menu *setup / reference* (refer chapter "Reference for Rotary Motors"). With this function the motor drives first to a reference switch (approx. zero) and then to the encoder Z-mark.

If reference position differs from starting position, an index (INDEX 1) can be executed to move to start position.

The program starts with the ASCII command "PG1" in the menu *move axis / by command line* or by activating an input function "PG1".

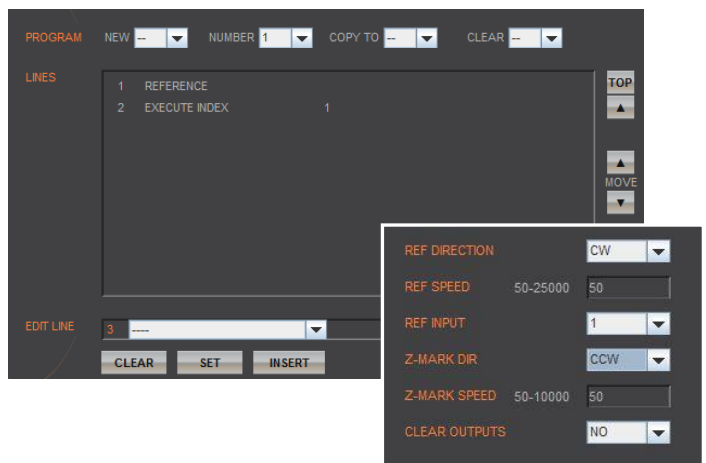

12.13 I/O Functions

OUTPUT FUNCTIONS

Assigning output functions to a physical output. ON und OFF of the outputs by mouse click.

INPUT FUNCTIONS

Assigning input functions to a physical input. Choice of high- or low-activity of all inputs. Input 9-12 binary coded.

In the operations overview, the physical input and output conditions are displayed.



12.13.1 Selection of Input Functions

LINAX®: Reference for LINAX®, travels the distance of two coded reference marks and calculates the absolute position according LINAX® linear motor.	REF	
ELAX®: Reference for ELAX®, the absolute position is determined by driving on a mechanical limit.		
Rotary Motors: Reference according REFERENCE for rotary motors.		
Execute index number xx or change according operation yy with distance zz	IX	xx, yy, zz
Execute Program xx	PG	xx
Set output xx	SO	xx
Clear output xx	CO	xx
Drive (Jog) positive (const. speed xxxxx inc/sec) while input # is active	JP	xxxxx
Drive (Jog) negative (const. speed xxxxxx inc/sec) while input # is active	JN	xxxxx
Capture Position, on triggered edge at input	CPOS	
Interrupt program, while Input active	IP	
Stop Impulse, edge triggered*)	SI	
Stop Impulse Counter, like SI but does not set position counter to 0*)	SIC	
Limit-switch negative*)	LS-	
Limit-switch positive*)	LS+	
Emergency Exit with power off*)	EE	
Emergency Exit with power on, Position stop (<i>Function can only be used without bus module. With bus module, apply function "EE"</i>)	EE1	
Power ON continue, keep encoder counter	PWC	
Execute profile nr. xx	PRF	xx
Reference Limit Stop, also refer menu <i>setup / reference</i>	RSTO	
Speed and acceleration will be reduced by xx percent	OVRD	xx
Stops and quits active program	PGEX	
Drive I_Force No. xx	DIF	xx
Power stage without power, the linear motor is movable by hand.	PQ	

*) Stop with ED

(Emergency Deceleration) braking ramp

Notes to Input Functions:

Except EE, EE1 all input functions must only be parameterized in a Pick & Place Maser or Gantry Master.

For rapid deceleration in emergency shut down situations (LL, LR, EE, EE1, SI, SIC, LS-, LS+) the special ED (Emergency Deceleration) can be given a value (COMMAND > ED xxxxx).

The Emergency Exit functions have the highest priority and are always activated immediately. As long as EE is active no other function can be executed.

For the other functions the following applies: If another function is already active it has to be finished before the next one is started. If several function calls are current at the same time, then the one with the lowest input number is executed first.

To run a program endlessly the assigned input can be simply left active.

With Interrupt program (IP) the program being executed can be interrupted. If IP becomes inactive the interrupted program will be continued directly.

With stop impulse (SIC) the running movement is stopped and aborted.

A new travel command can then be executed even with unreleased stop impulse (SIC active).

12.13.2 Selection Output Functions

<i>REF has been completed</i>	REF
In motion, motor is running	INMO
End of program	EDPG
Trigger (5ms, defined by TGU, TGD commands)	TGR
Error pending	ERR
Release brake	BRK
In position, within deviation target position (DTP)	INPO
Limit I_Force reached (command LIF)	IFML
I Force In Sector, when motion is completed	IFSE
In Sector (during and after motion is completed)	INSE
In Force (during and after motion is completed)	INFO
Warning pending	WARN
Information pending	INFM

12.14 Profile (Velocity)


Complex motion profiles can be linked with up to seven profile segments.

The XENAX® servo controller is able to store up to five profiles.

The profile definition includes a start position as well as absolute end-position, end-speed and acceleration of each profile segment. The result of these indications is the segment type (Speed up, Slow down, constant speed).

The “Profile Check” tests if the entered values can be realized with the connected linear motor.

Before profile curve starts, the linear motor has to be located at the predefined start position.

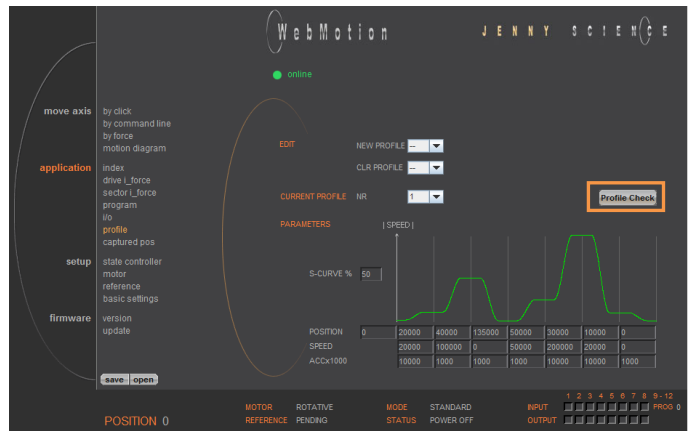

EDIT

NEW PROFILE = Enter new profile

CLR PROFILE = Clear profile

CURRENT PROFILE

This list contains all predefined profiles.

PARAMETERS

Set up of the parameters in „CURRENT PROFILE“

S-CURVE

Percentage S-curve rounding of the profile. Automatic calculation of jerk parameter for each profile segment.

POSITION

First panel: Input absolute start position

POSITION

End position of corresponding profile segment

SPEED

End speed of corresponding profile segment

ACCx1000

Acceleration within profile segment

PROFILE CHECK

The parameters will be checked on drivability (is distance long enough for demanded speed and acceleration ?)

Correct profile segments are colored in green, wrong segments are red and untested segments are orange


Defined and tested profiles have to be stored in the servo controller under „save“.

A profile can be started with the command PRFx. X represents the profile number.

Profiles can also be started as input function or in a program.

12.15 Captured Pos

The XENAX® servo controller has two special functions to read the current position of the motor.

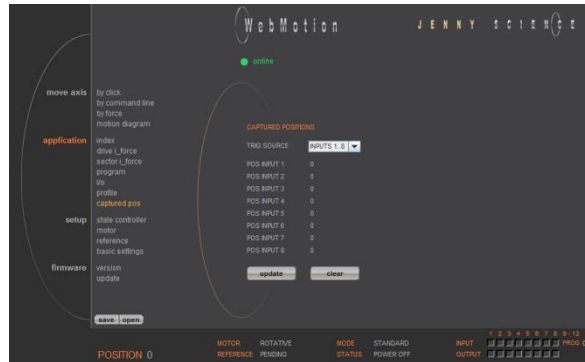


Record function of the actual position controlled by Input

In the WebMotion® menu I/O, you can select the record function CPOS for all digital inputs 1-8.

Reaction time > 4 ms.

(Input 1 = Pos Input 1 etc.)

ASCII command: TCPn (n = register number)

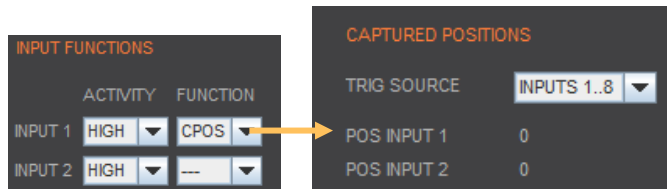


Record function of the actual position controlled by edge

With each increasing edge at input 12, the current position of the motor is written in a buffer register (Start is Captured Pos 1).

Reaction time ~ 4-6µs.

(First edge position = Captured Pos 1 etc.)

ASCII command: TCPn (n = register number)

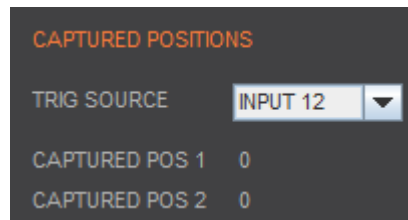

Function is available over Jenny Science bus module in asynchronous operation, too.

Object	Sub Idx		ASCII
5000h	0x5010	CLCP Clear all Captured Position	CLCP
	0x5015	Captured Position Mode Input 12	CP120
	0x5016	Captured Position Mode Input 1..8	CP121
5003h	0x37	Read Buffer Position (1..8)	TCPn (n=1..8)
	0x38	Return of value	

12.16 State Controller

The closed loop control system consists of a state controller with observer. The parameterization is very easy and clearly arranged.

PAYLOAD

Additional payload on the linear motor. The weight of the motor carriage slider is automatically taken into consideration with the motor identification.

Or

INERTIA (only for rotary motors)

Adjustment of the external torque of inertia.

If a gear box is placed between the motor and the load, you must adjust the external torque of inertia according to the motor shaft. The gear transmission ration needs to be squared.

e.g. With a gear transmission ratio of 20:1, we need to reduce the external torque of inertia by a factor of 400.

Bei Direktantrieben ist der Parameter-Wert für das Trägheitsmoment des externen Aufbaus (INERTIA) wichtig, sonst schwingt der Antrieb. Da ein Faktor 10⁻⁹ eingerechnet ist, kann dieser Parameter sehr grosse Werte annehmen, dann ist dieser im Zahlenfeld rechts einzutragen. Beispielrechnung: Der externe Aufbau ist eine homogene Scheibe mit 1.1kg Gewicht und Ø200mm. Die Formel lautet $J = \frac{1}{2}m \cdot r^2 = 0.55 \cdot 0.1^2 = 0.0055 \text{kgm}^2$, Skalierung mit 10⁻⁹ ergibt einen Parameterwert von 5'500'000.

Please refer to document *Param_Rotative_Motor_Xvi75V8* on www.jennyscience.de/en for more information.

GAIN POS

Gain of position controller. This parameter must be reduced when payload is increased.

Auto Gain

Sets the gain of position controller based on the entered payload value. This is a theoretically calculated value. A small adjustment might be necessary and can be completed with "GAIN POS".

FILTER FREQ

Notch Filters frequency. At a value of 0, the notch filter is deactivated. Typical values are in between 300-500Hz. The frequency might be detected with a smartphone app.



F Setting

Lock at Chapter 0

F Setting

GAIN CUR

Gain of current controller.

Default

Standard setting of the controller gain of current. This value can be adjusted with "GAIN CUR" and can be set to standard setting with the key „Default“.

DEVIATON POS

Maximum permissible deviation of position in encoder increments.
If this value is exceeded the error 50 occurs and flashes on the 7-segment display.

DEV TARGET POS

Permissible deviation of position in the target point until the status "in position" comes up.



12.16.1 F Setting

The band width of the position control (GAIN POS) should be set as high as the movements can be completed within the tolerable position deviation but before the motor begins to oscillate. In some applications, usually with high payloads, it sometimes happens that no setting can be found that meets both criteria. If the motor with a set band width begins to oscillate because of a resonance in the system, this oscillation can possibly be suppressed with a filter.

In the menu „state controller“ in WebMotion® the correct PAYLOAD and the required GAIN POS have to be set. If the motor oscillates, the resonance frequency can be found and suppressed with the frequency analysis function.

With the button „F Setting“, the frequency analysis pops up.

When operating, the frequency analysis can be started anytime. But because the current of the motor is being analyzed for the frequency analysis the, the output stage must be turned on. As soon as the analysis is completed, the measuring results are shown in WebMotion® and the frequency can be set.

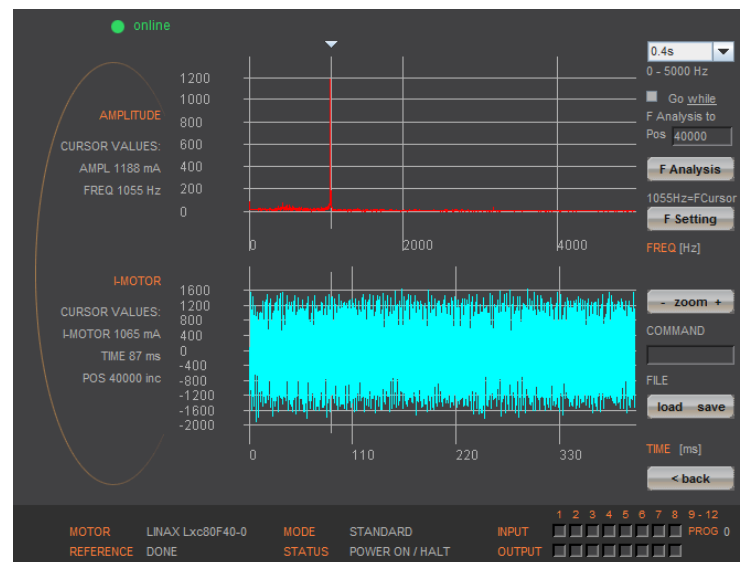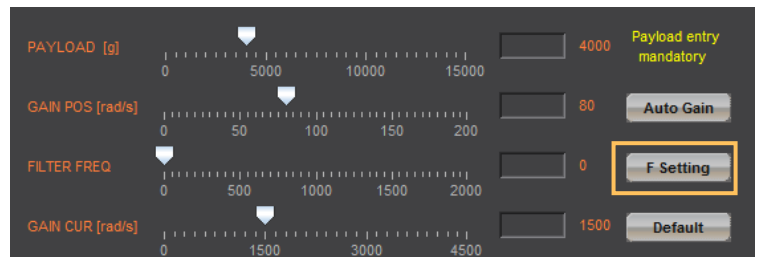

Settings for the Frequency Analysis

Recordable Time:


The longer the recording time is, the higher is the frequency resolution, but the smaller is the measurable frequency range. For each recordable time, the according measurable frequency range will be shown. Please begin with the minimal recording time of 0.4s (with the maximal frequency range). For low resonance frequencies, the analysis can be repeated with higher recording time and reduced frequency range.

0.4s	0 - 5000 Hz
0.8s	0 - 2500 Hz
1.6s	0 - 1250 Hz
3.2s	0 - 625 Hz

Go while F Analysis

Turned off:

During the frequency analysis there is no movement of the axis. Please select this option, when the analysis should be completed in halt mode or when there is already a movement active (e.g. through a running program or through a superior PLC).

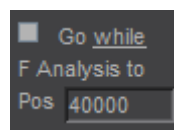


Turned on:

During the frequency analysis, the axis moves to the indicated position within the selected recording time.


F Analysis

 Starts the frequency analysis (and the movement if „Go while F Analysis“ is turned on).



F Setting

 
If the cursor is located in the adjustable filter frequency range (160...2000Hz), the filter frequency can be set according to the frequency the cursor shows by clicking the button „F Setting“. Directly after the frequency analysis, the cursor is automatically located on the frequency with the maximal amplitude within the adjustable filter frequency range. It is likely that this is where the resonance frequency is. However, the cursor can be moved anytime to set another filter frequency.



If the filter shall be turned off, the cursor has to be set to the frequency of 0 and then the button „F Setting“ has to be pushed.

Process of a Frequency Analysis:

This process shows a typical process of a frequency analysis:

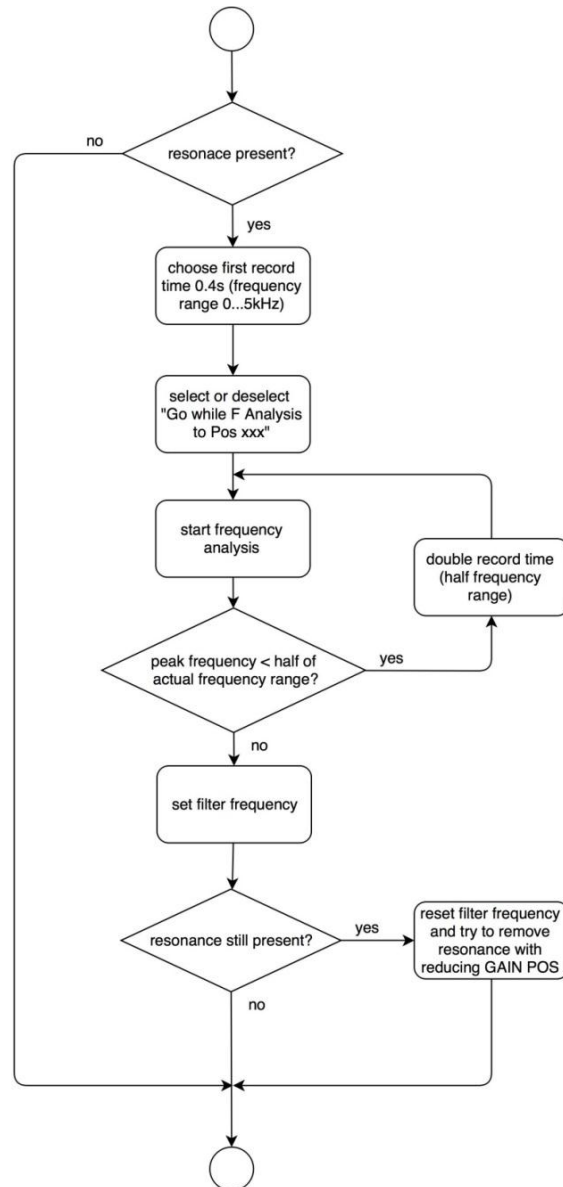

Notes to frequency analysis:

- The filter frequency might not always be able to clear the oscillation. Especially when the resonance frequency is low, the controller can possibly be affected too much by the filter frequency and the oscillation won't disappear. In this case please reduce GAIN POS until the oscillation disappears.
- If there are multiple resonance frequencies, try to put the filter frequency in the approximate middle of the resonance frequency.
- On frequency 0, the mean current will be displayed during the frequency analysis. It corresponds to the DC-portion of the motor current, which is rarely 0.

Diagram Amplitude

In this diagram, the amplitudes of all existing frequencies in the motor current are shown. The amplitude and the frequency of the cursor position are displayed on the left side of the diagram.


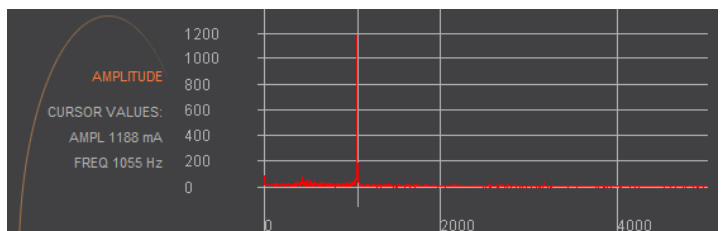


Diagram I-Motor

This diagram displays the motor current for the frequency analysis. The motor current and the recording time at the cursor position are displayed on the left side of the diagram. Furthermore the same legend shows the position the linear motor slide was located, at the time of the recording.

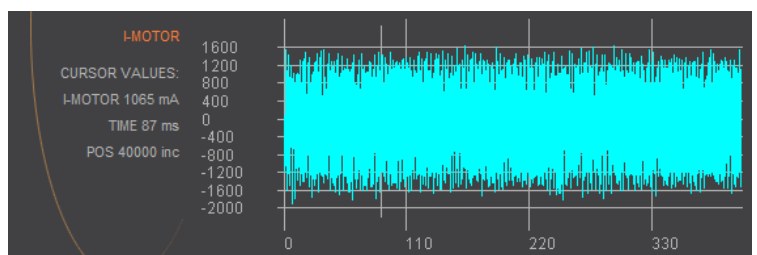

12.17 Motor

12.17.1 Motors LINAX® and ELAX®

MOTOR TYPE

The connected motor type of LINAX® and ELAX® series will be recognized and shown automatically.

I STOP

Maximal nominal current.
Current limitation in standstill position or during constant speed.

I RUN

Maximum peak current.
Current limitation during acceleration and deceleration.

POLE PAIRS

LINAX® Lx and ELAX® Ex linear motor pole pairs = 1

INC PER REVOL

Number of encoder increments per revolution.

Linear motor axis:

Lxc 44F04, INC PER REVOL = 12'000

other LINAX® products Lxc, Lxe, Lxu, Lxs,

INC PER REVOL = 24'000

ELAX®, INC PER REVOL = 14'171

PHASE DIR

Direction of phase control
U, V, W or V, W, U, depending on motor type.
LINAX® / ELAX® linear motor, PHASE DIR = 0

PHASE OFFSET

Correction of electrical angle, in accordance with the orientation of the coil to the magnet. Value for all LINAX® and ELAX® products and the most of rotary motors PHASE OFFSET = 0



12.17.2 Motor Rotary Servo Motors

MOTOR TYPE

Motors which of Jenny Science are sold, are available in the database engine and can be selected.

For parameterization of rotary servo motors, refer document *Param_Rotativ_Motor_Xvi75V8.pdf* On www.jennyscience.de/en/download.

I NOM

Thermic acceptable continuous current

I TORQUE

Depends on the application. Limit for acceleration and deceleration, temporary active.

POL PARS

Number of pole pairs of AC / DC / EC brushless servo motors

For DC brush-type servo motors, set POLE PAIRS to 0

INC PER REVOL

Number of encoder increments per revolution by AC / DC / EC brushless servo motors. With DC brush-type servo motors it is irrelevant.

PHASE DIR

Direction of phase control

U, V, W or V, W, U, depending on motor type.

With DC brush-type servo motors:

PHASE DIR = 0, if motor shaft turns clockwise with direct DC-supply voltage.

PHASE DIR = 1, if motor shaft turns counter clockwise with direct DC-supply voltage.

PHASE OFFSET

Correction of electrical angle, in accordance with the orientation of the coil to the magnet. Value for the most of rotary motors PHASE OFFSET = 0
Harmonic Drive PHASE OFFSET = 330

ROTOR INERTIA

Rotor moment of inertia of the Motor, with Factor 10^9

TORQUE CONST


Torque constant of the Motor, with Factor 10^6

INDUCANCE

Phase to Phase inductance of the Motor

RESISTANCE

Phase to Phase resistance of the Motor

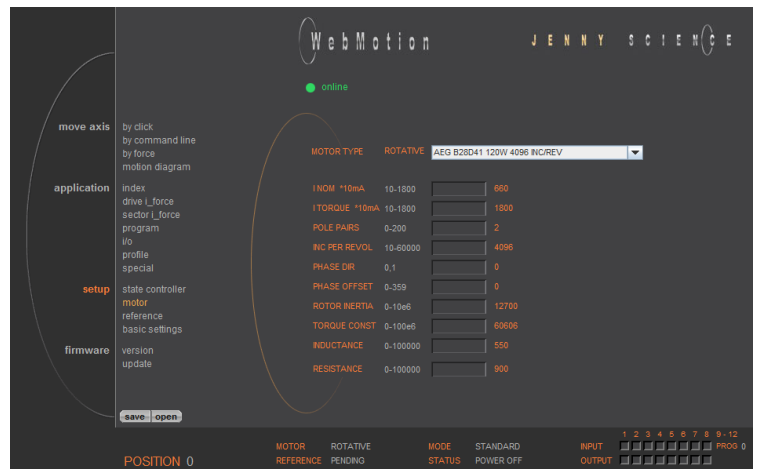


12.18 Reference

12.18.1 Reference LINAX®

12.18.1.1 Reference Absolute, According Reference Marks

REFERENCE Selection

Default, reference over two reference marks on the measuring scale with calculation of the absolute position. This position refers to the mechanical zero point of the LINAX® linear motor axes.

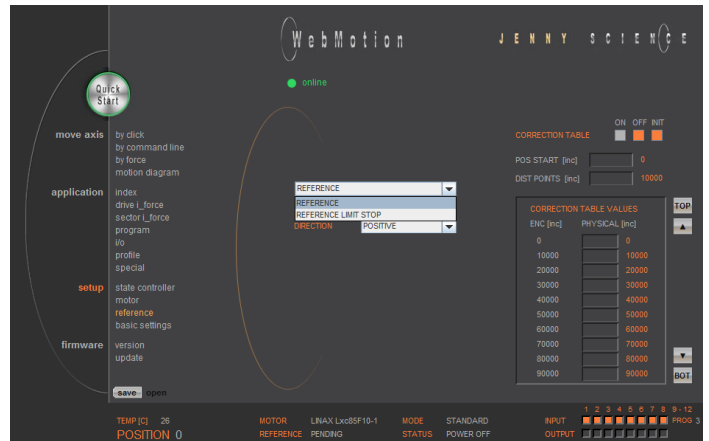

12.18.1.2 Reference to Mechanical Stop

Selection REFERENCE LIMIT STOP

Important: For LINAX® execute first „>REF“, normal reference with absolute position. Only then „>RSTO“ possible.

After the ordinary reference, the command “RSTO” moves the LINAX® carriage slider to a mechanical stop. After the stop, the position can be re-red. This function has no influence on the absolute positioning counter.

CREEP DIR

UP (Travel direction positive)

DOWN (Travel direction negative)

CREEP SPEED

Speed to mechanical stop [INC/s].

CURRENT LIMIT

Nominal motor current [x10mA] during reference

Power $F = \text{motor current} \times \text{force constant}$



REF WINDOW

Maximal allowed variation compared to last REF position [INC].

REF WINDOW = 0, testing off
Output Function REF = 1

REF WINDOW = 1, testing on

Variations within allowed tolerance (REF Window):
Output function REF = 1, current REF position will be new reference position.

Variations out of allowed tolerance:
Output function REF = 0,
The subsequent reference will be the new reference position.

12.18.1.3 Modification of Reference Travel Direction

DIRECTION

Enter start direction of the reference travel direction:

UP (DEFAULT) = Reference direction up. Away, from absolute zero point, in positive direction.


DOWN = Reference direction down, direction towards absolute zero point.

GANTRY => UP = Motors in same direction up, in positive direction (away from zero point).

GANTRY => DOWN = Motors in same direction, negative direction (towards zero point).

GANTRY<=>UP = Motors in opposite direction up.

GANTRY<=>DOWN = Motors in opposite direction down.

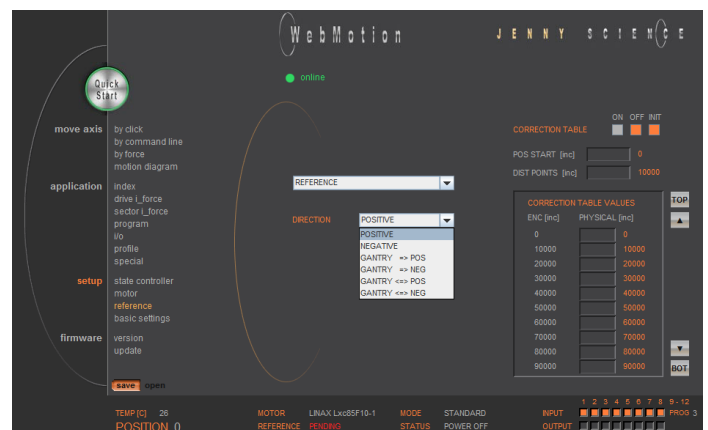

12.18.2 Reference ELAX®

ELAX® does not possess Z-marks on the measuring scale. The absolute position is determined by driving on a mechanical limit. The direction of the reference can be positive or negative (refer to ASCII command **DRHR**)

12.18.2.1 Reference with Internal Limit

If there are no externally mounted limit stops („**MLPN**“ = 0 and „**MLPP**“ = 0), the reference will be completed by the internal mechanical limits of ELAX® itself.

ASCII command „**MLPN**“= Mechanical Limit Position Negative
 ASCII command „**MLPP**“= Mechanical Limit Position Positive

Negative Reference (DRHR = 1)

The slide drives in negative direction until the mechanical limit is recognized. This position will then be set to <-1mm> as per definition. In order to complete the reference, the slide moves then to the absolute position 0.

ASCII command „**DRHR**“= Direction REF

Positive Reference (DRHR = 0)

The slide drives in positive direction until the mechanical limit is recognized. If the calibration of the internal mechanical limit was completed (MLC, Mechanical Limit Calibration) positively, the current position is set to the value „**DMLPP**“. If no calibration of the internal mechanical limit was completed positively („**DMLPP**“ = 0), the current position is set to <stroke ELAX + 1mm> as per definition. In order to complete the reference, the slide moves then to the absolute position <stroke ELAX + 1mm>.



12.18.2.2 Reference with External Limit

If there are externally mounted limit stops (**MLPN** ≠ 0 or **MLPP** ≠ 0), the reference (REF) will be completed to one of the externally mounted limit stops.

ASCII command „**MLPN**“= Mechanical Limit Position Negative
 ASCII command „**MLPP**“= Mechanical Limit Position Positive

Negative Reference


The slide drives in negative direction until the mechanical limit is recognized. This position will then be set to the value of „**MLPN**“. In order to complete the reference, the slide drives to the absolute position <MLPN + 1mm>.

Positive Reference

The slide drives in positive direction until the mechanical limit is recognized. This position will then be set to the value of „**MLPP**“. In order to complete the reference, the slide drives to the absolute position <MLPP - 1mm>.

Important Note:

The position of an externally mounted mechanical limit has to be accurate. If the entered position of the externally mounted limit stop is wrong, the alignment of the coils to the magnets cannot be completed and the motor won't be capable to drive. If the ELAX® slide is driven to the internal negative limit position, the slide is positioned at <-1mm> as per definition. The position of an externally mounted limit stop has to be indicated in relation to <-1mm>

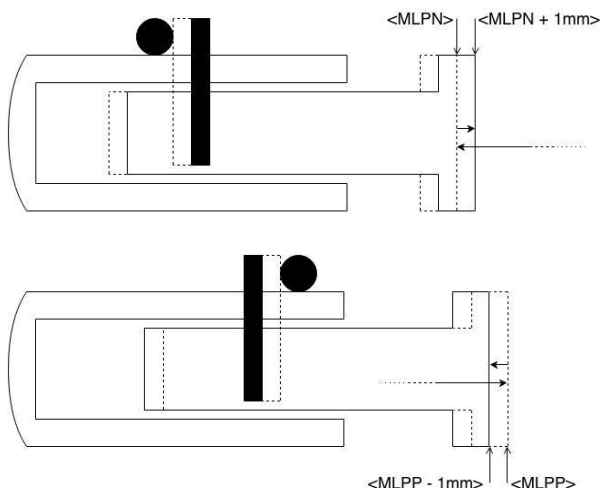

12.18.3 Reference Rotary Servo Motors

For rotary Motors only, for LINAX® or ELAX® please use directly command „>REF“.

CW = ClockWise
 CCW = CounterClockWise

REF DIR

Defines start direction for searching the external REF sensors 1 = CW, 2 = CCW

REF SPEED

Defines speed to search the external REF sensor.

If no home sensor exists, then set this value to 0.

REF INPUT

REF sensor external, input number (1-8).

Z-MARK DIR


Defines start direction for searching the Z-mark on encoder 1 = CW, 2 = CCW.

Z-MARK SPEED

Speed to search the Z-mark. If no Z mark (Reference mark) exists, then set this value to 0.

CLEAR OUPTPUTS

Set all outputs to OFF after reference.

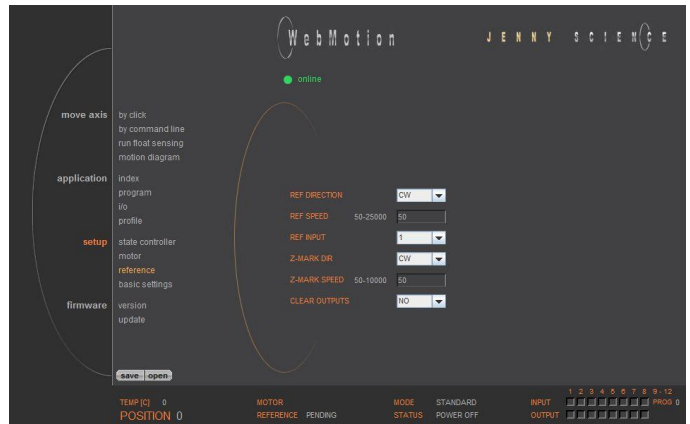

12.18.4 Correction Table for LINAX® / ELAX®

Depending on the application's construction in which a LINAX® or ELAX® linear motor axis is used, it is possible that the encoder position does not correspond to the actual physical position of the linear motor slide (e.g. in cross table or for high cantilevered applications with leverage effect).

To a certain degree, the XENAX® servo controller offers the possibility to correlate the encoder position with the actual position. The correction table in WebMotion® offers 51 entries in which the physical position can be entered in fixed distances to the encoder position. The physical position can be measured with an interferometer.



The range for the way can be freely selected.

Furthermore, the starting point and the distances between the entries of the table can be defined. If for example the range 0-100'000 increments shall be corrected, the starting position is 0inc and the distance for the 50 remaining table entries is 2'000 inc (100'000 / 50).


The correction values for the table are determined as follows: If the correction table is deactivated, all positions that were entered in the table are being driven to (example above: 0inc, 2'000inc, 4'000inc, ..., 100'000inc). At each position, the actual physical position has to be measured and entered in the correction table. When activating the correction table, all driving commands refer to the actual physical position and no longer to the encoder position of the LINAX® or ELAX® linear motor axes.

Limitations

- Correction table is not supported in case of rotary motors
- Correction table is not supported with communication over Real time Bus module (for example EtherCAT)
- This correction table runs with following commands and functions only: >G, >GP, >GW, >IX, >PRF, >RR, >RW, >TP

Input the correction values with WebMotion®:

With the navigation **setup/reference** in case of LINAX® or ELAX®

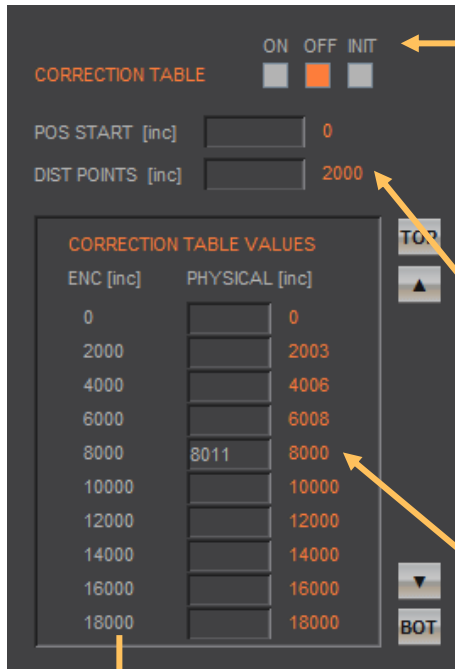

- INIT** Initialize correction table, physical position value = encoder value
- OFF** Correction not active, moving commands refer to encoder position value
- ON** Correction table active, moving commands refer to physical position value

- POS START** Startposition of correction table.
- DIST POINTS** Distance between data entries in correction table

Physical absolute Position, measured with laser interferometer.
If you enter a G8000 by command, and the laser interferometer reads the physical position 8011, you can put it in the table and press ENTER to take it over to the table.

Encoder Position (automatically generated from POS SSTART and DIS POINTS)

Notes to correction table:

- For the positions outside of the correction table, the correction of the first respectively the last entry in the correction table holds valid. For example the last entry is „ENC:100'000 -> PHYSICAL 100'017“, so for the encoder position of 110'000 the physical value of 110'017 is considered.
- The position values between the table entries are interpolated.
- The correction table is saved in the application data of the XENAX® servo controller.
- After a reset of the XENAX® servo controller (command “RES”), the correction table will be initialized and deactivated (physical position = encoder position).
- During the measurement of the physical position values, the correction table has to be deactivated.

ASCII Commands

>RES (Reset XENAX®) the correction table status is OFF, encoder values = physical values

>CTAB 0 (= OFF)
 >CTAB 1 (= ON)
 >CTAB 3 (= INIT)

>CTPS 0 (set correction table position start)
 >CTDP 10000 (set correction table distance points)

Setup individual correction table values
 >CTPO 20000 (preselect absolute encoder position)
 >CTVA 20003 (set correction table value with measured physical absolute position)


Important:

The reference point is also depending on the mechanical precision.
 Hence this reference point must be always at the same position
 We look for Reference REF 2 times.

Application example for Reference:

>REF Absolute position is calculated anywhere on the linear motor stroke
 >G0 Go to absolute position 0
 >REF Absolute position is calculated next to the 0 point
 This is repeatable at the same position.
 >G0 Go to absolute position 0
 → Now the Linear motor axis is ready

Remark: The position (WebMotion®/ TP „Tell Position“) is the physical absolute position
 The POSITION Value is blinking red/white when the correction table is in use.

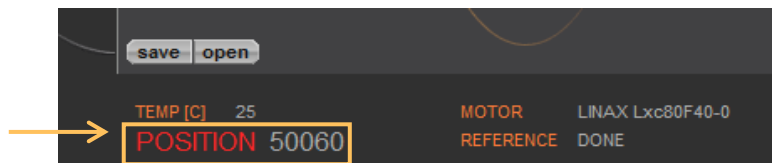

Influence of Temperature on Measuring System

Besides the position deviation, which can be corrected with the correction table, the temperature influence on the measuring system has to be considered, too.
 The deviation due to temperature can't be corrected in the correction table and is about 8.5µm per degree Celsius and meter for the optical measuring system. The optical measuring system
 Please refer to data sheet of the according motor.

Examples:

1000mm optical glass scale: per 1° Celsius 8.5µm deviation
 230mm optical class scale: Per 1° Celsius 2µm deviation

12.19 Basic Settings

General basic settings

MODE

Choose mode:

- Standard 0
- Electronic Gear 1
- Stepper Control 2
- Coded Prog No (standard) 10
- Coded Prog No (stepper control) 12

INC PER PULSE

Inc. pro Pulse, MODE 2, Puls/Direction controlling.

SYNC RATIO

Ratio of electronic gear

CARD IDENTIFIER

Master/Slave, CANopen, Powerlink
Read form start-up key (2 x binary coded switch)
or set manual if there is no start-up key.



12.20 Version

Overview of hardware and software versions of XENAX®, bus module and SMU module.

XENAX®

Overview of firmware, WebMotion® and hardware version.

BUS-MODULE


Optional bus module with version indication and protocol type.

Mac-address issue with Profinet / Powerlink and EtherNet/IP

If the Mac-address is 0, it misses the Card Identifier.
IP address issue with EtherNet/IP

SMU-MODULE

Optional SMU module with version indication.

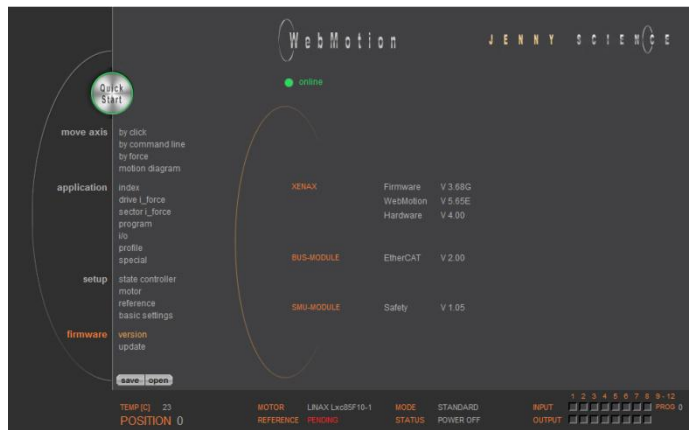


12.21 Update Firmware / WebMotion®

Please also consult the TUTORIAL Video
JSC Tutorial 3: Update Firmware and WebMotion®
 on our website.
 You can follow each step for the procedure online.

Loading new version of firmware and new
 WebMotion® to XENAX® or to bus module or SMU
 module.

The matching software components and hardware
 platforms can be found in the release notes.

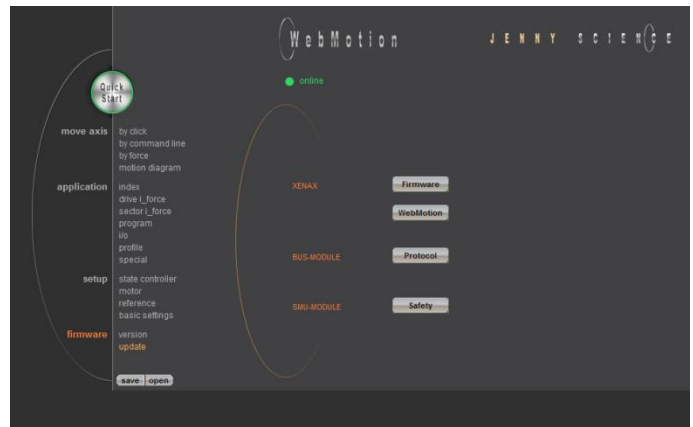

Firmware

Update of firmware. Select the firmware via Explorer
 window via mouse click (*.mot).

The download runs automatically and
 after the installation all functions are available
 immediately.

Recommended procedure of firmware download:

- Save application
- Disconnect PLC-connector and bus module cable if possible.
- We recommend using a point-to-point connection from PC to XENAX®, not via switch.
- After completion of firmware download reset servo controller with command "RES" (reset) in menu *move axis / by command line*
- Reload the application into WebMotion® and download it to servo controller.

WebMotion

The WebMotion® update will be completed with the Lantronix DeviceInstaller (www.lantronix.com/device-networking/utilities-tools/device-installer.html).

Please consult document: "Update_WebMotion" or "Tutorial Video" on www.jennyscience.ch for detailed information regarding the update procedure.

Protocol

Select and download file xx_application.flash

Safety

Select and download file Safety_Vx.xx.smu
 We suggest checking and testing the safety settings after a safety firmware update.

12.22 Save

Saves applications, which contain all from the client saved parameters, data and programs.

to XENAX


saves applications from WebMotion® to XENAX®.

to file

saves applications from WebMotion® to a file on PC/Laptop (Harddisk, Server).

to start-up key

Saves applications in the start-up key to load faster on other XENAX®.

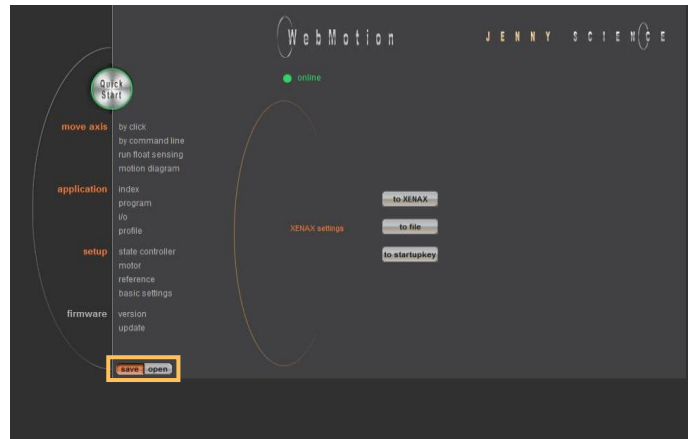


12.23 Open

Opens applications, which contain all from the client saved parameters, data and programs.

from file

loads an existing application from a file to WebMotion®. Data will be stored into XENAX®.

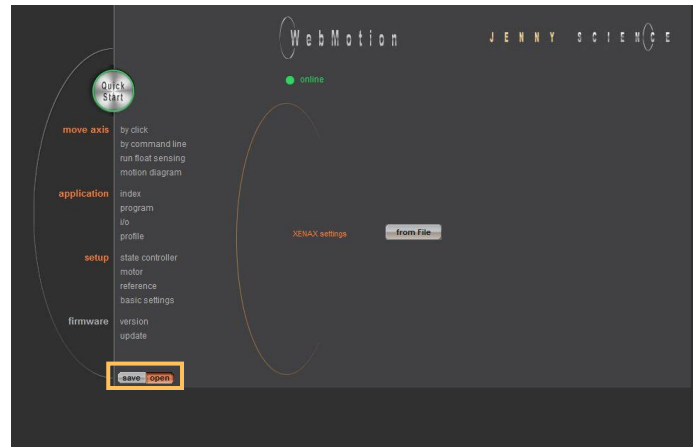


13 Master / Slave

Please also consult the TUTORIAL video **JSC Tutorial 5: Programming of a Pick and Place System with XENAX Master-Slave** on our website.

With the master/slave configuration you can control up to 4 axes with one central program.

Typical applications are handlings modules (pick&place).

The master controls his slave's autonomously in stand-alone operation and can directly be controlled by a superior system over simple I/O signals.

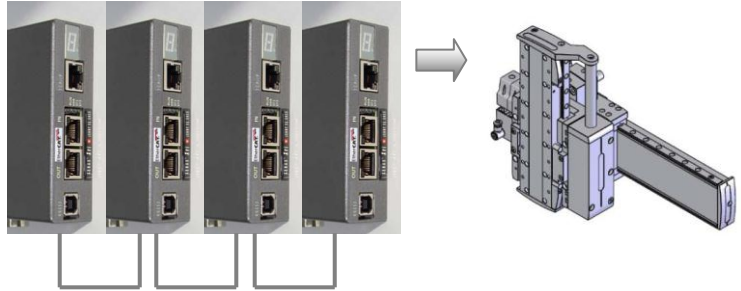

I2C-Bus

13.1 Master/Slave Configuration

Master and slave devices are absolute identical standard Xvi 75V8 servo controllers.

The I2C bus is interconnected via short standard USB patch cables. Both plugs (USB-A) are usable.

No difference between input and output.

The parameter CI (Card Identifier) must be set on the involved devices as follows:

Device	CI	Remote ID	programs
Master	0	LOC (local)	programs
Slave 1	1	REM ID1	-
Slave 2	2	REM ID2	-
Slave 3	3	REM ID3	-

Important:

The program is running on the master servo controller.


On the slaves servo controller must be no programs loaded.

The start-up key functionality is disabled in master/slave configuration and must be disconnected.

13.2 Programming example Pick&Place

X-Axis Master (LOC)
Z-Axis Slave (REM ID1)

1	HOME REFERENCE MARK			
2	HOME REFERENCE MARK		REM ID1	
3	EXECUTE INDEX	3	REM ID1	
4	EXECUTE INDEX	4		
5	EXECUTE INDEX	1	REM ID1	50%
6	EXECUTE INDEX	2		70%
7	EXECUTE INDEX	3	REM ID1	
8	EXECUTE INDEX	1	REM ID1	50%
9	EXECUTE INDEX	4		70%
10	EXECUTE INDEX	3	REM ID1	

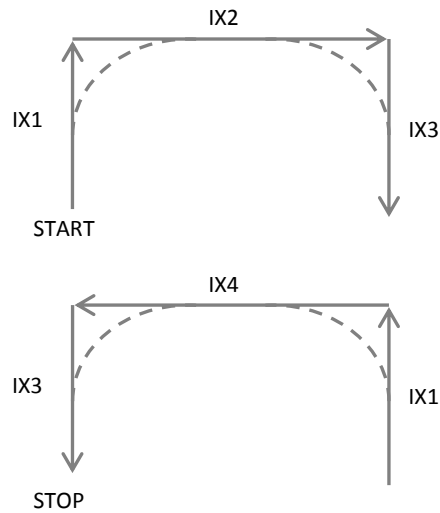

Please note:

All indices and profiles have to be defined exclusively in the master device. After turning on the devices, indices and profiles will be automatically transferred to the slaves.


13.3 Timing Master / Slave

The program interpreter is triggered in 1ms intervals.
The transmission of a command from the master to the slave takes an additional 0.45ms.

The measurement of time critical sequences is possible with the process timer functionality and the commands: "TIMER_START" und "TIMER_STOP". The process time can be read with the command TPT (Tell Process Timer).

14 Gantry Synchronized Mode

In the gantry mode there are two linear motor axes mounted with the same driving direction. Those two axes have to move synchronously. In this example these are the y-axes marked with the arrows.

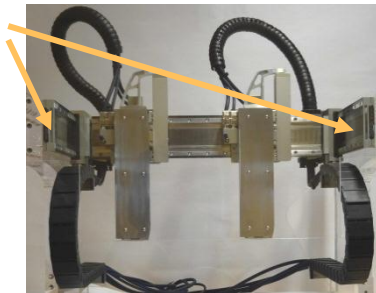

When switching on the system, these two Y-axes have to be aligned in order to move without mechanical tension.

The alignment is automatically completed with the function "REFERENCE". For "REFERENCE" function for gantry systems you will need the following information:

The arrangement of the two linear motor axes
Is driving direction from the mechanical absolute zero point the same for both axes or in opposite direction
In which direction should the reference be completed (parameter DRHR)


The axis with which will be communicated by ASCII commands is the master. The slave has to be connected to the master via A-A cable.

The slave has to be assigned a CARD IDENTIFIER between 1 and 3. This can be done by WebMotion® under "setup / basic / CARD IDENTIFIER" or with ASCII command
CI x (where x = 1-3).

The card identifier (CI) can also be assigned with a start-up key and an address from 1 to 3. When turning on the logic supply the next time, this CI number of the start-up key is set.

The master has to be assigned to the number 0 or a different Card identifier (CI) than its slave.

14.1 Activate Gantry Mode

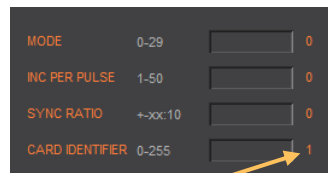


Corresponds to CI

Master-Slave
USB A-A cable



XENAX®	Parameter	Description
SLAVE	CI	Card Identifier
MASTER	DRHR	Direction of reference drive and arrangement LINAX® / ELAX® linear motor axes.
MASTER	GSID	Gantry Slave ID corresponds to CI Slave

Settings WebMotion® only by the Master-XENAX®

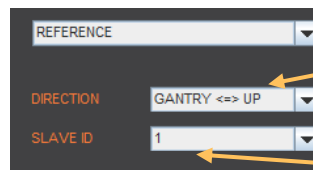

Corresponds to
DRHR

Corresponds to
GSID

The gantry mode is activated with these settings.

14.2 ASCII Commands for Gantry Synchronized Mode

Command	Description
REF	Reference
GP / G	Go Position / Go direct Position
GW	Go Way
IX	Index
PRF	Start profile No. xx
PG	Program
EE*	Emergency Exit
EE1*	Emergency Exit 1
SM	Stop Motion

Can also be triggered as INPUT FUNCTION in the master.
Reference, profile and indices can also be invoked in a program.

Supported by firmware version 3.58 and higher

** EE and EE1 must only be parameterized in a Gantry Master*

15 Force Processes

15.1 Overview FORCE Functions

The force processes of the XENAX® servo controller cover four FORCE functions:

- **FORCE CALIBRATION:** Calibration of the motor through detection of all idle running forces including the payload of the client specific installation on the slide. This creates the basis to precisely determine the external application forces.

- **FORCE LIMITATION:** Driving with limited force to an object or an end position if there are no objects (e.g. inserting parts). Or driving with very little force in order to detect an “object’s touching position”.

- **FORCE MONITORING:** Monitoring the force progression by defining sectors in a force/ way diagram (e.g. inspecting switches). These sectors can automatically be adjusted towards the “object’s touching position”.

- **FORCE CONTROL:** Integration of different FORCE functions into a program. This is how it becomes possible to use the force processes decentrally in the standalone operation mode. Of course these FORCE functions can also be invoked by a superior PLC through Ethernet fieldbus.




15.1.1 Force Calibration

With the patented function „force calibration“ of the XENAX® servo controller, the cogging-, load- and friction forces of the iron core LINAX® and ELAX® linear motor axes from Jenny Science can be detected.

This is how it becomes possible to limit, monitor and control forces in processes.

START: Determining the beginning position of calibration process in increments.

END: Determining the ending position of calibration process in increments.

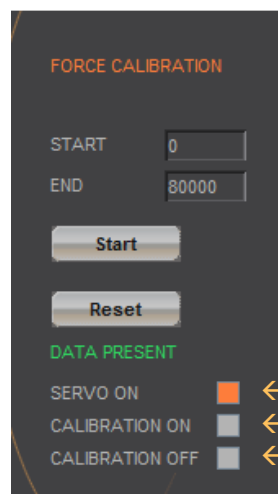

← Normal operation, calibration active
 ← Test calibration active
 ← Test without calibration


15.1.2 Force Limitation

The current value „I_Force“ is proportional to the force.

Following graph shows corresponding relations for the different linear motor types.

LINAX® Linear Motor Axis	Force Constant	Minimal detectable force	Resolution
Lxc F04	1N ~ 50 * 10mA	0.5N	0.25N
Lxc F08	1N ~ 32 * 10mA	0.5N	0.25N
Lxc F10	1N ~ 28 * 10mA	0.5N	0.25N
Lxc F40	1N ~ 11 * 10mA	1N	0.5N
Lxe F40	1N ~ 11 * 10mA	10N	5N
Lxu/Lxs F60	1N ~ 10 * 10mA	10N	5N

ELAX® Linear Motor Slide	Force Constant	Minimal detectable force	Resolution
Ex F20	1N ~ 12 * 10mA	0.5N	0.25N

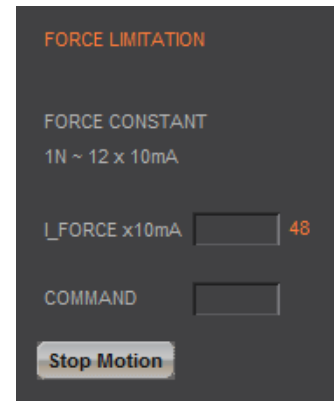

Example:


A compression die should apply no more than 4N force on an object.

Force Limitation with „LIMIT I-FORCE“
 e.g.. ELAX® force constant: 1 N ~ 12 x 10mA
 4 N ~ 48 x 10mA

15.1.3 Force Monitoring

15.1.3.1 Diagram I_Force

In the menu „Diag I_Force“ the way/force diagram can be recorded by which the force progression through the sectors can be verified.

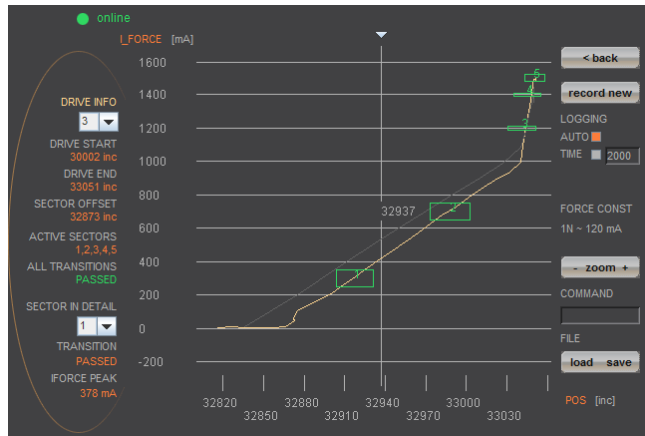


15.1.3.2 Sector I_Force

In the WebMotion® program menu „sector i-force“ up to 10 different force sectors can be defined.


Example:

Once an object is touched the force progression shall be examined in a sector of 150 to 170 Increments. When entering the force sector (“ENTRY”) the force should be between 3 and 4N. When exiting the sector (“EXIT”), the force should have reached 4N. These force specifications are defined with the in the force sector incoming and exiting sector boundaries.

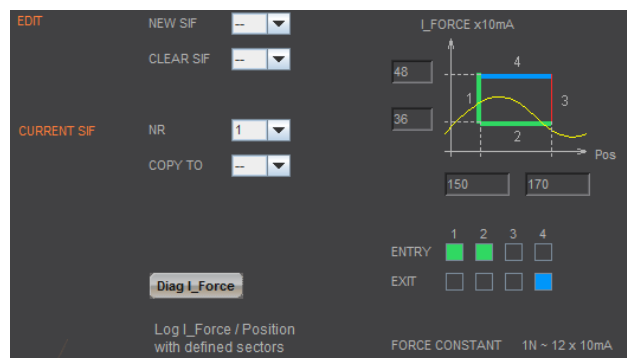


Force Specification Examples:


- 1) Force curve has to pass through sector from the left/bottom side to right/top side.
- 2) Force curve has to pass through sector from the bottom to the top side.
- 3) Force curve has to reach the sector and can pass through incoming and exiting force boundaries multiple times.

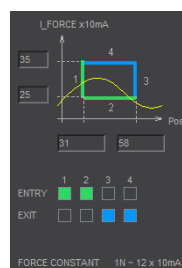

1

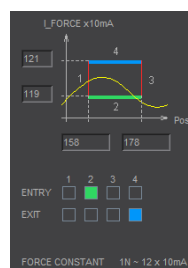

2

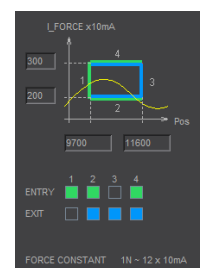

3


Note:

If there are defined incoming and exiting force boundaries, it is absolutely necessary that the force curve passes through them. If there are no incoming force boundaries defined, the force curve has to begin somewhere within the force sector. If there are no exiting force boundaries defined, the force curve has to end within the force sector.

15.1.4 Force Control

15.1.4.1 Program with Force Control Commands

In the WebMotion® menu „program“ the different force functions of FORCE CALIBRATION, FORCE LIMITATION and FORCE CONTROL can be combined and defined with the use of the according commands.

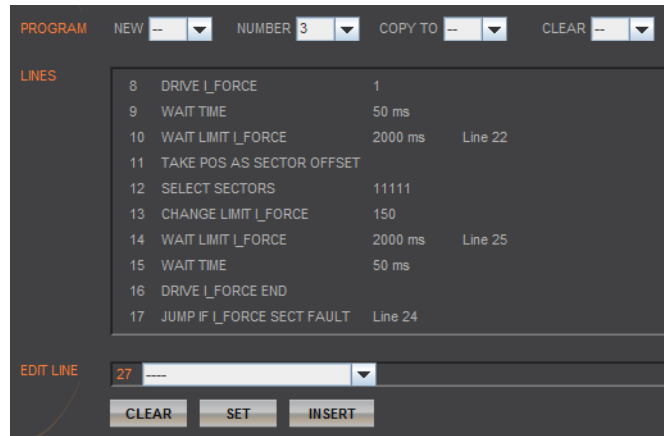


15.1.4.1 Drive I_Force

DRIVE I_FORCE is driving with force consisting of acceleration (ACCEL), speed (SPEED), current (I_FORCE) and driving direction (DIRECTION).

After defining and saving the above mentioned parameters, DRIVE I_FORCE can be included in a program.

Up to 10 DRIVE I_FORCE can be defined.

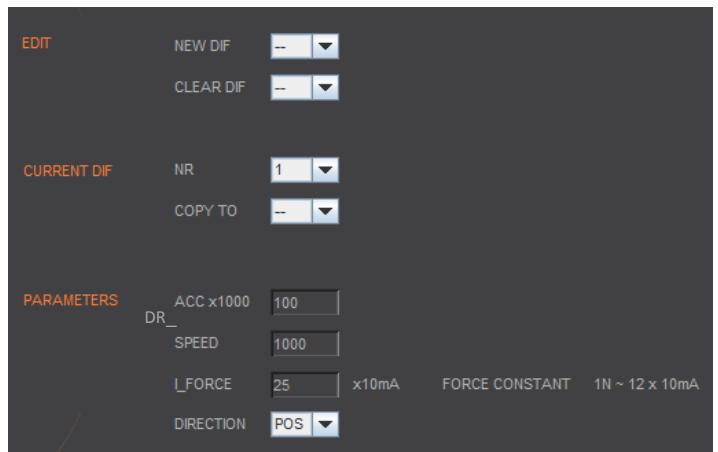

15.2 Integration of Force Processes

15.2.1 XENAX® in Program

15.2.1.1 Programming Commands

Description	Command	Parameter	Master /Slave
Executing Force Calibration, Start Pos xx, End Pos yy	FORCE CALIBRATION	xx, yy	
Execute DRIVE I_FORCE No. xx	DRIVE I_FORCE	xx	
Selection of active sectors with Bit mask. E.g. xx = 1010 → sectors 2 and 4 are active. LSB is on right.	SELECT SECTORS	xx	
Jump to line xx "error handling" if one or more sectors are not passed correctly. Only active sectors are being tested. Caution: Before this analysis can be done, "DRIVE I_FORCE END" has to be completed.	JUMP IF I_FORCE SECTORS FAULT	xx	
Wait until Limit I_FORCE is reached according parameter DRIVE I_FORCE within timeout xx, otherwise jump to line yy „error handling“	WAIT LIMIT I_FORCE	xx, yy	
Changing Limit DR_I_FORCE to xx x 10mA Value of I_FORCE will overwrite the current parameter I_Force in DRIVE I_FORCE until DRIVE I_FORCE END	CHANGE LIMIT I_FORCE	xx	
Is taking the actual position as offset value for all sectors followed by the restart of monitoring. Furthermore the positions "Wait for distance greater/less" and "Jump if distance greater/less" are being adjusted by the offset as well.	TAKE POS AS SECTOR OFFSET <i>(typically touching position , also refer to chapter 15.2.3 Sector Offset for Touching Position)</i>		
Setting offsets for all sectors followed by the restart of monitoring. xx = [Inc] Offset Furthermore the positions "Wait for distance greater/less" and "Jump if distance greater/less" are being adjusted by the offset xx as well. e.g. xx = 0, sets offset incl. TAKE POS AS SECTOR OFFSET to 0	SET SECTOR OFFSET	xx	
Wait for distance (absolute position – Sector Offset) to be greater than xx within timeout frame yy, otherwise jump to line zz „error handling“	WAIT FOR DISTANCE GREATER	xx, yy, zz	
Wait for distance (absolute position – Sector Offset) to be smaller than xx within timeout frame yy, otherwise jump to line zz „error handling“	WAIT FOR DISTANCE LESS	xx, yy, zz	

Description	Command	Parameter	Master /Slave
Jump to line zz if distance xx (absolute position – sector offset) greater than xx e.g driving distance was too big after force was reached	JUMP IF DISTANCE GREATER	xx, zz	
Jump to line zz if distance (absolute position – sector offset) smaller than xx e.g. driving distance was too small after force was reached	JUMP IF DISTANCE LESS	xx, zz	
Wait for input No. xx to be High within timeout frame yy, otherwise jump to line zz „error handling“	WAIT INPUT Nr. HIGH	xx, yy, zz	MS
Wait for input No. xx to be Low within timeout frame yy, otherwise jump to line zz „error handling“	WAIT INPUT Nr. LOW	xx, yy, zz	MS
Wait for process status register Bit xx High within timeout frame yy, otherwise jump to line zz „error handling“	WAIT PROCESS STATUS BIT HIGH	xx, yy, zz	
Wait for process status register Bit xx Low within timeout frame yy, otherwise jump to line zz „error handling“	WAIT PROCESS STATUS BIT LOW	xx, yy, zz	
Stop Drive I_Force, current position = setpoint position, parameter LIMIT DR_I_FORCE inactive	DRIVE I_FORCE END	xx	
Program is being ended and does not proceed to last line. Beneficiary for „error handling“	PROGRAM END		

15.2.1.2 Input Functions Commands

Selection Input Functions

Program exit Stop Motion (if driving) and then exiting the current program	PGEX		
Driving with I_Force No xx [1-10] (pre-programmed)	DIF	xx	

15.2.2 Over Command Set

15.2.2.1 ASCII Commands

Description	Commands	Parameter	MS
Force Calibration xx=0 -> Reset, deleting all calibration values xx= [Inc] -> calibration distance from current position	FC	xx / ?	
(Force Calibration Test) testing force calibration xx=0 -> Servo on, in position control xx =1-> test floating slide in balance with calibration function xx=2-> test slide without calibration function	FCT	xx	
(Drive I_Force) Driving with limited force until reaching an object or the end position if there is no object. xx= [1-10] No. of the selected Drive I_Force parameter set	DIF	xx	
Change Limit DR_I_FORCE to xx x 10mA value xx will overwrite the current parameter DR_I_Force, until DRIVE I_FORCE END	CLIF	xx	
Select sectors which should be active. E.g. xx = 100110-> active are the sectors 2,3,6 Binary from right side LSB	SSEC	xx / ?	
(I_Force Peak) Reads I_FORCE peak value [x1mA] xx=not defined-> Max peak value over all sectors xx=n-> peak value of sector n	IFPK	xx	
(Sectors I_Force curve failed) shows the active sectors which force curve did not correctly pass through E.g. xx = 1001->Error in sector 1 and 4.	SIF	xx / ?	
(Take Position as Sector Offset) Is taking current actual position as an offset for all sectors with restart of monitoring. Furthermore the positions „Wait for distance greater/less“ and „Jump if distance greater/less“ are adjusted by this offset.	TPSO <i>(typically touching position , also refer to chapter 2.3)</i>		
Provide offset for all sectors with restart of monitoring. xx = [Inc] offset Furthermore the positions „Wait for distance greater/less“ and „Jump if distance greater/less“ are adjusted by this offset xx. E.g. xx = 0, sets offset to 0	SSO	xx / ?	

Changing Parameters over ASCII Commands

(Number of Sector for change parameter)
 Selecting sector number for which parameters shall be changed. xx = [1-10] Sector number, NSEC? = Retrieving the selected sector number.

(Sector I_Force Start) start distance of sector
 xx = [Inc] start distance (absolute position – sector offset)

(Sector I_Force End) End distance of sector
 xx = [Inc] ending distance (absolute position – sector offset)

(I_Force Low) lowest value I_Force in pre-selected sector. xx [x10mA]

(I_Force High) peak value I_Force in preselected sector. xx [x10mA]

(Sector transition configuration hexadecimal/decimal)
 Definition of transitions **Entry** and **Exit** in sector
 xx = activated transition 1,2,3,4 Entry/Exit

Bit 15..12	11..8	7..4	3..0	xx
Entry	not used	Exit	not used	
4 3 2 1	0	4 3 2 1	0	Transition
0 0 0 1	0 0 0 0	0 0 1 0	0 0 0 0	bin
1	0	2	0	hex
			4128	dec

(Number of Drive I_Force to change parameter)
 Selecting Drive I_Force number in which parameters shall be changed.
 xx= Drive I_Force number 1-10. NDIF? = Retrieving selected sector number

(Acceleration for Drive I_Force)
 xx [x1'000 inc/s²]

(Speed for Drive I_Force)
 xx [inc/s]

(I_Force Limit while Drive I_Force)
 Limitation of I-Force current while Drive I_Force
 xx [x10mA]

(Direction Drive I_Force)
 xx = 0 ->positive, xx =1 -> negative

(?) = Retrieving possibility of parameter value by adding a question mark to the command. E.g >NDIF? -> 2

NSEC xx / ?

Deriving commands:
 SIFS, SIFE, IFH, IFL, STC, STCX


SIFS xx / ?

SIFE xx / ?

IFL xx / ?

IFH xx / ?

STCX (hex) xx / ?
 STC (dec)

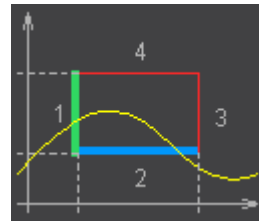

NDIF xx / ?

Deriving commands:
 IDIF, DDIF, SDIF, ADIF

ADIF xx / ?

SDIF xx / ?

IDIF xx / ?

DDIF xx / ?

15.2.3 Sector Offset for Touching Position


Typically an object is first touched. All following functions then relate to this touching position. Depending on the size tolerance of the objects, this touching position differs from object to object.

The touching position can very simply be detected with „Drive I_Force“ (by using little force). The command “TPSO” (Take IST-Position as Sector Offset) will take this touching position as sector offset for all functions that follow.

In order to determine the value „Sector I_Force Start“ and „Sector I_Force End“ it is simplest to record the force curve and to calculate the distance to touching position (absolute position – Sector Offset).

“Sector I_Force Start”, “Sector I_Force End”, “Wait for Distance greater/less” and “Jump if Distance less” are distances relative to the touching position (sector offset).


With „SSO“ Set Sector Offset = 0 the distances correspond to the absolute positions.

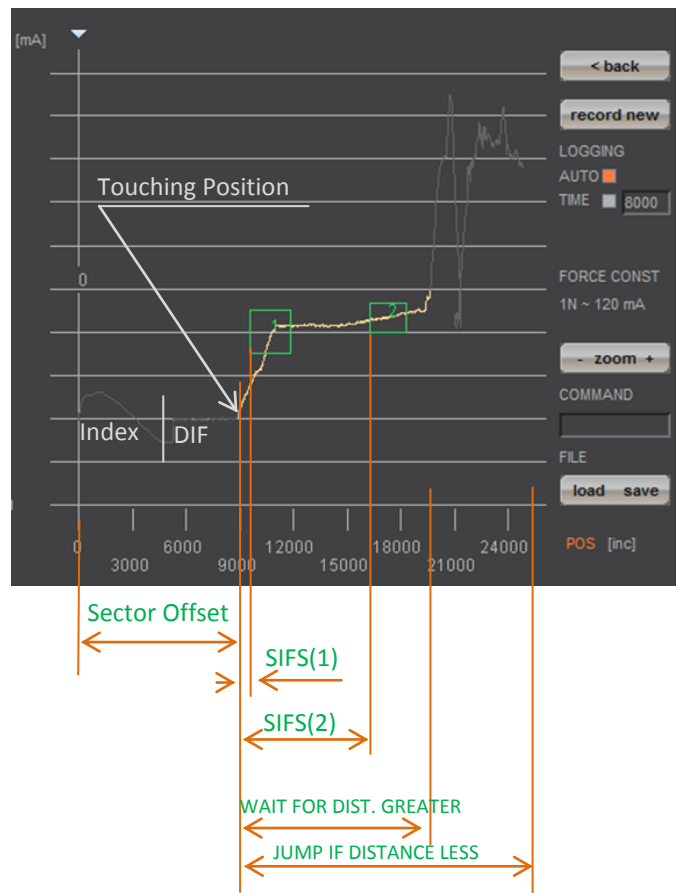


15.3 Application Example

A force sensor consisting of a little mounting plate, ceramic and strain gauge elements glued on the top shall be tested upon its functionality.


The force sensor measures the external force applied to the small ball (upper left corner in picture).

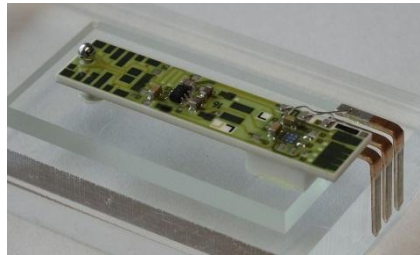

With the ELAX® linear motor slide and the XENAX® servo controller the ball shall be touched and the touching position detected. The touching position is the offset of the actual force curve measurement. This offset compensates the height tolerances of the different measuring objects.

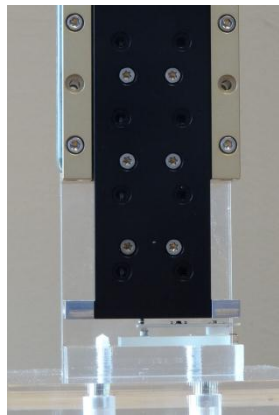

After touching position, the force curve of the ceramic plate shall be recorded. After an air gap of only 200 µm, the ceramic plate hits the rubber buffer. At this position the force increases steeper as the rubber buffer acts against the ceramic plate. The maximal force is limited to approximately 12N ~150 x 10mA. Of interest is the increase in force while the plate is bending and the position where the force curve is making a kink upwards when hitting the rubber buffer. For this example, five different sectors are defined on the force-/way curve, which have to be passed correctly.

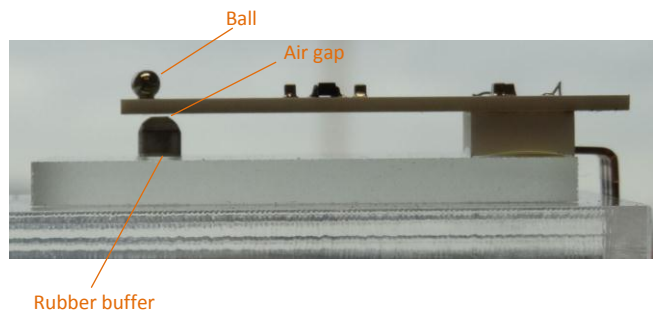

Hereinafter you can find the according program example 1) as stand-alone version programmed and stored in the XENAX® servo controller 2) as Ascii command set controlled via a superior controller.

15.3.1 Programming Force Process in XENAX®

Input / Output Interface Definition

INPUT FUNCTIONS:

- Input 1 = Program 1, Referencing and drive to position 0
- Input 2 = Program 2, Force Calibration of ELAX® linear motor slide
- Input 3 = Program 3, Entire test process including analysis

OUTPUT „STATUS“

- Output 1 = No touching position found → No test object available
- Output 2 = Error of test object
- Output 5 = Test object OK.

INDEX, DRIVE I_FORCE und SECTORS

Drive INDEX 1 to 0Inc. absolute
(1Inc = 1µm)

```
***** Index 1*****
Acc x1000 = 1000
Speed = 100000
Dist = 0
AbsRel = 1
```

Drive INDEX 2 to 30'000Inc. absolut


```
***** Index 2*****
Acc x1000 = 1000
Speed = 100000
Dist = 30000
AbsRel = 1
```

Drive with Force, Force on 0.5N in order to recognize touching position.
(1N = 12 x 10mA)


```
***** Drive I_Force 1 *****
Acc x1000 = 100
Speed = 5000
IForce x10mA = 6
Direction = 0
```

In order to determine the following sector parameters, we recommend the following approach:


1. Drive towards test object (Drive I_Force) with little force (e.g. 0.5-1.0N) and remember the touching position (offset corresponds to the position at arrowhead)
2. Record Force/Way diagram of a correct test object. Then place the testing sectors according to the force curve and retrieve parameters. For Sector I_Force Start/End the offset has to be subtracted of the touching position.

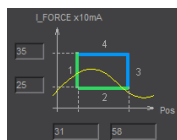


```
***** Sector I_Force 1 *****
Sector IForce Start = 31
Sector IForce End = 58
IForce Low x10mA = 25
IForce High x10mA = 35
Sector Transit Config = 12480
```

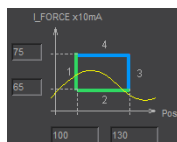


```
***** Sector I_Force 2 *****
Sector IForce Start = 100
Sector IForce End = 130
IForce Low x10mA = 65
IForce High x10mA = 75
Sector Transit Config = 12480
```

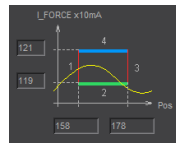

***** Sector I_Force 3 *****
Sector IForce Start = 158
Sector IForce End = 178
IForce Low x10mA = 119
IForce High x10mA = 121
Sector Transit Config = 8320

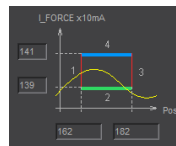

***** Sector I_Force 4 *****
Sector IForce Start = 162
Sector IForce End = 182
IForce Low x10mA = 139
IForce High x10mA = 141
Sector Transit Config = 8320

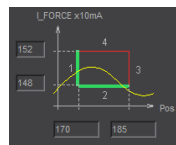

***** Sector I_Force 5 *****
Sector IForce Start = 170
Sector IForce End = 185
IForce Low x10mA = 148
IForce High x10mA = 152
Sector Transit Config = 12288

No „EXIT“
Ending position has to be in sector.

Referencing and driving to position 0, INDEX 1

***** Program 1 *****
Line 1 REFERENCE
Line 2 INDEX 1, DEVICE = LOCAL COMPLETION = 100%

Calibration of linear motor slide by recording all forces
(cogging, friction, weight etc.)

***** Program 2 *****
Line 1 FORCE CALIBRATION POSITION START = 0 POSITION END = 50000

Entire testing process with analysis of result

***** Program 3 *****
Line 1 CLEAR OUTPUT 1 M/SLAVE DEVICE = LOCAL
Line 2 CLEAR OUTPUT 2 M/SLAVE DEVICE = LOCAL
Line 3 CLEAR OUTPUT 5 M/SLAVE DEVICE = LOCAL
Line 4 SET SECTOR OFFSET POSITION = 0
Line 5 SELECT SECTORS 0

Reset output status display

Initializing sector offset to 0 (not mandatory)
Selected sectors 0 (not mandatory)

Line 6 INDEX 1 LOCAL COMPLETION = 100%
Line 7 INDEX 2 LOCAL COMPLETION = 100%
Line 8 DRIVE I_FORCE 1
Line 9 WAIT TIME TIME [ms] = 50
Line 10 WAIT LIMIT I_FORCE TIMEOUT = 2000ms LINE = 23
Line 11 WAIT TIME TIME [ms] = 20
Line 12 TAKE POS AS SECTOR OFFSET
Line 13 SELECT SECTORS 11111

Drive to position 0, all the way to the top
Drive to position 30000, fast driving to pre-position
Drive to touching position with little force (0.5N)
Short wait time, in case the force has been exceeded while
accelerating (when using little forces).
Wait until LIMIT I_FORCE is reached. If there is no touching
position during timeout frame, jump to error
“no object in place”, output 1 ON
Short wait time in order to stabilize touching position
Takes touching position as offset for the following tests
Selecting sectors 1-5

Change I_FORCE forcurrent Drive I_Force from, 6 to 150 =
12.5N
Timeout in case that force is not reached, then no output no 5.
Short wait time after force reaches limit to “stabilize”.


Line 14 CHANGE LIMIT I_FORCE I_FORCE = 150
Line 15 WAIT LIMIT I_FORCE TIMEOUT = 2000ms LINE = 26
Line 16 WAIT TIME TIME [ms] = 20
Line 17 DRIVE I_FORCE END
Line 18 JUMP IF I_FORCE SECT FAULT LINE = 25
Line 19 SET OUTPUT 5 M/SLAVE DEVICE = LOCAL
Line 20 SELECT SECTORS 0
Line 21 INDEX 1 LOCAL COMPLETION = 100%
Line 22 PROGRAM END

Drive I_Force ends
Testing the selected sectors, in case of an error, jump to error
output 5 ON, meaning testing object OK

Line 23 SET OUTPUT 1 M/SLAVE DEVICE = LOCAL
Line 24 GOTO LINE 26
Line 25 SET OUTPUT 2 M/SLAVE DEVICE = LOCAL
Line 26 DRIVE I_FORCE END
Line 27 INDEX 1 = LOCAL COMPLETION = 100%

15.3.2 Force Process with ASCII Commands

Download the determined sector parameters into XENAX® servo controller. There are 5 sectors all in all.

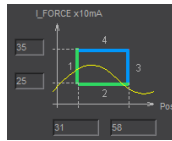

Below you find the description for sector 1. Sectors 2-5 are structured in the same way.

Pre-selection of sector number
Sector I_Force Start [Inc]
Sector I_Force End [Inc]
IFL I_Force Low [x10mA]
IFL I_Force High [x10mA]
Sector Transition Configuration


Parameter Sector 1 laden
>NSEC 1
>SIFS 31
>SIFE 58
>IFL 25
>IFH 35
>STC 12480

In order to be able to see those parameters in the webbrowser under "sector i_force", the site has to be re-loaded. This is how the values are transferred from the XENAX® to the Webbrowser.

Calculate STC parameter with Win Calc (view of programmer)

Decimal value can be negative if highest Bit, Entry 4 is set.

Bit 15..12	11..8	7..4	3..0
Entry	not used	Exit	not used
4 3 2 1	0	4 3 2 1	0
0 0 1 1	0 0 0 0	1 1 0 0	0 0 0 0

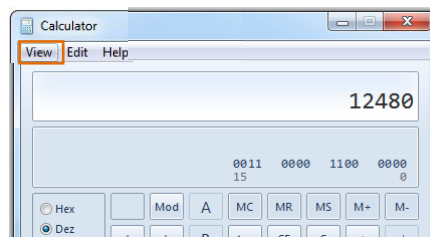

Program

Referencing Axis
Drive to position 0

>REF
>G 0

Remove test objects, axis has to drive without obstacles.
Execute Force Calibration from 0 until 50000 Inc (one-time)
Old calibration values are deleted beforehand.

>FC 50000

*Force Calibration test, if slider is floating / in balance (optional)
Back to position control (optional)*

>FCT1
>FCT0

Sector Offset is set to 0 (optional)

>SSO 0

Selection of active sectors of 0. Only to be activated before test drive, so the analysis SIFF is correct.
Drive to position 30'000 Inc

>SSEC 0
>G 30000

Reduce Deviation Position, so the internal calculated desired position does not deviate too much from the actual position of Drive I_Force.
Otherwise the slide would jump in position when I_Force is increased. Only needed when there are long timeouts after Drive I_Force is reached.

>DP100

Drive I_Force 1 moves to touching position
Take Position as Sector Offset (touching position)
Activate sectors 1-5
Change Limit I_FORCE to 150 x 10mA
Verify tell process status registry, Bit 5 „IN FORCE“

>DIF 1
>TPSO
>SSEC11111
>CLIF 150
>TPSR

Stop Drive I_Force with Stop Motion
Shows faulting sectors. Response should be 0
Reset Deviation Position to old value
Drive to position 0

>SM
>SIFF?
>DP1000
>G 0

15.3.2.1 PSR Prozess Status Register

Bit coded process status, return string displays three bytes
in HEX format.

ERROR = BIT 0

REF = BIT 1

IN_MOTION = BIT 2

IN_POSITION = BIT 3

END_OF_PROGRAM = BIT 4

IN_FORCE = BIT 5

IN_SECTOR = BIT 6

FORCE_IN_SECTOR = BIT 7

INVERTER_VOLTAGE = BIT 8

END_OF_GANTRY_INIT = BIT 9

LIMIT_SWITCH_LEFT = BIT 10

LIMIT_SWITCH_RIGHT = BIT 11

EMERGENCY_EXIT_1, REMAIN POWER ON = BIT 12

*(Function can only be used **without** bus module. If used **with** bus module apply "EMERGENCY_EXIT").*

EMERGENCY_EXIT, POWER OFF = BIT 13

FORCE_CALIBRATION_ACTIVE = BIT 14

I_FORCE_LIMIT_REACHED = BIT 15

STO PRIMED/HIT = BIT 16

SS1 PRIMED/HIT = BIT 17

SS2 PRIMED = BIT 18

SS2 HIT = BIT 19

SLS PRIMED = BIT 20

SLS SPEED HIT = BIT 21

SLS POSITION HIT = BIT 22

WARNING = BIT 23

DISPLAY INFO ONLY = BIT 24

Tell Process Status Register **TPSR**

16 Operating Status on 7-Segment Display

Description	Display
No firmware, operating system is active	F
Firmware active, servo controller OFF	0
Servo On, control loop closed	1
Error refer handling)	xx flashing
Supply voltage too high >27VDC (e.g. if 48V logic power is used). The logic is protected (from HW 3.00) and won't be activated.	none



17 Error Handling

Errors are displayed on the XENAX® servo controller's 7-segment display by flashing a two digit number. With the command „>TE“ (Tell Error) they can be retrieved.

There are 3 different categories to differentiate:

Information	No 0-39
Warnings	No 40-49
Errors	No 50-99

They do not change state of the servo controller. These are simple status indicators.

They can trigger a stop of an active drive (e.g. driving in soft limit). However, the drive can then be continued without the need to switch off the output stage.

Always cause the output stage to switch off. The drive can only be continued after troubleshooting.

The first information/warning/error is always displayed first. A possible follow-up error won't be displayed. Each warning can overwrite information and each error can overwrite a warning or information. The error history can be retrieved with AXII command TEB.

17.1 Error Codes

F-Number	Description	Note
01 to 12	Waiting for input xx (Low od. High)	Keeps driving, if status has been reached or restart with HO, REF, SM, or PQ, PWC.
20	Command not allowed	Command is not allowed when bus module is active
30	I Force Max reached	Force proportional motor current reached "Limit I_Force Value" (LIF). Motor current was limited to "Limit I_Force Value". A possible detected error 50 (position deviation to large) is suppressed.

F-Number	Description	Note
40	Driveway limitation due to soft limit values.	Warnings Soft limits can be adjusted in WebMotion® in menu „move axis / by click“.
41	Limit switch right / left active	Limit switches are defined as input function LL / LR.
42	Remote Controller Command rejected	One of the slave axes has an error or command for the slave could not be executed
43	Remote Controller not recognized	Master Slave configuration: Not all remote controllers defined in the master were recognized. The programs in the master have to be checked and the invalid remote controllers (Rem ID) have to be deleted.
44	Remote controller communication error	Please check Master/Slave cables
45	AD Offset Error	The AD-Offset for measuring the current could not be retrieved correctly during the first drive. The linear motor has to be turned off while the output stage is turned on for at least 0.5s, so the AD-Offset can be retrieved correctly.
46	Cyclic data are not valid	Cyclic data specified via the bus modules are not valid. Check the Data S-Curve, Deviation position, Deviation Target position, I Force Max, Speed and Acceleration.
50	Position deviation is too large.	Errors The difference between the internal calculated position and the present motor position (encoder) is larger than the value defined as DP (deviation position) in Closed Loop setup. Refer to chapter 17.2 Notes for Error 50
54	Excessive rise of temperature too over-temperature or weak signal of LINAX® read head	Temperature rise too high/fast. The signal in the detector head of the measuring system is too weak or. Clean glass scale on LINAX® linear motor.
55	Excessive rise of temperature too over-temperature	Temperature rise too high/fast. Check our drive profile.
60	Over-temperature power stage	If temperature, measured with temperature sensor in power stage, power stage will be switched off.
61	Overvoltage of power supply	Power supply voltage or retarding energy from motor too high.
62	Ballast circuit active for too long	The ballast circuit is active for more than 5 sec continuously. Retarding energy is too high or the power supply voltage is too high.
63	Over-temperature LINAX®/ ELAX®	Coil temperature above 80° in LINAX® / ELAX® linear motor. Power stage will be switched off.
64	Under voltage of power supply	Motor power supply voltage is too low. The power supply probably is not able to deliver temporary demanded peak current exposure.
65	Field adjustment on the magnet poles	The adjustment on the magnet pole was not successful, travel-plate of LINAX®/ELAX® or rotor of a rotary motor is blocked or encoder / motor cable is broken. If at multi-axis applications, all servo controllers show error 65, then the D-sub encoder connector is unplugged at one axis.
66	REF error	Push the travel-plate by hand to a “free range” and try “REF” again
67	Z-Mark distance failure	The measured distance of coded reference marks are not plausible. Execute “REF” again.
68	Velocity too high during REF	Execute REF again. Maybe increase of nominal current needed. Could be consecutive fault of vector field adjustment on the magnet pole.
69	Error HALL signal	Error in the consecutive order of HALL-signals, check Encoder cable.
70	Over-current power stage	Potential short circuit or accidental ground in motor cable / coils. Or short circuit in 24V I/O to GND
71	Power stage disabled	Release signal via PLC I/O Pin 9 not present (if activated) or power stage is disabled by Safe Motion Unit (SMU)
72	Speed is too high	Maximal speed. For 100nm measuring option = 9'000'000 inc/s = 0.9m/s
73	Over-temperature (I2T)	I2T calculation has detected over-temperature in the coil I2t.


F-Number	Description	Note
74	Electrical Angle Failure	The calculated electrical angle differs more than 40° from the estimated angle. Interrupt power and execute REF again. Cleaning the measuring scale might also be necessary.
75	Reference pending	REF has to be executed before motor can move
76	Gantry Master Salve Offset	Difference between automatically measured Gantry Master Salve Offset and pre-set value through PGMSO great than 0.5mm
77	Bus module or serial port communication error	Depending on the operation mode, please check communication between servo controller and bus module or communication over serial interface (RS232/Ethernet). For communication over serial interface adjust Watchdog time if necessary (command „WD“)
79	Wrong checksum of calibration data	Force calibration or position of mechanical limit wrong. Restart “Force calibration” (ASCII: fcxx) or “mechanical limit calibration (ASCII: mlc).
80	Over-current PLC Output	One or more outputs of PLC interface outputs in 24V source configuration were overloaded. $I_{max_{out}}=100mA$ per channel.
81	Master / Slave	One of the Slave axes reports an error or the command for the Slave axis was not able to be completed.
82	Communication error I2C bus to the motor	Check encoder and extension cables. Connect cable shields on servo controller and motor with GND. Check Master / Slave cables
83	Internal FRAM error	Permanent data storage not possible ¹⁾
84	Start-up key error	Test with other key. Functionality in master-slave mode not supported.
85	I2C switch error	Test without master-slave cables.
86	wrong checksum of application data	This Error is possible after firmware download. Execute reset (RES)
87	Remote controller missing	Master Slave configuration: One or more remote controllers defined in master are missing. Check master programs for nonexistent controllers (RemID) and delete them out of programs.
88	General I2C error	Check the cable to the motor.
89	SMU error	Communication error with the safety motion unit. Details to cause and correction are given by WebMotion® as soon as error occurs. Please refer to chapter 17.3 Notes for Error 89
90	Functional Safety active	The SMU module has turned off power stage. Chosen to cause small ED (Emergency Deceleration).
92	3- Phase Output frequency > 599Hz	The output frequency of the 3-phase motor is over 599Hz. There are only movements allowed, which do not lead to an output frequency of >599Hz.
93	Encoder plausibility	The encoder signals are not plausible. Possible causes: Encoder cable of motor might not plugged in, interruption of strands in the encoder cable, or encoder signals are led asymmetrically only. When encoder signals are led asymmetrically by intention for rotary motors, the encoder plausibility check can be turned off (refer to SCII command ENCPD).
97	Interlaced warnings	A new warning occurred before the state which led to the previous warning was cleared. Please make sure process is setup in a way where warnings cannot interlace (e.g. drive in soft limit and then drive in limit switch, before soft limit was left).
„L“	Level I2C Bus	The Level of the I2C bus is not ok. Bus is blocked. Rotary motor connected to a XENAX® controller with linear axis setup (DIP Switch)? Or servo controller encoder connector defect. Test encoder: disconnect encoder; if XENAX® starts normally, connector is defect. If still not working, please contact Jenny Science for support: website www.jennyscience.ch .
„n“	Level I2C Bus	I2C bus response is „nak“ (not acknowledged) No communication on I2C bus, XENAX® internal or LINAX®/ELAX®, temperature check is not possible.

¹⁾ Internal hardware failure of the device, please contact Jenny Science

17.2 Notes for Error 50

Error 50 means that deviation from position target value to actual position value is higher than „DEVIATION POS“ (→ *WebMotion®*, *setup, state controller*).


There are different possible causes which lead to this error. Please check the following:

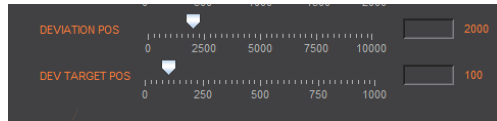

Status Display XENAX® WebMotion®

When the carriage slider of a linear motor axis or the rotary linear motor is being moved by hand, the position encoder counter has to adjust accordingly. If not check cable, signal encoder (check A/A* and B/B*).

 Test POSITION Encoder counter



If a shaft of a rotary motor is being turned clockwise (when looking at front shaft), the POSITION encoder counter has to count positive. When turned counter clockwise, the POSITION encoder counter has to count negative. Compare to chapter 4.2.5 “Definition of Rotating Direction for Servo Motors”.

Check parameters in setup

I STOP	sufficient?
I RUN	sufficient?
DEVIATION POS	2000 (Default)
DEVIATION TARGET POS	100 (Default)

Check power supply unit

Are there enough voltage and enough power supply available?

For LINAX® field adjustment

Lxc F04 at least 5,2A

Lxc F08 at least 6,1A

Lx F10 at least 5,5A

Lx F40 at least 6.0A

Lx F60 at least. 8.0A

For ELAX® field adjustment

Ex F20 at least 5,5A

When using LINAX® linear motor axes and ELAX® electric slides, we suggest executing the Quick Start function with automatic system-check.

Test of brushless servo motors for hall signals encoder A/B and motor phase (wiring and colors).

There is no common standardization for servo motor connectors. Jenny Science is happy to support you during the setup process.

Test if motor is running at low velocity

With WebMotion®


Menu Motion:
 S-CURVE 20%
 AC (x1'000) 100
 SPEED 10'000
 Power
 Rep Reverse 10'000

Menu Terminal:


SCRV20
 AC100000
 SP10000
 WA10000
 PWC
 RR100

17.3 Notes for Error 89

 The Fault description would be shown in the WebMotion®.




Click on the Button „ERROR 89“ and the window would be open.

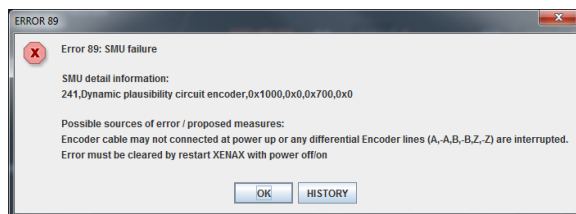

The Fault description without WebMotion®

Open a terminal program and give in the command „TESM“.

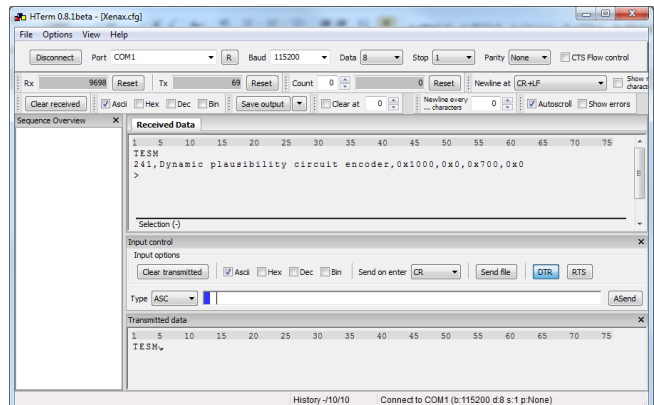

		CPU	
200	RAM/Address test		Restart XENAX® ¹ .
201	Flash memory test		Restart XENAX® ¹ .
202	stack overflow		Restart XENAX® ¹ .
203	program sequence		Restart XENAX® ¹ .
204	data flash problem		Load the parameter again ¹ .
205	oscillator drift/stop detection		Restart XENAX® ¹ .
		Communication	
210	host communication, external supervising, watchdog		Restart XENAX® ¹ .
211	internal communication, internal supervising		Restart XENAX® ¹ .
		Cross checks	
220	data consistency/checksum master/slave		Load the parameter again ¹ .
221	speed cross compare		Restart XENAX® ¹ .
		Software checks	
230	acceleration plausibility		Restart XENAX® ¹ .
231	speed calculation interrupt		Restart XENAX® ¹ .
232	firmware version not compatible		Load the SMU firmware again. ¹
		Hardware checks	
240	dynamic safety inputs		Error by self-check from the safety inputs Restart XENAX® ¹ .
241	dynamic plausibility circuit encoder		Error by self-check by the encoder signal check. Possible unplugged encoder cable. Restart XENAX® ¹ .
242	enable feedback test		Error by self-check by Enable Enable-feedback signal. Restart XENAX® ¹ .
243	plausibility digital signal		Invalid state of one or more encoder signals. Check encoder cable, possible cable break. Restart XENAX® ¹ .
244	plausibility analogue signal		Invalid voltage difference of one or more encoder signals. Check encoder cable, possible cable broken. Restart XENAX® ¹ .
245	encoder cable disconnected		Unplugged encoder cable on XENAX®. Problems with the signal connecting. Restart XENAX® ¹ .
246	faulty input states		There is only one Input from the safety active. It must be always two Inputs activated for safety. Restart XENAX®.
247	power active input test		Pin 9 is activated in XENAX®, this Input should not be used with the SMU
248	scale failure		Rotative motors: no Hall signal Linear motors: - Dirty measuring system or head - problem with the hall signals, check the encoder plug Restart XENAX® ¹ .
249	overcurrent failure		Equivalent to 70 errors on the XENAX®, has been found only on the SMU. Restart XENAX® ¹ .
250	overtemperature failure		Equivalent to 60 errors on the XENAX®, has been found only on the SMU. Restart XENAX® ¹ .
251	enable power failure		Invalid state of the enable signal for the output stage. Restart XENAX® ¹ .
252	motor data failure		Motor data has not been transmitted to the SMU. Possibly communication problems with the SMU. Restart XENAX® ¹ .

¹⁾ Internal hardware failure of the device, with repeated appearance please contacts Jenny Science

17.4 Arbitrary Display on 7-Segment

After turning on the logic supply (24V), typically a "0" appears on the display. The green LED of the RJ45 connector lights up green when using active Ethernet connection.



If there is an arbitrary sign e.g. "8." or if the display is flickering, there are the following causes possible:



17.4.1 Defective adapter for logic supply

For the logic supply the adapter should deliver 24V DC and at least 300mA. Provides the adapter 24V DC for the logic as well as the power, 5A are required.


Measure logic supply (24VDC), change adapter if necessary.

17.4.2 Defective Firmware

If a wrong or corrupt firmware data was loaded or another cause:

Delete XENAX® with DIP switch firmware recorder and start boot loader:

- DIP switch 2 ON
- Logic supply ON, firmware recorder is being deleted, wait until „F“ on display, logic supply off, DIP switch 2 OFF
- Logic supply ON, display „F“ → boot loader active, Ethernet connection to PC/Laptop and load new firmware with WebMotion®.

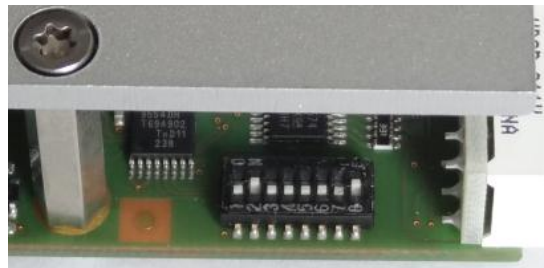

17.4.3 GAL contact problems, only with hardware <=2.0

Remove and re-insert GAL.
It is also possible that there is a faulty capillary joint on the GAL pedestal.



Note

This instruction manual contains copyright protected information. All rights are reserved. This document may not be in its entirety or partially copied, duplicated or translated without the prior consent of Jenny Science AG.

Jenny Science AG grants no guarantee on, or will be held responsible for, any incidents resulting from false information.

Information in this instruction manual is subject to change.